

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103

June 19, 2008

RECEIVED

DEC 17 2010

HOBBS

CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-33597
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
8. Well Number 680
9. OGRID Number 5380
10. Pool name or Wildcat Eunice Monument; Grayburg-San Andres
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3582' GL

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐	2. Name of Operator XTO Energy, Inc.
3. Address of Operator 200 N. Loraine, Ste. 800 Midland, TX 79701	4. Well Location Unit Letter H : 1490 feet from the North line and 185 feet from the East line Section 7 Township 21S Range 36E NMPM County Lea
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3582' GL	

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: Reactivate and Test Well ☒

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. MIRU PU, MI & rack 4100' of 2-7/8" WS, ND WH, NU BOP.
2. PU & RIH w/4-3/4" bit & Dcs on 2-7/8" WS, MIRU rev unit.
3. DO CIBP @ 3748' and CO to 3980', circ hole clean, POOH
4. RIH w/5-1/2" CIBP & 5-1/2" pkr on 2-7/8" WS to 3970', set CIBP @ 3970', test to 300psig
5. RIH w/csg gun, perf Penrose 3750-3755' (5', 15 holes), Grayburg I 3770-3784' (14', 42 holes) & 3790-3816' (26', 78 holes), RD
6. Acdz all perfs w/4000gls 15% NEFE 90/10 & 3000# rock salt in 4 stgs
cont'd on next page

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Patty Urias TITLE Regulatory Analyst DATE 10/1/10
Type or print name Patty Urias E-mail address: patty_urias@xtoenergy.com PHONE 432-620-4318


For State Use Only

APPROVED BY [Signature] TITLE PETROLEUM ENGINEER DATE DEC 17 2010
Conditions of Approval (if any):

Eunice Monument South Unit #680
C103 – cont'd

7. Release pkr & RIH & retrieve RBP. PUH to 3825' and set RBP. Test tools and PUH to 3700' and set pkr
8. Test lines to 4000psig. Breakdown intervals 3750-3755', 3775-3784' & 3790-3816' w/2500gls 15% NEFE 90/10, flush to bottom perf
9. RDMO acid company and shut well in for 2 hrs
10. Release pkr, RIH & retrieve RBP, POOH & LD WS, pkr & RBP.
11. PU & RIH w/prod tbg, land SN @ 3900', ND BOP, NU WH, RIH w/rods & pmp designed for 500bfpd or better estimate based on swab results.
12. RWTP, put well in test, RDMO PU.

EUNICE MONUMENT SOUTH UNIT #680 "PROPOSED" WELLBORE

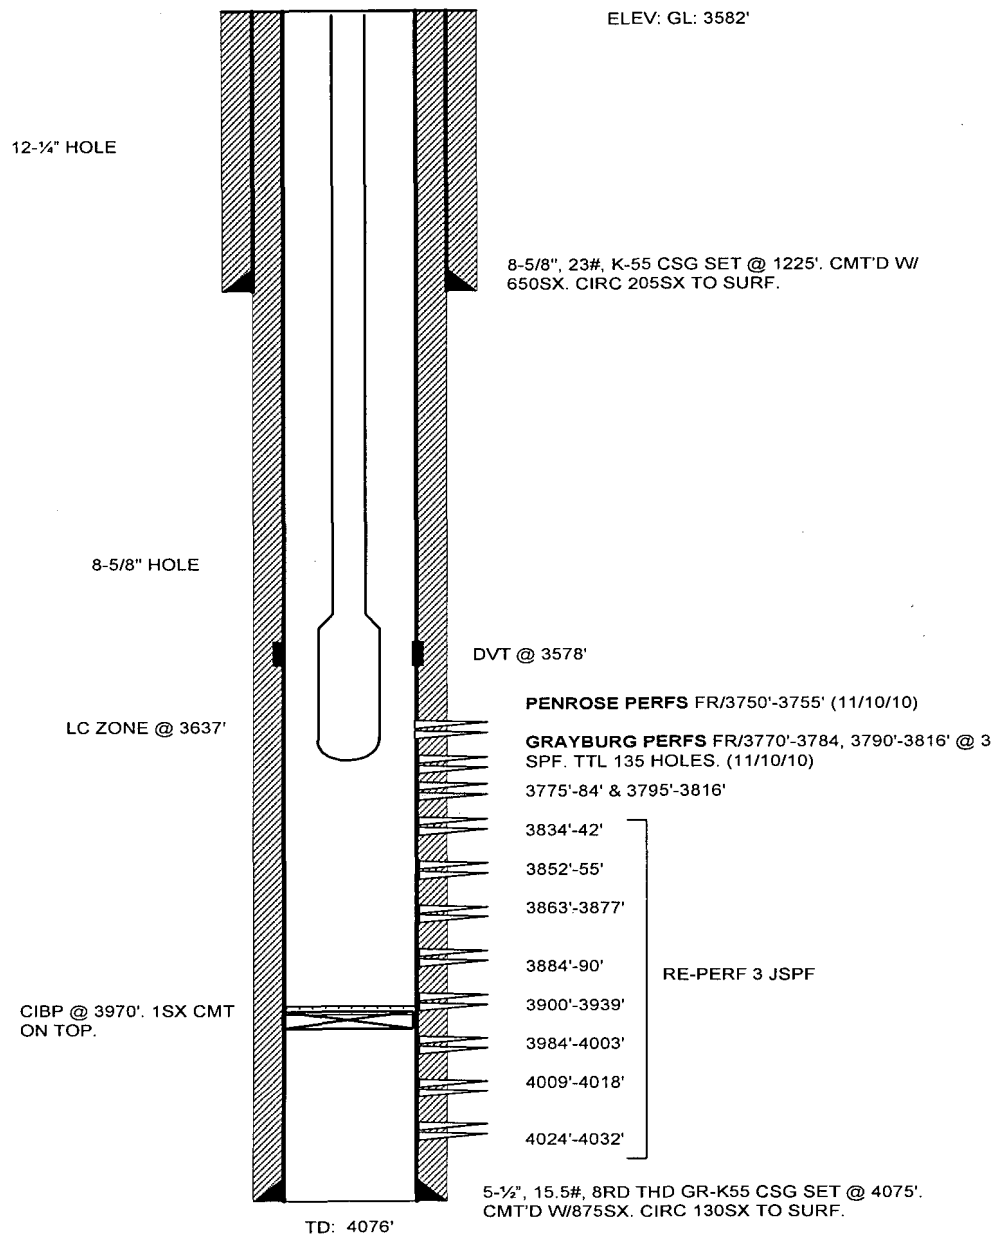

EUNICE MONUMENT SOUTH UNIT #680
"CURRENT" WELLBORE

