

Submit 3 Copies To Appropriate District
Office
District I
✓ 1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised May 08, 2003

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-12011
5. Indicate Type of Lease STATE ☐ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Eaves A
8. Well Number 5
9. OGRID Number 021355
10. Pool name or Wildcat Scarborough

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other

2. Name of Operator Southwest Royalties, Inc.

3. Address of Operator P.O. Box 11390, Midland, Texas 79702

4. Well Location

Unit Letter K : 1980 feet from the South line and 1980 feet from the West line

Section 19 Township 26S Range 37E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
2946'

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

*Notify the BLM of P&A commencement and RU plugging rig.

1. RIH w/tbg and tag up on CIBP set @ 2900' (set 2/14/01). Cap CIBP w/35' cmt. Mix and pmp 9.5# mud laden fluid - circ hole.
2. Mix and spot 30 sx of class "C" cmt from 1700' - 1500'.
3. Mix and spot 30 sx of class "C" cmt from 1300' - 1100'.
4. Perf 5-1/2" csg @ 300' and squeeze w/60 sx - 30 sx outside and 30 sx inside of 5-1/2" csg. WOC and tag plug.
5. Mix & spot 30 sx for surface plug; cut off csg; weld on 4 X 4 marker; cover cellar. Rip and re-seed location.

Current and proposed schematics attached.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE Dawn M. Howard TITLE Operations Assistant DATE 2/19/04

Type or print name Dawn M. Howard dhoward@swrinc.com Telephone No. (432) 686-9927


(This space for State use)

APPROVED BY Harry W. Wink FIELD REPRESENTATIVE II/STAFF MANAGER DATE FEB 25 2004
Conditions of approval, if any.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED

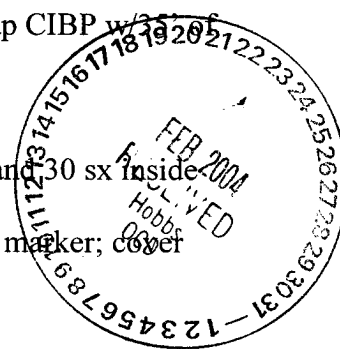

EAVES "A" #5
 1980' FSL = 1980' FWL
 Sec. 19, T-26S, R-37E

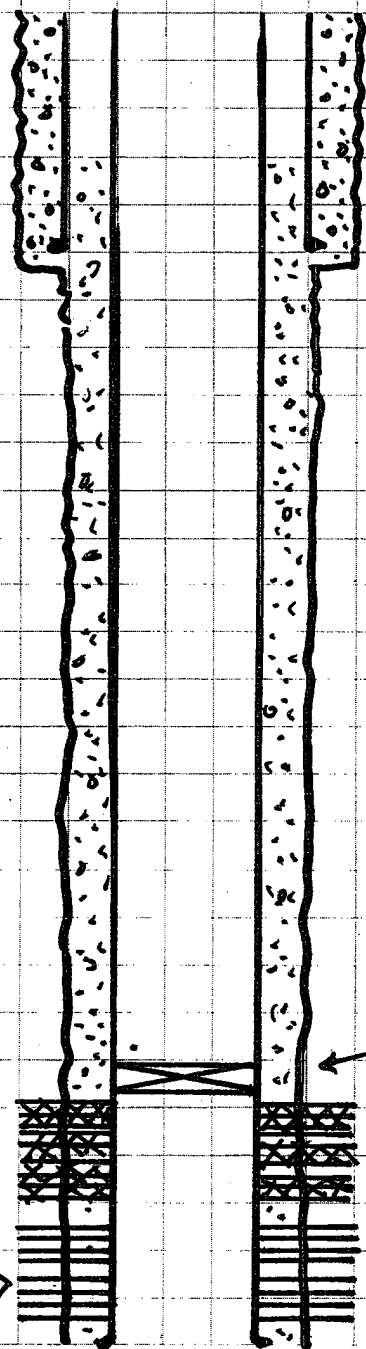

7 5/8" - 24" CS₉ @ 1228'
 CMT'D w/ 500 SXS
 <circ'd>

2/14/01 CIBP SET @ 2900'

SQUEEZED 2/87


QZ {
 2937 - 2968'
 2975 - 3035'
 3042 - 3104'
 3112 - 3160'
 3160 - 3177'
 3178 - 3213' }

TD @ 3220'

5 1/4" - 14" CS₉ @ 3219'
 CMT'D w/ 600 SXS
 <TO CC ± 950' PER TS>

< Current Condition >

EAVES "A" #5
 1980' FSL @ 1980' FWL
 Sec. 19, T-26S, R-37E

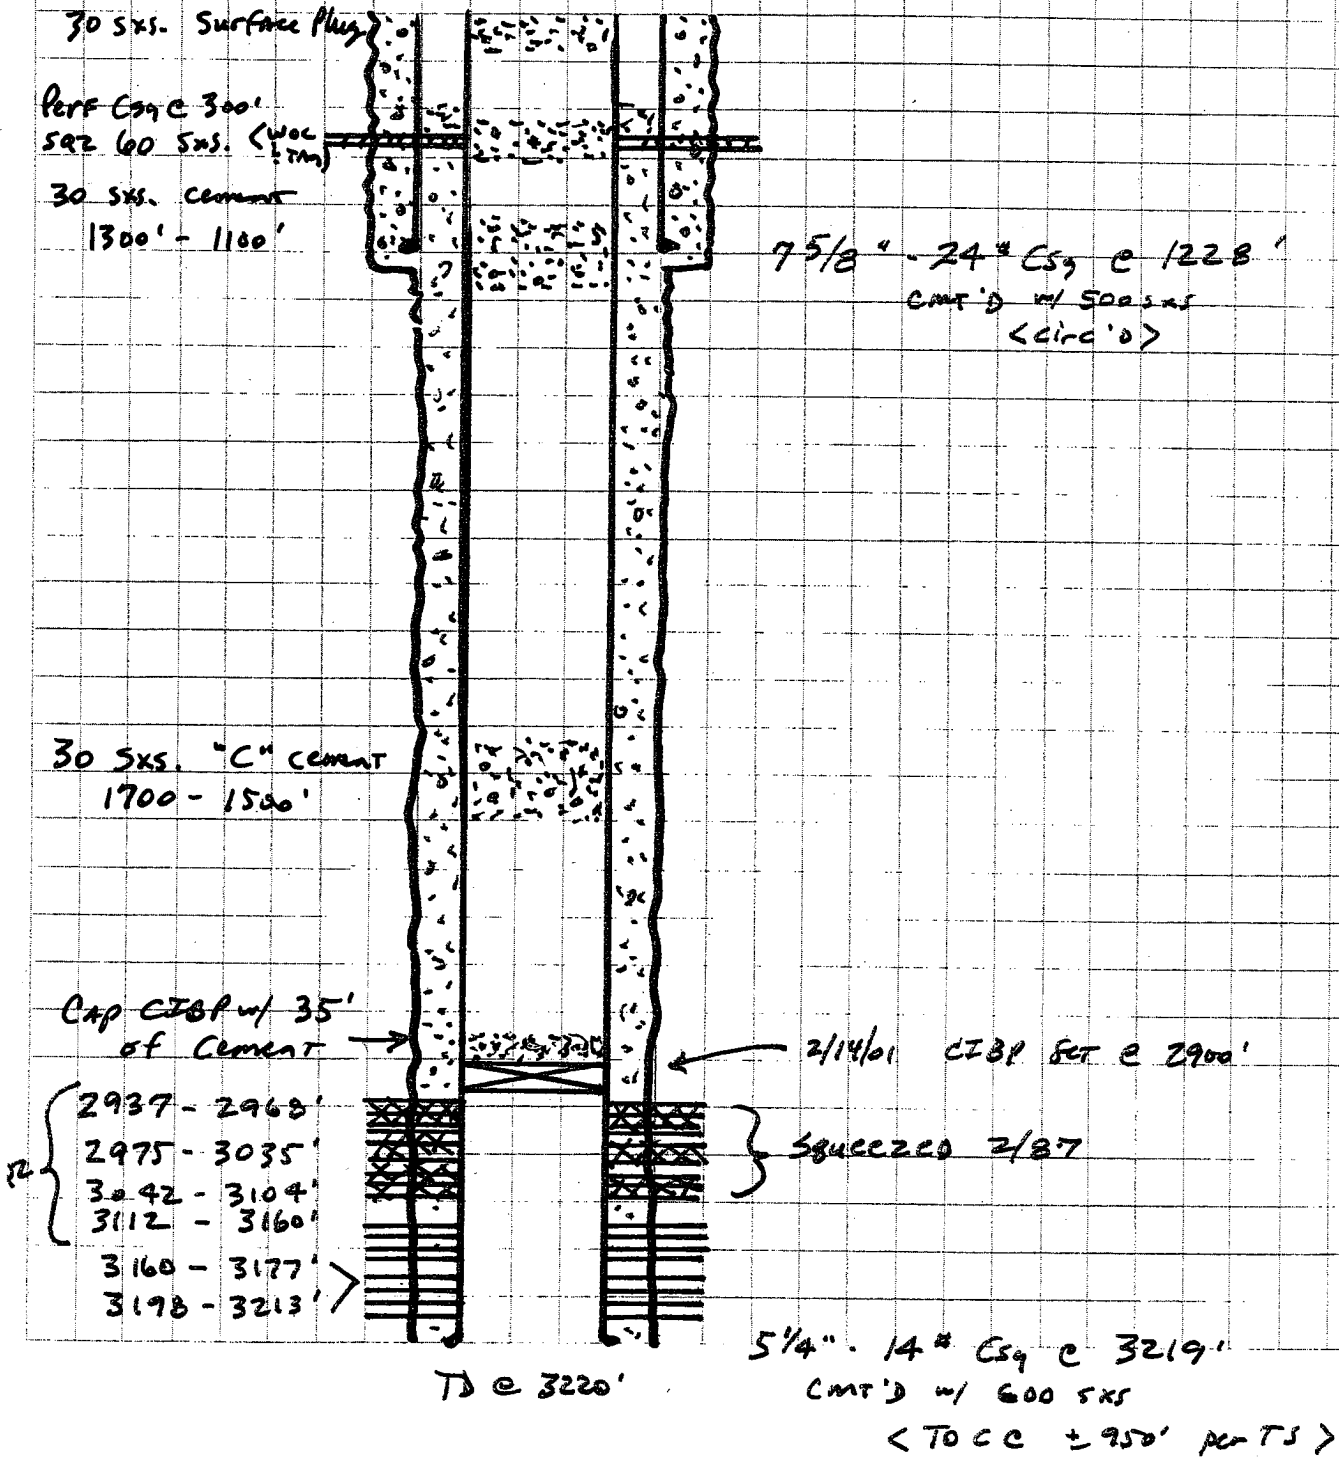

<Proposed P&A>