

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCD Hobbs

FORM APPROVED
OMB No. 1004-0137
Expires: March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE – Other instructions on page 2.

1. Type of Well <input checked="" type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other		7. If Unit of CA/Agreement, Name and/or No.
2. Name of Operator PRIME OPERATING COMPANY		8. Well Name and No. HOLCOMB 18 FED #1
3a. Address 3300 NORTH A, BLDG. ONE, SUITE 238 MIDLAND, TX 79705	3b. Phone No. (include area code) 432-682-5770	9. API Well No. 30-025-27247
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 1980 FWL & 760' FNL OF SEC. 18, T-9S, R-38E		10. Field and Pool or Exploratory Area SAWYER (SAN ANDRES) ASSOC.
		11. Country or Parish, State LEA COUNTY, NEW MEXICO

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input checked="" type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

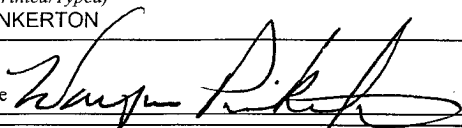
12/13/10 Set CIBP in 4 1/4 csg @ 4826'. Load hole w/ 10ppg MLF. Spot 25sx cmt 14.8ppg on CIBP. Spot 25sx cmt @ 3074' WOC and tag TOC @ 2808'. Spot 35sx cmt @ 2450' WOC.
12/14/10 Tag TOC @ 2126'. Spot 10sx cmt from 2126' to 2001'. Okay by BLM. Pump 40sx cmt from 480' to surf.
12/16/10 Cut off well head. Install dry hole marker. Clean loc and move off.

RECEIVED

JAN 25 2011
HOBBSCOCD

Accepted as to plugging of the well bore.
Liability under bond is retained until
Surface restoration is completed.

Reclamation Due 6-16-11

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed) WAYNE PINKERTON		Title GENERAL MANAGER
Signature 		Date 12/16/2010
ACCEPTED FOR RECORD		
THIS SPACE FOR FEDERAL OR STATE OFFICE USE		
Approved by:	Title	Date
	Office	
BUREAU OF LAND MANAGEMENT		
JAN 15 2011		
EAG 1-26-2011		

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.