

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

RECEIVED

APR 15 2011

HOBSOIL

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-36731
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Triple X 6 State
8. Well Number 1
9. OGRID Number 16696
10. Pool name or Wildcat Triple X Delaware
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3642' GR
Pit or Below-grade Tank Application <input type="checkbox"/> or Closure <input type="checkbox"/> Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	2. Name of Operator OXY USA Inc.	3. Address of Operator P.O. Box 50250 Midland, TX 79710-0250	4. Well Location Unit Letter 4 : 330 feet from the north line and 1310 feet from the west line Section 6 Township 24S Range 33E NMPM County Lea
12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.			

The Oil Conservation Division Must be notified
24 hours prior to the beginning of plugging operations.

See Attachment

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE David Stewart TITLE Regulatory Advisor DATE 4/13/11
E-mail address: david_stewart@oxy.com
Type or print name David Stewart Telephone No. 432-685-5717

For State Use Only

APPROVED BY [Signature] TITLE Staff Manager DATE 4-18-2011
Conditions of Approval, if any:

TD-9200' PBD-8800' Perfs-5080-5100' 8826-8856' CIBP-8800'

13-3/8" 61# csg @ 885' w/ 800sx, 17-1/2" hole, TOC-Surf-Circ

8-5/8" 32# @ 4920' w/ 1350sx, 11" hole, TOC-Surf-Circ

4-1/2" 11.6# csg @ 9200', DVY @ 6499' w/ 1900sx, 7-7/8" hole, TOC-3520'-CBL

1. RIH & tag CIBP @ 8800' M&P 25sx cmt

2. M&P 25sx cmt @ 6550-6445'

3. RIH & set CIBP @ 5030' M&P 25sx to 4870' WOC-Tag

4. Perf @ 2950' sqz 40 sx cmt 2850' WOC-Tag

5. Perf @ 935' sqz 40sx cmt to 835' WOC-Tag

6. Perf @ 250' sqz 100sx cmt to Surface

10# MLF between plugs

~~4B~~ 4A Perf @ 2950' sqz 40 sx cmt 2850' WOC-Tag → Perf @ 50 40sx cmt 1150 - WOC-Tag

OXY USA Inc. - Proposed
Triple X 6 State #1
API No. 30-025-36731

100sx @ 250'-Surface

40sx @ 935-835' WOC-Tag

40sx @ 1150' - 1050 WOC-TAG

40sx @ 2950-2850' WOC-Tag


CIBP @ 5030' w/ 25sx to 4870'

25sx @ 6550-6445'

25sx @ 8800'

11/04-CIBP @ 8800'

PB-9145'

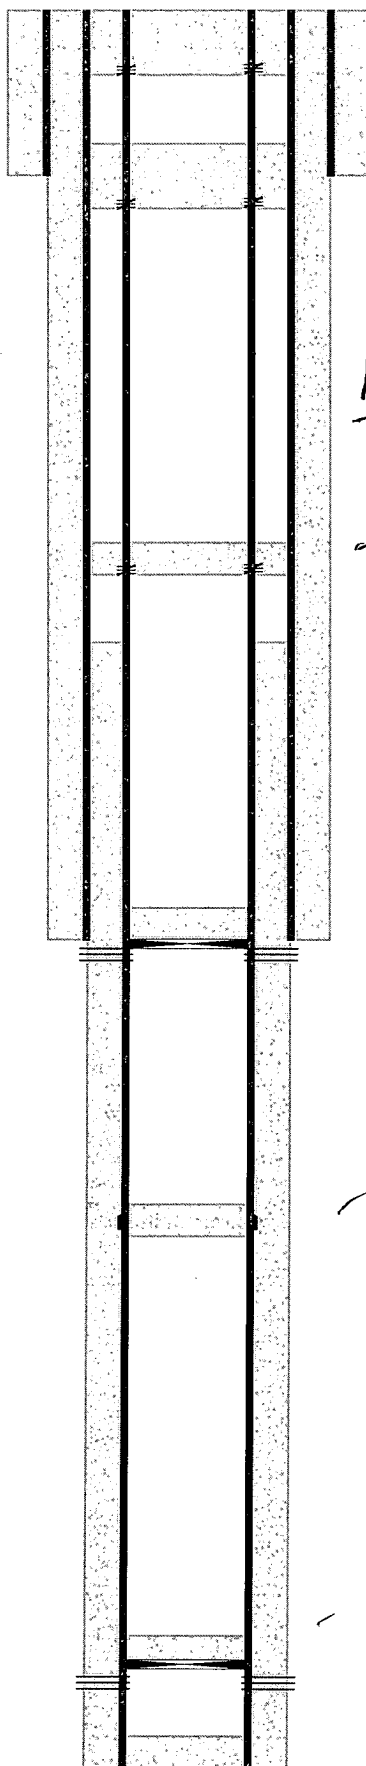

Perf @ 250'

17-1/2" hole @ 885'
13-3/8" csg @ 885'
w/ 800sx-TOC-Surf-Circ

Perf @ 935'

Perf @ 1150

✓ Perf @ 2950'


✓
11" hole @ 4920'
8-5/8" csg @ 4920'
w/ 1350sx-TOC-Surf-Circ
Perfs @ 5080-5100'

✓
7-7/8" hole @ 9200'
4-1/2" csg @ 9200'
DVT @ 6499'
1st w/ 1000sx-6494'-Circ
2nd w/ 900sx-3520'-CBL

Perfs @ 8826-8856'

TD-9200'

OXY USA Inc. - Current
Triple X 6 State #1
API No. 30-025-36731

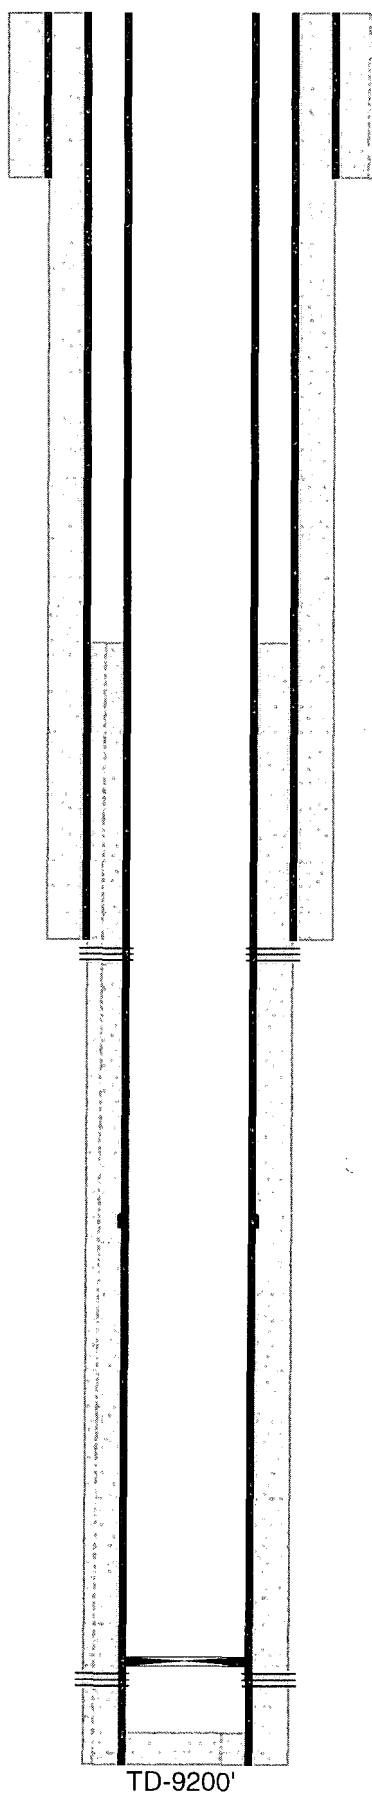

17-1/2" hole @ 885'
13-3/8" csg @ 885'
w/ 800sx-TOC-Surf-Circ

11" hole @ 4920'
8-5/8" csg @ 4920'
w/ 1350sx-TOC-Surf-Circ
Perfs @ 5080-5100'

7-7/8" hole @ 9200'
4-1/2" csg @ 9200'
DVT @ 6499'
1st w/ 1000sx-6494'-Circ
2nd w/ 900sx-3520'-CBL

11/04-CIBP @ 8800'

PB-9145'

Perfs @ 8826-8856'

TD-9200'