


OIL CONSERVATION COMMISSION

Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELLS

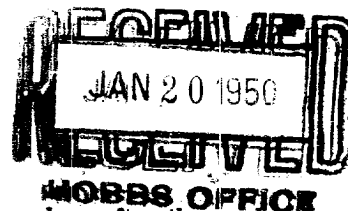

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut off, result of plugging of well, and other important operations, even though the work was witnessed by an agent of the Commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below.

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON PULLING OR OTHERWISE ALTERING CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL			

Tulsa, Oklahoma,

Date

January 13, 1950.

Place

OIL CONSERVATION COMMISSION,
SANTA FE, NEW MEXICO
Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the _____

J. R. Sharp, Inc., Federal-Yeckel Well No. 1 in the
Company or Operator Lease
NW 1/4 NE 1/4 of Sec. 13, T. 9 S, R. 35 E, N. M. P. M.,
Batonbough Field, Lea County.

The dates of this work were as follows: see below

Notice of intention to do the work was (was not) submitted on Form C-102 on _____ 19____
and approval of the proposed plan was (was not) obtained. (Cross out incorrect words.)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

On January 3, 1950, cemented 9,615' of 7" OD 26 and 29# New Seamless Casing with 1,450 sacks 6% Gel and 340 sacks regular cement. Job complete and plug down at 4:00 PM 1-4-50. On 1-5-50 at 4 AM ran Halliburton Temperature Survey and found solid cement back to 5,370 outside of 7" casing and cement channeled from 5,370' to surface. Circulated out 5 to 10 sacks. Drilled plug on 1-11-50 and tested 7" casing with 1200# pressure. Pressure dropped to 1,195# in one hour.

Witnessed by _____

Name	Company	Title
Subscribed and sworn before me this <u>18th</u> day of <u>January</u> 19 <u>50</u> <u>Barbara W. Smith</u> Notary Public BARBARA SMITH My commission expires <u>April 15, 1950</u>	I hereby swear or affirm that the information given above is true and correct. Name <u>[Signature]</u> Position <u>Treasurer</u> Representing <u>J. R. Sharp, Inc.</u> Company or Operator Address <u>Tulsa, Oklahoma.</u>	

Remarks:

APPROVED

Date JAN 20 1950

[Signature]
Name W. B. Gay
Title Inspector