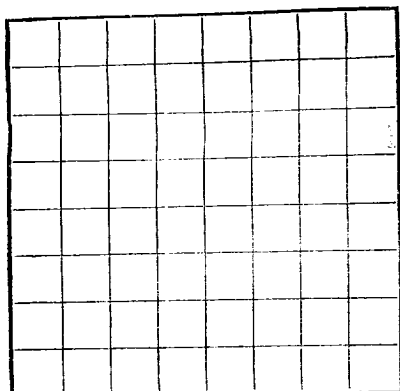


Form 9-330

HOBBS

U. S. LAND OFFICE **Las Cruces**
SERIAL NUMBER **067665 A**
LEASE OR PERMIT TO PROSPECT

LOCATE WELL CORRECTLY

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

OCT 27 1960

GEOLOGICAL SURVEY
NEW MEXICO

LOG OF OIL OR GAS WELL

Company **GORDON M. GONE** Address **Box 1148, Lovington, N.M.**
Lessor or Tract **Anderson** Field **Allison** State **New Mexico**
Well No. **1** Sec. **1** T. **9** S. R. **36** E. Meridian **N.M.P.M.** County **Lea**
Location **2086** ft. **N.** of **S.** Line and **2086** ft. **E.** of **W.** Line of **Sec. 1** Elevation **4037**
(Denote floor relative to sea level)
The information given herewith is a complete and correct record of the well and all work done thereon
so far as can be determined from all available records.
Signed **Reggie Jean Pellet** Title **Secretary**
Date **October 20, 1960**

The summary on this page is for the condition of the well at above date.

Commenced drilling **August 17**, 19 **60** Finished drilling **September 28**, 19 **60**

OIL OR GAS SANDS OR ZONES

(Denote gas by G)

No. 1, from **9656** to **9684** No. 4, from _____ to _____
No. 2, from _____ to _____ No. 5, from _____ to _____
No. 3, from _____ to _____ No. 6, from _____ to _____

IMPORTANT WATER SANDS

No. 1, from _____ to _____ No. 3, from _____ to _____
No. 2, from _____ to _____ No. 4, from _____ to _____

CASING RECORD

Size casing	Weight per foot	Threads per inch	Make	Amount	Kind of shoe	Cut and pulled from	Perforated		Purpose
							From—	To—	
13-3/8	48#	8	new	384'					surface
8-5/8	32#	8		4175'					intermediate
5-1/2	17#	8		9720'			9656	9684	production
8-15/16							9574	9684	string

MUDDING AND CEMENTING RECORD

Size casing	Where set	Number sacks of cement	Method used	Mud gravity	Amount of mud used
13-3/8	373'	385	Halliburton		
8-5/8	4150'	1100			
5-1/2	9720'	260			

PLUGS AND ADAPTERS

Heaving plug—Material _____ Length _____ Depth set _____
Adapters—Material _____ Size _____

SHOOTING RECORD

Size	Shell used	Explosive used	Quantity	Date	Depth shot	Depth cleaned out
Perforated 9656-69 with 4 shots per foot, treated with 500 gallons of mud acid. Perforated 9674-84, treated with 3000 gallons regular acid.						

TOOLS USED

Rotary tools were used from **0-** feet to **9720** feet, and from _____ feet to _____ feet
Cable tools were used from _____ feet to _____ feet, and from _____ feet to _____ feet

DATES

_____, 19____ Put to producing **October 1**, 19**60**.

The production for the first **3 1/4** hours was **100** barrels of fluid of which **75**% was oil; _____%
emulsion; **25**% water; and _____% sediment. Gravity, °Bé. _____

If gas well, cu. ft. per 24 hours _____ Gallons gasoline per 1,000 cu. ft. of gas _____

Rock pressure, lbs. per sq. in. _____

EMPLOYEES

W.O. Eubanks, Driller _____, Driller
Harvey Collett, Driller _____, Driller

FORMATION RECORD

FROM—	TO—	TOTAL FEET	FORMATION
-0-	1667	1667	Red bed
1667	1997	300	Red bed & Anhydrite
1997	2208	211	Red bed & salt
2208	2334	126	Anhydrite
2334	3890	1556	Anhydrite & salt
3890	4132	242	Anhydrite & lime
4132	5060	928	Lime
5060	7683	2623	Lime, lime & sand
7683	9224	1544	Lime and shale
9224	9720	496	Lime
TOPS			
San Andres:	4097'		
Abo :	7690'		
Penn Bough C	9656'		

