

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
K-5173

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Union Oil Company of California	8. Farm or Lease Name State "12"
3. Address of Operator P.O. Box 671 - Midland, Texas 79701	9. Well No. 3
4. Location of Well UNIT LETTER 0, 660 FEET FROM THE south LINE AND 1980 FEET FROM THE east LINE, SECTION 12 TOWNSHIP 10-S RANGE 33-E NMPM.	10. Field and Pool, or Wildcat Vada Penn
11. Elevation (Show whether DF, RT, GR, etc.) 4198' GR	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

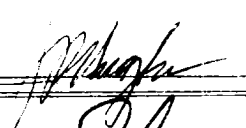
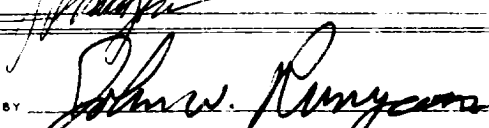
17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Cement plugs set as follows:

25 sx - 9650 - 9450' 5½" casing shot @ 6105' (6144' recovered)
60 sx - 6147 - 5937' in & out of 5½" stub
75 sx - 5339 - 5129'
75 sx - 4091 - 3836' across 8-5/8" shoe
110 sx - 1303 - 1060' 8-5/8" casing shot @ 1246' (1252' recovered)
110 sx - 486 - 288' across 11-3/4" shoe
20 sx - 30' - Surface

Welded on ½" steel plate, installed dry hole marker, cleaned & leveled location.

Well plugged and abandoned June 13, 1974.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.		
SIGNED 	TITLE District Drilling Supt.	DATE 6-18-74
APPROVED BY 	TITLE	DATE
CONDITIONS OF APPROVAL, IF ANY:		