

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

SEP 10 11 35 AM '68

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. OG - 4537
7. Unit Agreement Name
8. Farm or Lease Name Nine Ranch
9. Well No. 1
10. Field and Pool, or Wildcat Inbe
12. County Lea

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>
2. Name of Operator Charles B. Read
3. Address of Operator P. O. Box 2126, Roswell, New Mexico 88201
4. Location of Well UNIT LETTER <u>N</u> , <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>23</u> TOWNSHIP <u>10S</u> RANGE <u>33E</u> NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) 4198.6 GL

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input checked="" type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input checked="" type="checkbox"/>	


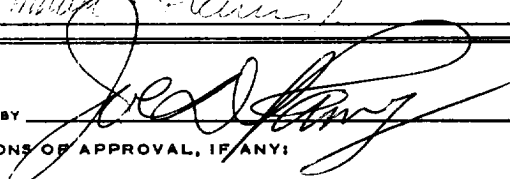
17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

Commenced drilling operations at 8:30 A.M. 8/9/68

Ran 10 jts., 12 3/4", 48#, J-55 csg., set at 378' KB, cmt w/350 sx, Incore Poz, 2% CaCl, 8# salt/sx. Plug down at 5:15 P.M. 8/9/68. Cmt. circ back to surf, WOC 18 hrs., 30 min. pressure test to 600#, OK.

Ran 95 jts., 8 5/8", 24#, 28# and 32#, J-55 csg, 4020.06', set at 3995' RKB. Cmt w/200 sx Incore Poz, 2% Gel, 8# salt/sx and 100 sx Incore Poz, 2% CaCl, 8# salt/sx, WOC 18 hrs., pressure tested to 1000#, OK.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE <u>Agent</u>	DATE <u>Sept. 6, 1968</u>
APPROVED BY 	TITLE <u>[unclear]</u>	DATE <u>[unclear]</u>
CONDITIONS OF APPROVAL, IF ANY:		