

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE
(Other instructions on
reverse side)Form approved
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

LC 065510

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back into a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR JACK L. MCCLELLAN	8. FARM OR LEASE NAME FEDERAL "22"
3. ADDRESS OF OPERATOR Box 343, ROSWELL, NEW MEXICO	9. WELL NO. 1
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 990' FSL & 1650' FWL	10. FIELD AND POOL, OR WILDCAT TODD SAN ANDRES
14. PERMIT NO.	11. SEC. T., R., M., OR BLK. AND SURVEY OR AREA 22-T7S-R35E
15. ELEVATIONS (Show whether DF, RT, CR, etc.) 4208.5 OL	12. COUNTY OR PARISH ROOSEVELT
	13. STATE NEW MEXICO

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

SEGREGATE GAS ZONES

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

12/20/66 KILLED WELL & PULLED TUB. RE-RAN TUB. & SET PKR. AT 4197', TO SEPERATE THE "A" ZONE FROM THE "B" ZONE. TESTED "B" ZONE. WEAK BLOW OF GAS. WELL PROBABLY WATER LOGGED.

12/21/66 PULLED TUB. & SET BRIDGE PLUG @ 4195'. PERF. CSG. 1 SHOT/FT. AT 4153, 4160, 4168, 4170, 4180, 4182, & 4184, ALL IN THE "A" ZONE. SWB. LOAD WTR. HARD BLOW OF GAS.

12/22/66 FL 1500'. SWD. DOWN. ACIDIZED W/1000 GALS. (4158-4184). SWD. LOAD. FAIR TO GOOD BLOW OF GAS.


12/27/66 PULLED TUG. AND DRILLED OUT BRIDGE PLUG AT 4195'. RE-RAN TUBING AND SET PACKER AT 4195'.

ALTERNATELY TESTED "A" & "B" ZONE THROUGH TUBING AND CASING ANAULAS, TO ASCERTAIN WHICH ZONE PRODUCED MOST GAS.

WELL NOW PRODUCING GAS FROM THE "B" ZONE THROUGH THE TUBING, "A" ZONE SHUT-IN. PRESSURES ON TUBING AND CASING INDICATE THAT THE TWO ZONES ARE EFFECTLY SEPERATED.

18. I hereby certify that the foregoing is true and correct

SIGNED

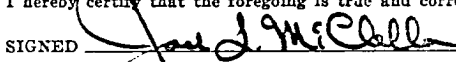

TITLE

Operator

DATE

3/15/67

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side