

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER		5. LEASE DESIGNATION AND SERIAL NO. L.S. 0328425
2. NAME OF OPERATOR Lone Star Producing Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR Box 4815, Midland, Texas 79701		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' from North and West lines of Section 27, T-8-S, R-36-E		8. FARM OR LEASE NAME L.S. (55) Federal
14. PERMIT NO.		9. WELL NO. 1
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 1483' O.I.		10. FIELD AND POOL, OR WILDCAT Wildcat Vada Basin
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 27, T-8-S, R-36-E
		12. COUNTY OR PARISH Roosevelt
		13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) <u>Completion</u>	☒
(Other) ☐		(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

On February 6, 1970, started completion operations.


- (1) Perforated Bough "C" from 9745'-50', 9752'-58' and 9761'-63' with 2 jet shots per foot. BTD at 9778'.
- (2) Set Dresser Atlas type "A" production packer at 9709'.
- (3) Acidized perforations 9745'-63' with 750 gallons of 15% mud acid. Acid on formation at 3500 psi, broke back to 0 psi.
- (4) Swabbed spent acid water to pit.
- (5) Completed well with 2" tubing and Fluid Back casing pump.
- (6) Ran 24 hour potential test starting at 5:00 P.M., February 20, 1970.
Produced: 272.72 bbls. oil - 17.1° API corrected to 60°F
514 bbls. water
385 MCF - 1110/1

18. I hereby certify that the foregoing is true and correct

SIGNED C. E. [Signature] TITLE Dist. Prod. Superintendent DATE February 24, 1970

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____
CONDITIONS OF APPROVAL, IF ANY:

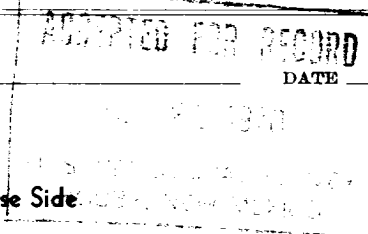

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.