

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil & Gas Division
~~811 S. 1st Street~~ Hobbs
Artesia, NM 88210-2834

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other TA

2. Name of Operator

PLAINS PETROLEUM OPERATING COMPANY

3. Address and Telephone No.

415 W. WALL, SUITE 1000 MIDLAND, TX 79701 915/683-4434

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FSL & 660' FEL, SEC. 14 (I), T8S, R37E

5. Lease Designation and Serial No.

nm 2041698A

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

BLUITT SA FEDERAL #9

9. API Well No.

30-041-20250

10. Field and Pool, or Exploratory Area

Blutt San Andres Associated

11. County or Parish, State

ROOSEVELT, NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
<input checked="" type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input type="checkbox"/> Other _____
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Dispose Water

(Please Report results of multiple completion on Well Completion or Recompletion Report and Log form.)


13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of completion, for all work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1) GIH w/2-3/8" tbg work string & 5-1/2" x 2-3/8" packer. Circulate hole w/10 ppg mud. Set pkr @ 4600' KBM. Pressure test CIBP to 500 psi & tbg-csg annulus to 500 psi

2) Spot 15 sx Prem Plus cmt from 3400' back to 2850'

3) Perf 5-1/2" csg @ 550' KBM, set pkr on 2-3/8" tbg @ 485' and establish circulation out of 8-5/8" x 5-1/2" csg annulus w/10 ppg mud. Squeeze w/50 sx Prem Plus cmt & displace TOC to 485' 250' (in 9' behind 5 1/2" casing). Tag plug

4) Spot 20 sx Prem Plus cmt plug from 60' back to surface. Cut off all casings, weld on steel plate across all casings and install dry hole marker

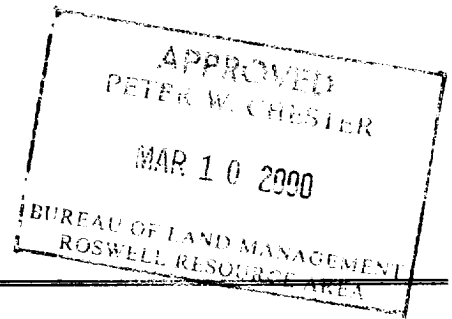

14. I hereby certify that the foregoing is true and correct

Signed Bonnie Husband

Title ADMINISTRATIVE ASSISTANT

Date 03/06/00

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

Date

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See instruction on Reverse Side

3
GW