

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPL
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 12025

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

CSO-FEDERAL

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

BLUITT (WOLFCAMP) GAS

11. SEC. T. R. M. OR BLK. AND
SURVEY OR AREA

Sec. 28, T-7S, R-37E

12. COUNTY OR PARISH

13. STATE

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

H. L. BROWN, JR.

3. ADDRESS OF OPERATOR

P. O. Box 2237, Midland, Texas 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)

At surface

990' FSL & 990' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4067.4 GL

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

PRESENT WELL DATA:

12-3/4" casing set to 515' with 400 sks circulated

8-5/8" casing set to 3740' with 650 sks., TOC at 1320'

4-1/2" casing set to 8242' with 480 sks., TOC at 6500' PBTD

Perforations: 8122 to 8172

3208'

PROPOSE TO P & A AS FOLLOWS:

Set CIBP with 35' cement at 8050'

Mud Hole

Cut and pull 4 1/2" at approx. 6400, place 100' of cement at 6400', stub of 4 1/2".

Place 100' of cement at 5100', top of Glorieta.

Place 100' of cement at 3770', base of 8-5/8".

Cut and pull 8-5/8" at approximately 1300'

Place 100' at stub of 8-5/8", place 100' at 425', base of 12-3/4", place 10' at top of surface with marker.

P&A OPERATIONS should start Nov. 24, 1975

AMENDMENT: Place additional B.P. at 6500 feet with 35 feet of cement on top.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE


DATE Nov. 18, 1975

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

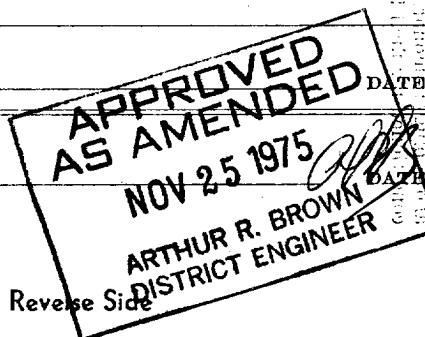

*See Instructions on Reverse Side