

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
HOBBS, NEW MEXICO 88240

SUBMIT IN TRIPLICATE

Expires August 31, 1985

LEASE DESIGNATION AND SERIAL NO.
NM044216

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use APPLICATION FOR PERMIT for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐		7. UNIT AGREEMENT NAME	
2. NAME OF OPERATOR PLAINS PETROLEUM OPERATING COMPANY		8. FARM OR LEASE NAME Bluitt San Andres Unit <i>See L3</i>	
3. ADDRESS OF OPERATOR 415 W. WALL, SUITE 1000 MIDLAND, TX 79701		9. WELL NO. 15-6	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface Unit Letter F, 1980' FNL & 1980' FWL		10. FIELD AND POOL, OR WILDCAT Bluitt San Andres Assoc.	
		11. SEC., T., R., M., OR B.L. AND SURVEY OR AREA Sec.13, T8S, R37E	
14. PERMIT NO. 3D-14-20852	15. ELEVATIONS (Show whether DF, RT, CR, etc.) GR 4016.3	12. COUNTY OR PARISH Roosevelt	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

RELL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

9-4-93 MIRU, unseat pump. POOH w/rods, pump. ND wellhead. Release TAC. POOH w/tbg, TAC SN, PS, BPMA. NU BOP. RIH w/CIBP, set @ 4610'. Perf 4" 1 JSPF @ 4504'-4577' (13 holes). Dump 2 sx cmt on CIBP. PU & RIH w/5-1/2" pkr, 2-3/8" SN, 142 jts 2-3/8" tbg hydrotesting to 5000 psi. RD hydrotester, close BOP. SI for press buildup

9-7-93 Press test pkr to 3500 psi, ok. Release press, op bypass, spot acid to pkr. Close bypass, acidize San Andres P1 zone w/546 gals 15% NeFe HCl, flush w/17 BFW, max 2700 psi, avg 1 BPM, min 850 psi, 42 gals/perf. Swab w/50' fluid rise every 20 mins rec 3/10th BF/hr w/50% oil cut, light to mod gas blow. SI for press buildup.

9-8-93 SITP 1350 psi. Blew dwn in 2 hrs. RIH w/2" swab. Tag FL @ 300' above SN. Release pkr. POOH w/pkr & tbg. RIH w/pkr, SN 2-3/8" tbg. Isolate perfs 4504'-4514' between tools. RU tbg swab, well kicked off & unloaded remaining load wtr. Well stabilized flowing 66 MCF w/no fluid, SI for pressure buildup.

18. I hereby certify that the foregoing is true and correct

SIGNED

Barrie Husband

TITLE

Administrative Assistant

Sept. 17, 1993

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

ACCEPTED FOR RECORD
PETER W. CHESTER
DATE

SEP 23 1993

*See Instructions on Reverse Side

RECEIVED

SEP 21 1961

U.S. AIR FORCE
OFFICE

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
HOBBS, NEW MEXICO 88240

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	7. UNIT AGREEMENT NAME Bluitt San Andres Unit Sec 13
2. NAME OF OPERATOR Plains Petroleum Operating Co.	8. FARM OR LEASE NAME
3. ADDRESS OF OPERATOR 415 West Wall, Suite 1000, Midland, TX 79701	9. WELL NO. 13-6
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1980' FNL & 1980' FWL Unit F	10. FIELD AND POOL, OR WILDCAT Bluitt San Andres Assoc.
14. PERMIT NO. 30-041-20852	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 13, T8S, R37E
15. ELEVATIONS (Show whether DF, RT, GR, etc.) GR 4016.3	12. COUNTY OR PARISH Roosevelt
	13. STATE NM

18. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐
REPAIR WELL ☐	CHANGE PLANE ☐
(Other) ☐	X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

Recomplete, perforate & acidize the P1 San Andres zone by plugging (CIBP w/2 sx cmt) the P2 zone (4625'-4655').

P1 Recompletion procedure - Unhang well, POOH & lay down rods & pump. Drop SV and test tbg to 3500 psi. ND WH, release TAC & POOH w/tbg. RU wireline & RIH w/CIBP for 5-1/2" csg. Set CIBP @ 4610' w/2 sx cmt. Perforate 13 holes w/4" gun 4504'-4577'. RIH w/PPI pkr w/SN above pkr. Set @ 4600' & test CIBP. Isolate & breakdown each perf w/42 gals 15% NEFE HCl. After last perf is broken dwn, POOH w/ PPI pkr & RBP. RIH w/RBP & pkr, isolate & swab test these intervals 4562-4577, 4524-4535, 4504-4514. If there is gas show w/little or no wtr, set pkr @ 4480 & acidize w/4500 gals 15% NEFE HCl. Pump at 5-8 BPM, treat press 1200 psi, dropping 1 ball every 900 gals, max press 3500 psi. Swab back load, nipple up to separator at battery and sales line.

18. I hereby certify that the foregoing is true and correct

SIGNED Donna Hubbard

TITLE Office Manager/Tech


DATE 8/27/93

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

*See Instructions on Reverse Side

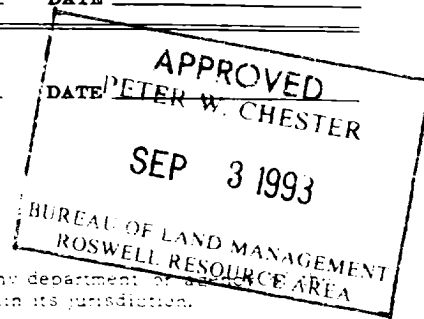

RECEIVED

SEP 07 1993

**DDO HULDS
OFFICE**