

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
HOBBS, NEW MEXICO BOX 1980

OFFICE FOR NUMBER
OF COPIES REQUIRED
(Other Instructions)

ROSWELL DISTRICT
Modified Form No.
ND60-3160-4

SUNDRY NOTICES AND REPORTS ON NEW MEXICO 88240

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. ☒ GAS ☐ WELL ☐ OTHER		7. UNIT AGREEMENT NAME Bluitt San Andres Unit Sec.13
2. NAME OF OPERATOR Plains Petroleum Operating Co.		8. NAME OF LEASE NAME
3. ADDRESS OF OPERATOR 415 West Wall Street, Suite 2110 Midland, Texas 79701		9. WELL NO. 1316 #16
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface Unit Letter P - 660' FSL, 660' FEL		10. FIELD AND POOL, OR WILDCAT Bluitt San Andres
		11. SEC. T., R., W. OF BLK. AND BEARBY OR AREA Sec.13, T8S, R37E
14. PERMIT NO.	15. ELEVATIONS (Show whether BY, RT, CR, etc.) 3989.0' GR	12. COUNTY OR PARISH Roosevelt
		13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE (INTENTION TO:

TEST WATER SHUT-OFF	☐	PULL OR ALTER CASING	☐
FRACURE TREAT	☐	MULTIPLE COMPLETION	☐
SHOOTING OR ACIDIZING	☐	ABANDON*	☐
REPAIR WELL	☐	CHANGE PLANS	☐
(Other)	☐		

SUBSEQUENT REPORT OF:


WATER SHUT-OFF	☐	REPAIRING WELL	☐
FRACURE TREATMENT	☐	ALTERING CASING	☒
SHOOTING OR ACIDIZING	☐	ABANDONMENT*	☐
(Other)	☐		

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DRILLING PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and plan pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give approximate locations and measured and true vertical depths for all markers and water pertinent to this work.)*

4-16-90 Norton Drilling Co. spudded 12-1/4" hole. Ran 12 jts 8-5/8" 20# X42 ST&C csg w/ notched Texas pattern shoe (total 509.72'), insert baffle and 4 centralizers @ 486', 406', 326' and 246'. Set csg w/landing jt @ 526' KB. Cmtd w/300' sx Class "C" cmt w/2% CaCl₂, circ 50' sx cmt to surface. Tested BOP to 3000 psi, held OK.

4-25-90 Drlg 7-7/8" hole @ 4900'. Ran 111 jts 5-1/2" 14# J55 ST&C csg set @ 4896.52' KB, 5-1/2" guide shoe & shoe jt 44.02' and insert float. Ran centralizers @ 4852', 4720', 4676', 4632', 4588', 4554', 4522' and 4478'. Set slips on 5 1/2" csg & cut off 5 1/2" csg. Top of short marker jt @ 4500' KB (22' jt). Preflush w/100 Bbls FW followed by 1120 sx 65:35 Poz w/6% gel, 1/2" celloseal, 6# salt/sack (12.6#/gal), tailed in w/200 sx Class "C" neat (14.8#/gal). Displaced plug & cmt w/FW. WOC

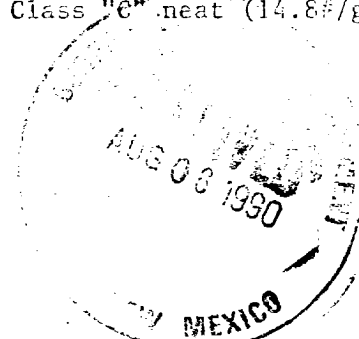

18. I hereby certify that the foregoing is true and correct

SIGNED Stephen D. Owen TITLE Operations Engineer

DATE 5-8-90

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

ACCEPTED FOR RECORD
PETER A. CHESTER
DATE _____

AUG 7 1990

BUREAU OF LAND MANAGEMENT
ROSWELL RESCUE AREA

*See Instructions on Reverse Side