

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

N. M. OIL CONS. COMMISSION  
P. O. BOX 1980  
HOBBS, NM 88241

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

**SUBMIT IN TRIPLICATE**

1. Type of Well <input checked="" type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other	5. Lease Designation and Serial No. NM-054926
2. Name of Operator Read & Stevens, Inc.	6. If Indian, Allottee or Tribe Name
3. Address and Telephone No. P. O. Box 1518 Roswell, New Mexico 88202 505/622-3770	7. If Unit or CA, Agreement Designation SW-940
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 1980' FNL & 1980' FWL Section 20 T12S-R31E	8. Well Name and No. Winton Gas Com #1
	9. API Well No. 30-005-20439
	10. Field and Pool, or Exploratory Area Chaves Queen Gas Area SE
	11. County or Parish, State Chaves County, New Mexico


12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA		
TYPE OF SUBMISSION	TYPE OF ACTION	
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment	<input type="checkbox"/> Change of Plans
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion	<input type="checkbox"/> New Construction
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Other <u>Plug and Abandon</u>	<input type="checkbox"/> Dispose Water
(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)		

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Read & Stevens proposes to plug and abandon the subject well as follows:

- 1) Set CIBP @ 2,550' above Queen perforations 2,562'-80'. Spot 35' cmt plug on CIBP.
- 2) Run tbg and set 100' cmt plug from 1,875'-1,775' across the top of the Yates. Free point 4 1/2" csg and shoot off and pull 4 1/2" csg from free point, anticipated to be approx. 1,500' from surface. Set 100' cmt plug across the top of the salt and anhydrite from 1,050' to 950'.
- 3) Set 100' cmt plug from 50' below the base of the surface pipe to 50' above the base of the surface pipe. Surface pipe set @ 325'. *Tag plug.*
- 4) Set ~~10'~~ surface plug and cut off wellhead 3' below ground level. Install dry hole marker.
- 5) Backfill and level location, install dry hole marker.

14. I hereby certify that the foregoing is true and correct		
Signed <u>John C. Mackey, Jr.</u>	Title <u>Petroleum Engineer</u>	Date <u>11-20-97</u>
(This space for Federal or State office use)		
Approved by _____	Title _____	Date _____
Conditions of approval, if any:		
Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.		
*See Instruction on Reverse Side		

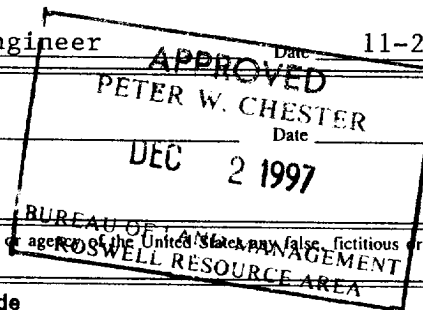

JOHN F. LAMOTHE  
ROSWELL OFFICE

197 NOV 25 A 10:11

RECEIVED

