

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- Salt Water Disposal		7. Unit Agreement Name
2. Name of Operator ASHMUN & HILLIARD		8. Farm or Lease Name G. K. McDonald
3. Address of Operator 906 Building of the Southwest, Midland, Texas 79701		9. Well No. 1 SWD
4. Location of Well UNIT LETTER P , 660 FEET FROM THE South LINE AND 660 FEET FROM THE East LINE, SECTION 1 TOWNSHIP 13-S RANGE 37-E N.M.P.M.		10. Field and Pool, or Wildcat Undesignated
15. Elevation (Show whether DF, RT, GR, etc.) 3870' Top of Tubinghead		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

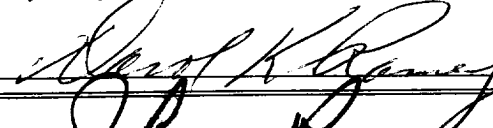

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Subject well has been plugged and abandoned as follows:

1. Attempted to release Baker Model "A" packer set @ 1874'. Packer would not release.
2. Cut off tubing @ 1866'. Left packer set.
3. Loaded hole w/10# brine-gel mud. Pulled tubing.
4. Set Baker Cast Iron Bridge Plug @ 1850' w/two sacks cement on top of bridge plug w/dump bailer.
5. Cut off wellhead.
6. Placed 10 sx cement plug 3'-33'.
7. Set regulation dryhole marker.
8. Cleaned up location.

Plugging completed - Sept. 26, 1975

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE Manager of Operations	DATE 11-24-75
APPROVED BY 	TITLE Geologist	DATE JAN 27 1976
CONDITIONS OF APPROVAL, IF ANY:		

RECEIVED

DEC 8 1975

U.S. CONSERVATION COMM.
WASH. D.C.