


G.L. 4137
D.F. _____
K.B. 4155
ZERO 12461

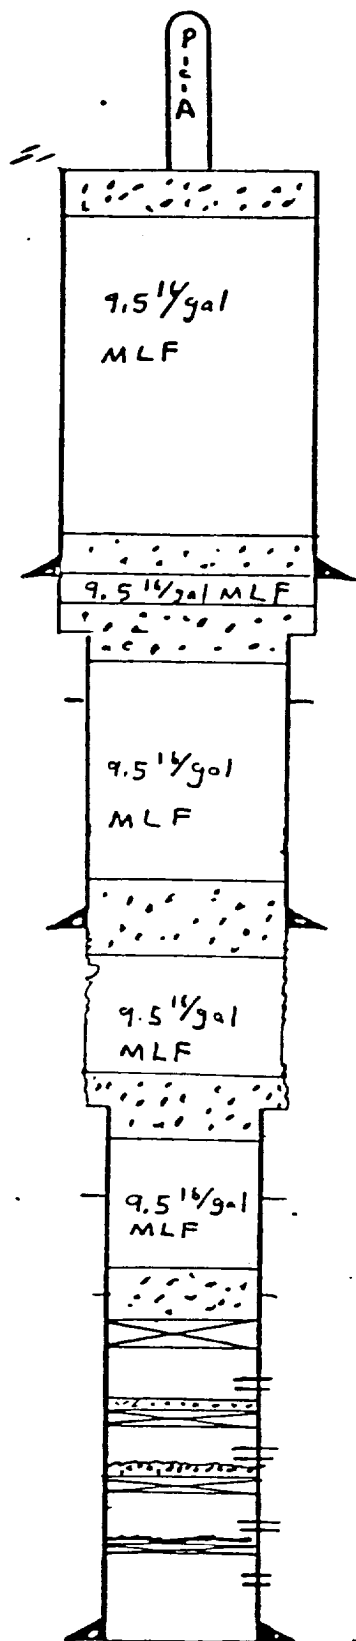

105x Class C surface plug $\pm 20'$

11 3/4" 42 1/4" Ft H-40 Set @ 400' w/ 4005XS Circ 15" hole
100' Class C cmt plug 50' above; below 11 3/4" shoe ± 875XS
100' Class C cmt plug 50' above; below 8 5/8" CSG stub ± 875.
8 5/8" TOC at 3075' TS CUT DET'D BY FREEPOINT

100' class C cmt plug 50' above & below $8\frac{5}{8}$ " CSG shoe $\pm$ 455.
 $8\frac{5}{8}$ " 32 $\frac{1}{4}$ " FT J-55 Set at 4500' w/ 525SX 11" hole

100' Class C cmt plug 50' above and below CSG stub ± 455 XS
5 1/2" TOC @ 8400 by TS
CUT DET'D BY FREEPOINT.

CIBP set at 9600' capped w/ 100' Class C $\pm$ 65Xs
Wolfcamp Perfs 9634-38; 9953-78 2JS PF

CIBP at 10,030 capped w/ 5'cmt

Middle Wolfcamp perf's at 10,038-42' 2JS PF

CIBP 10,250' capped w/ 35' cmt ± SXS

Lower Wolfcamp Perfs 10,311-18 4 JSPF

CIBP @ 10,380 capped w/ 25x5 cmt $\pm 20'$

Upper Penn perfs 10,402 - .0% 4JSPF

5 1/2" 17 1/2" 1 1/4" N-80 CSG set at 11,031' w/ 375 SXS
7 7/8" hole

TD 11,031'