


New Mexico 85
Section 28, T-14S, R-34E
Lea County, New Mexico

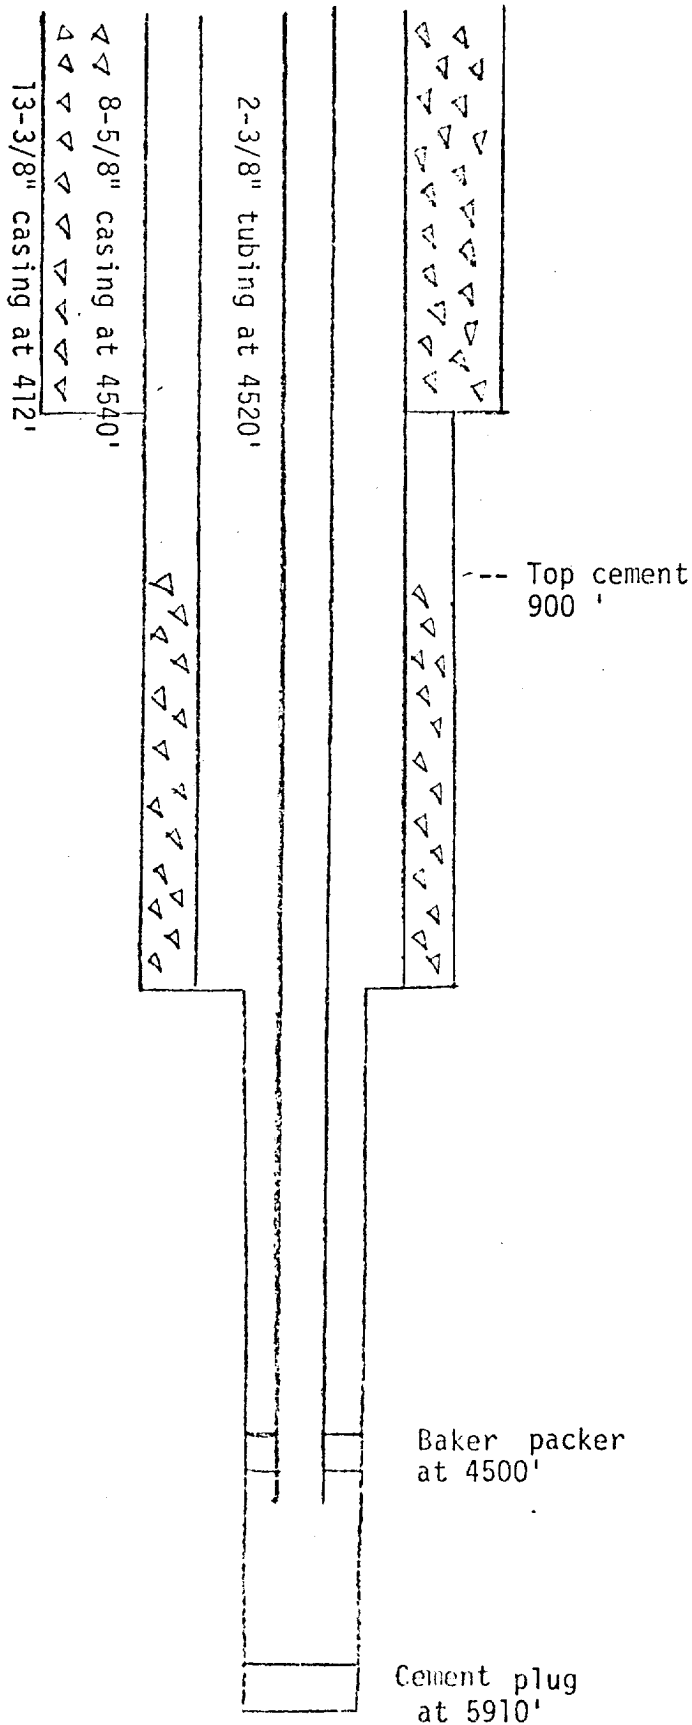

Plan to install 8-5/8" well head.
Drill out surface plug and the plug
from 4584' (in and out of 8-5/8"
casing).

Clean out hole to 5907' to top of
cement bridge plug.

Run 4520' of 2-3/8" plastic coated
tubing and complete by setting
Baker Packer at 4500'. Acidize
open hole with 2000 gals. Then
fill annulus with KCI inert water.
Set pressure gauge at surface.