

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

FORM APPROVED
Budget Status No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

LC-058698B

6. If Indian, Allottee or Tribe Name

7. If Unit or CA Agreement Designation

8. Well Name and No.
MCA Unit No. 31

9. API Well No.
30-025-00653

10. Field and Pool, or Exploratory Area
Maljamar (G-5A)

11. County or Parish, State
Lea, NM

1. Type of Well
☐ Oil Well ☐ Gas Well ☒ Other: Injection

2. Name of Operator
CONOCO INC.

3. Address and Telephone No.
10 DESTA DRIVE, STE 100 W, MIDLAND, TX 79705 (915) 686-5494

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
660 FNL + 660 FNL

Unit letter D, Sect 23, T17S, R32E

CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Lease
☒ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other: Clean out
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to that work.)

MIRU. ND WH. NU BOP - hel pkr. POH w/2 7/8" P.C. tbg + Baker ADI pkr. BHH w/3 7/8" bit, jet sub - 10 - 3 7/8" DC + 2 3/8" P.C. tbg. 2ag fill at 3713. RIH + CO to 3827. Drill on pkr left in hole. POH WIDE. PU + RIH w/13 7/8" washpipe shoe, changeover sub, 10 - 3 7/8" DC + 106 jts 2 3/8" P.C. tbg at 3520. RIH + tagged up at 3830. Drill out 3929. Metal + rubber returns. POH WIDE. PU + RIH w/13 7/8" bit - jet sub 10 - 3 7/8" D.C. + 10 jts 2 3/8" P.C. tbg. RIH + jet wash to 3893. wellhead cracked. PUH inside cog LD 2 jt + set TIW valve + model R pkr at 25'. Spear 4 1/2 cog, pull cog, cut loose + change out wellhead. Spear 4 1/2 cog + set slips. POH w/pkr + NU BOP. RIH WIDE + start jet wash at 3892. Tag bridge at 3940 + CO to 3945. PU swivel + get circ. Do from 4017 to TD (4150). Circ clean PUH to 3987 + jet wash to 4108, clean out to TD. RIH w/2 3/8" x 4 1/2 OTIS interval

14. I hereby certify that the foregoing is true and correct

Signed Christine L. Neff

Title ADMIN. ASSISTANT

(This space for Federal or State office use)

Date 11-1-91

Approved by _____
Comments of approval, if any:

Title _____

Date _____

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Number No. 1004-0135
Expires March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well ☐ Oil Well ☐ Gas Well ☒ Other <u>Injection</u>	5. Lease Designation and Serial No. <u>LC-058698B</u>
2. Name of Operator <u>CONOCO INC.</u>	6. If Indian, Alaskan or Tribe Name
3. Address and Telephone No. <u>10 DESTA DRIVE, STE 100 W, MIDLAND, TX 79705 (915) 686-5494</u>	7. If Unit or CA. Agreement Designation
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) <u>Unit letter D, Sect 23, T17S, R32E</u>	8. Well Name and No. <u>MCA Unit No. 31</u>
	9. API Well No. <u>30-025-00653</u>
	10. Field and Pool, or Exploratory Area <u>Maljamar (G-5A)</u>
	11. County or Parish, State <u>Lea, nm</u>

CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION	
☐ Notice of Lease	☐ Abandonment	☐ Change of Plans
☒ Subsequent Report	☐ Recompletion	☐ New Construction
☐ Final Abandonment Notice	☐ Plugging Back	☐ Non-Routine Fracturing
	☐ Casing Repair	☐ Water Shut-Off
	☐ Altering Casing	☐ Conversion to Injection
	☒ Other <u>Clean out</u>	☐ Dispose Water

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

* WS + Set plr at 3695. POH + LD WS. PU + RIH w/lot's on/off tool * 124 jts 23/8
Star FG tbg. Latch on * tst at 500#. Unlatch on/off tool. Circ ph. fluid. NO BOP.
Tst csg for 30 min at 500# - HE-D. 4-12-91

14. I hereby certify that the foregoing is true and correct

Signed Christine L. Neff

Title ADMIN. ASSISTANT

Date 11-1-91


(This space for Federal or State office use)

Approved by

Continued of approval, if any:

Title

Date

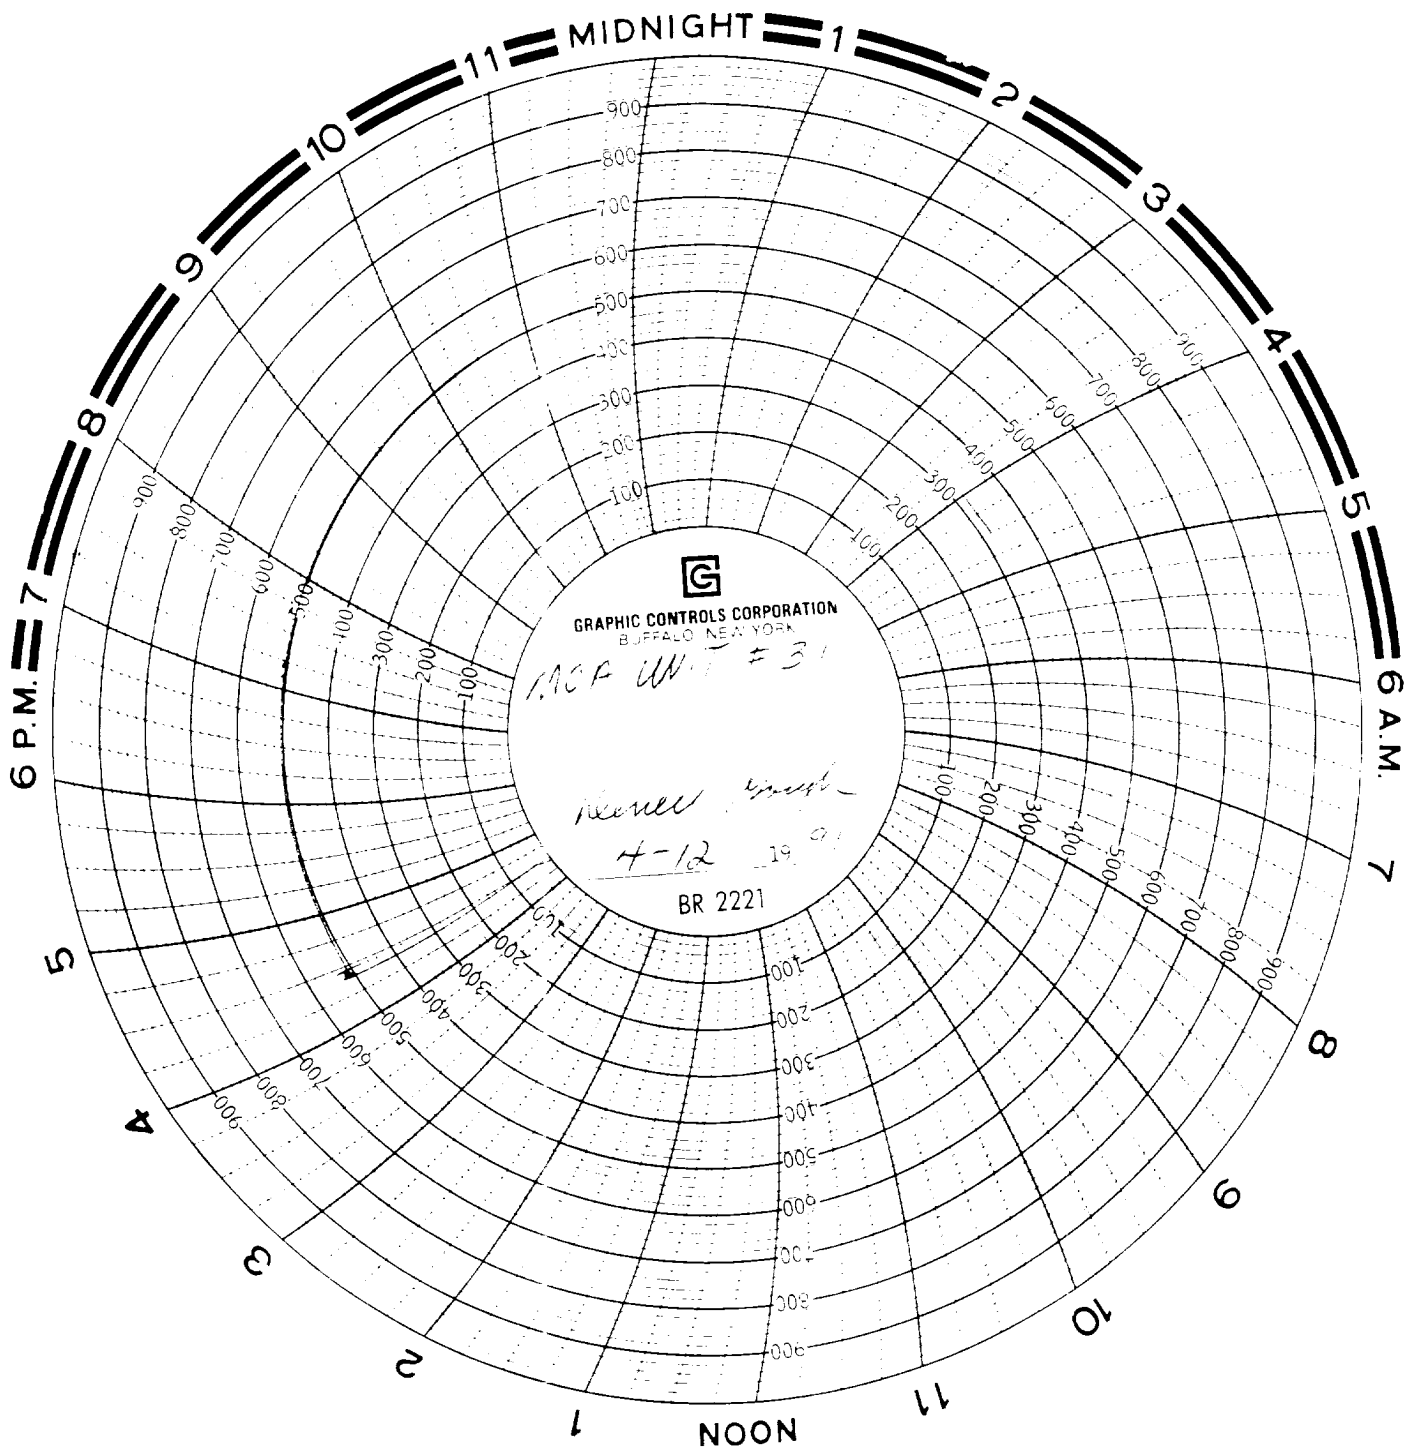

CONOCO INC. MCA

Well # MCA UNIT #31 Date 4-12-91

Foot Depth 3695' 0

Reason for CLEAN OUT OPEN

The test HOLE

Witness Samuel Jones

CONOCO INC. MCA

Well # _____

Foot Depth _____

Reason for _____

The test _____

Witness _____