


(SUBMIT IN TRIPLICATE)

Land Office Los Cruces

Lease No. 057210

Unit Lease

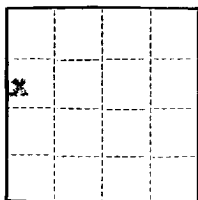

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	<u>Subsequent Report of CO,</u> <u>and replace Tbg.</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Queen B April 24, 1961

Well No. 15 is located 1920 ft. from N line and 660 ft. from E line of sec. 28

SW/4 NW/4 Sec. 28 17-S 32-E NMPN
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Maljamar Lea New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3976 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Before workover - TD 4010 Polo, TP 1, Elev 3976. Pay Grayb-San and 3536-4010 open hole. Csg PT 5 1/2 at 3536. Tbg parted due to corrosion. Well Tsd. Daily Allowable 30 BO. Work Done - RU, Killed Well. Fished 28 ft. Corkscrewed Tbg /9 Jts Tbg remain in hole/. Drd & Co to 3800. Ran Tbg to 3693. Swbd well to flwg. Rec oil load and placed well on prod. After workover TD and pay same as before. /T/ 44 BO, No BW, in 24 Hrs, 32/64 Cbk, TP 160 lbs. CP 425 lbs, W/245.3 MCPGPD. GCR 5575. Daily allow 21 BO. Workover started 4-7-61, Comp 4-15-61. Well Tsd 4-21-61.

USOS-3 NMCC-2 VAM file

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Continental Oil Company

Address Rowley Bldg.

Artesia, New Mexico

By _____

Title District Superintendent