

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State ☒	Fee ☐
5. State Oil & Gas Lease No. L-6690-1	
7. Unit Agreement Name	
8. Farm or Lease Name Cabot "Q" State	
9. Well No. 1	
10. Field and Pool, or Whitcut Morton Wolfcamp	
12. County Lea	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator J.M. Huber Corporation
3. Address of Operator 1900 Wilco Building, Midland, Texas 79701	4. Location of Well UNIT LETTER <u>L</u> <u>1980</u> FEET FROM THE <u>South</u> LINE AND <u>560</u> FEET FROM THE <u>West</u> LINE, SECTION <u>7</u> TOWNSHIP <u>15S</u> RANGE <u>35E</u> N.M.P.M.
15. Elevation (Show whether DF, RT, GR, etc.) KB: 4053'	

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Spot a 200' (27 cu.ft.) cmt. plug above perfs from 10,120' to 9920' inside 5½" csg. Use 26 sx Class "H" w/0.2% HR-5 (retarder).
- Spot a 200' (27 cu.ft.) cmt. plug across the casing patch at 8740' inside 5½" csg. Use 26 sx Class "H" with 0.2% HR-5.
- Spot a 200' (27 cu.ft.) cmt. plug across the top of the Abo @ 7990' inside 5½" csg. Use 26 sx Class "H" w/0.2% HR-5.
- Spot a 200' (27 cu.ft.) cmt. plug @ 6200' inside 5½" csg. Use 26 sx Class "H" w/0.2% HR-5.

5. 100' PLUG AT 500'

(See attached diagrams)


Estimated starting date is as soon as approval is received.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief. (915) 682-3794

SIGNED Robert R. Glenn TITLE District Production Mgr. DATE January 3, 1985

ORIGINAL SIGNED BY JERRY SEXTON
APPROVED BY DISTRICT SUPERVISOR TITLE _____ DATE JAN - 7 1985

CONDITIONS OF APPROVAL, IF ANY:

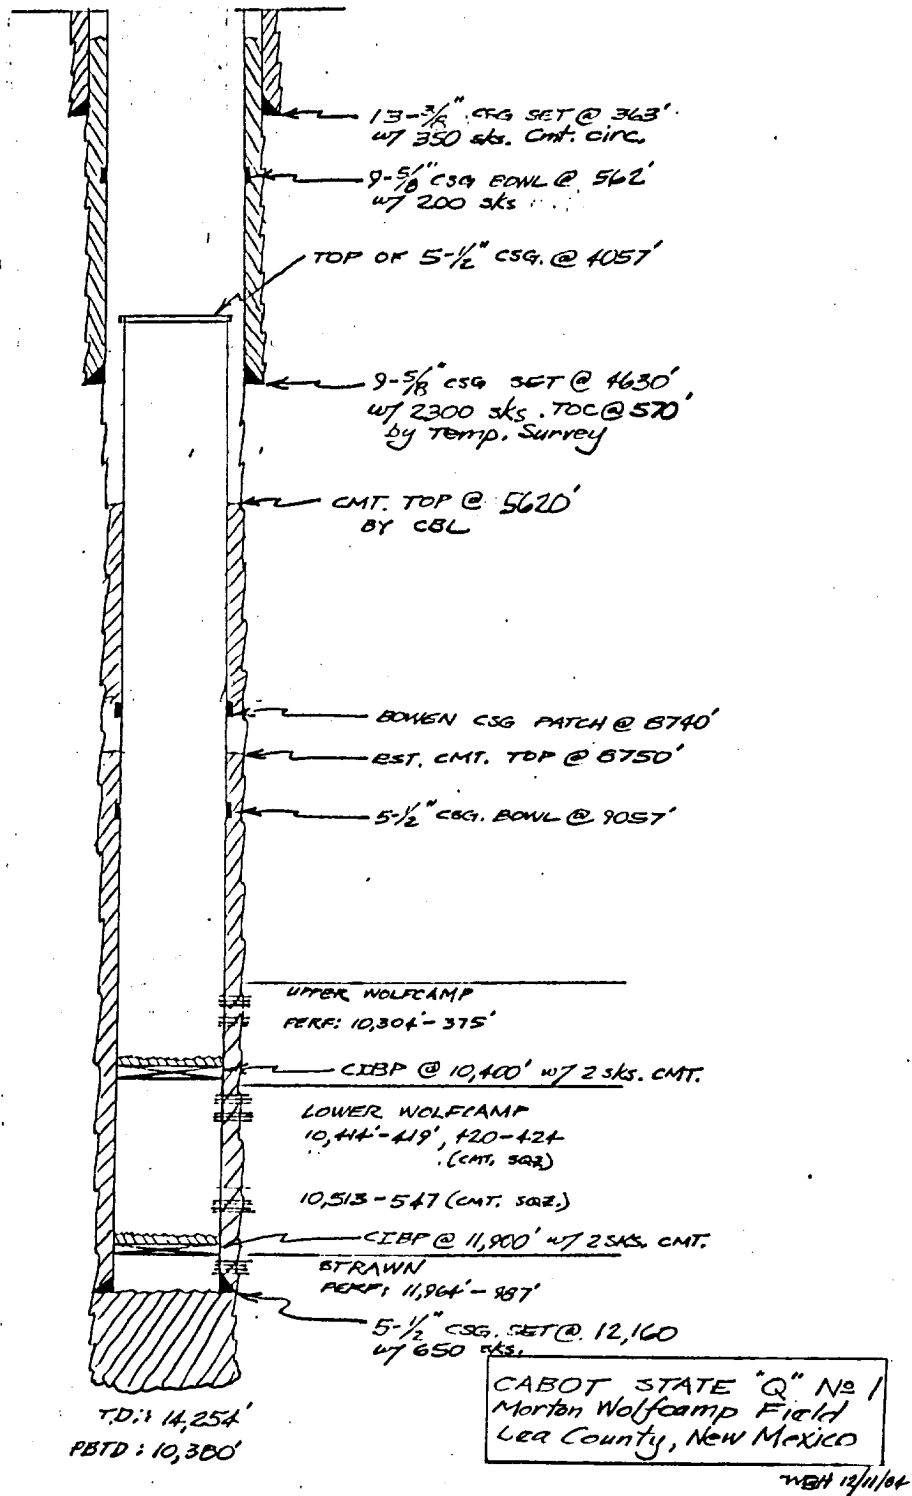

CURRENT STATUS

RECEIVED


JAN - 4 1985

O.C.D.
HOBBS OFFICE

RECEIVED

DEC 31 1984

O.C.D.
HOBBS OFFICE

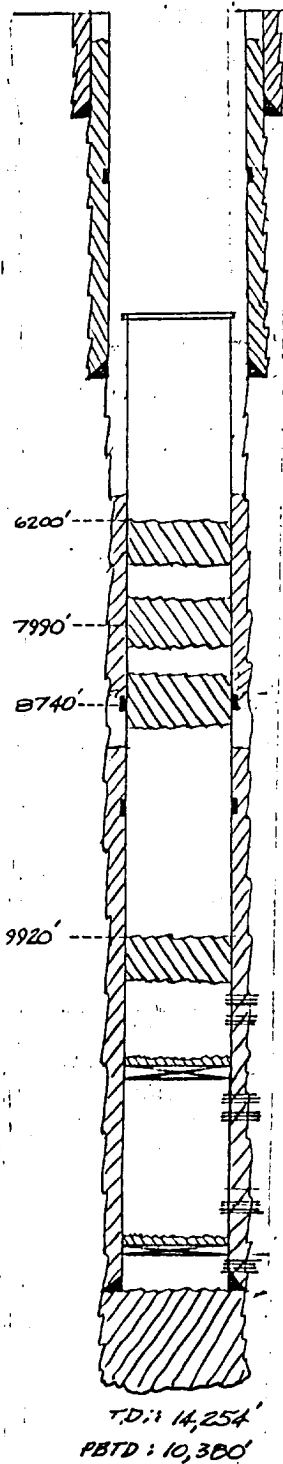

PROPOSED ABANDONMENT PROCEDURE

Cabot "Q" State No. 1

Lea County, New Mexico

1. Spot a 200' (27 cu.ft.) cmt. plug above perfs from 10,120' to 9920' inside 5½" csg. Use 26 sks Class "H" w/0.2% HR-5 (retarder).
2. Spot a 200' (27 cu.ft.) cmt. plug across the casing patch at 8740' inside 5½" csg. Use 26 sks Class "H" with 0.2% HR-5.
3. Spot a 200' (27 cu.ft.) cmt. plug across the top of the Abo @ 7990' inside 5½" csg. Use 26 sks Class "H" w/0.2% HR-5.
4. Spot a 200' (27 cu.ft.) cmt. plug @ 6200' inside 5½" csg. Use 26 sks Class "H" w/0.2% HR-5.

CABOT STATE "Q" No. 1
Morton Wolfcamp Field
Lea County, New Mexico

RECEIVED

JAN - 4 1985

CCF
HODDGE LICE

RECEIVED

JAN 31 1984

CCF
HODDGE LICE