

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.

NM - 237-5

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Mobil Oil Corporation	8. Farm or Lease Name New Mexico I
3. Address of Operator Box 633, Midland, Texas 79701	9. Well No. 1
4. Location of Well UNIT LETTER L, 660 FEET FROM THE West LINE AND 1980 FEET FROM THE South LINE, SECTION 36 TOWNSHIP 15-S RANGE 36-E NMPM.	10. Field and Pool, or Wildcat Dean Perm. Penn
15. Elevation (Show whether DF, RT, GR, etc.) -387.3	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER ☐
ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plug & Abandon as Per attached Procedure.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Authorized Agent DATE 12-18-70

APPROVED BY [Signature] TITLE SUPERVISOR DISTRICT DATE 12-18-70

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

FEB 21 1970

OIL CONSERVATION
RESEARCH

11

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS

Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions

Lease: New Mex "J" Well No. 1
Field: Dean Permo-Penn Pool
County: Lea State: New Mexico

RECOMMENDED PROCEDURE:


1. Load tubing w/ form. water and rig for pressure control. Perforate 2½" tubing as deep as possible above backed-off rods. Perf. 2-½" holes.
2. Place cement plug into annulus thru 2 holes and leave cement inside tubing for plug. (Note: 1400# pressure on csg. at surface. 0# on tbg. now). Hold pressure on csg. and tbg.
3. When plug is set - using salt mud fluid
 - a. Cut 2½" tbg at free point and pull
 - b. Set CIBP in 7" csg above tubing stub. Cap w/ 10 sx. cmt.
 - c. Cut 7" csg. at free point (est. @ 4300') and pull.
 - d. Spot 100 sx cement plug across stub of 7"
 - e. Spot 10 sx cement plug at surface and erect monument.
4. Clear location

Freelin. OCC approval on procedure - OK.

12-9-70

JCG/12-10-70

New Mex J #1
 Dean Permo Penn
 Lea County New Mexico

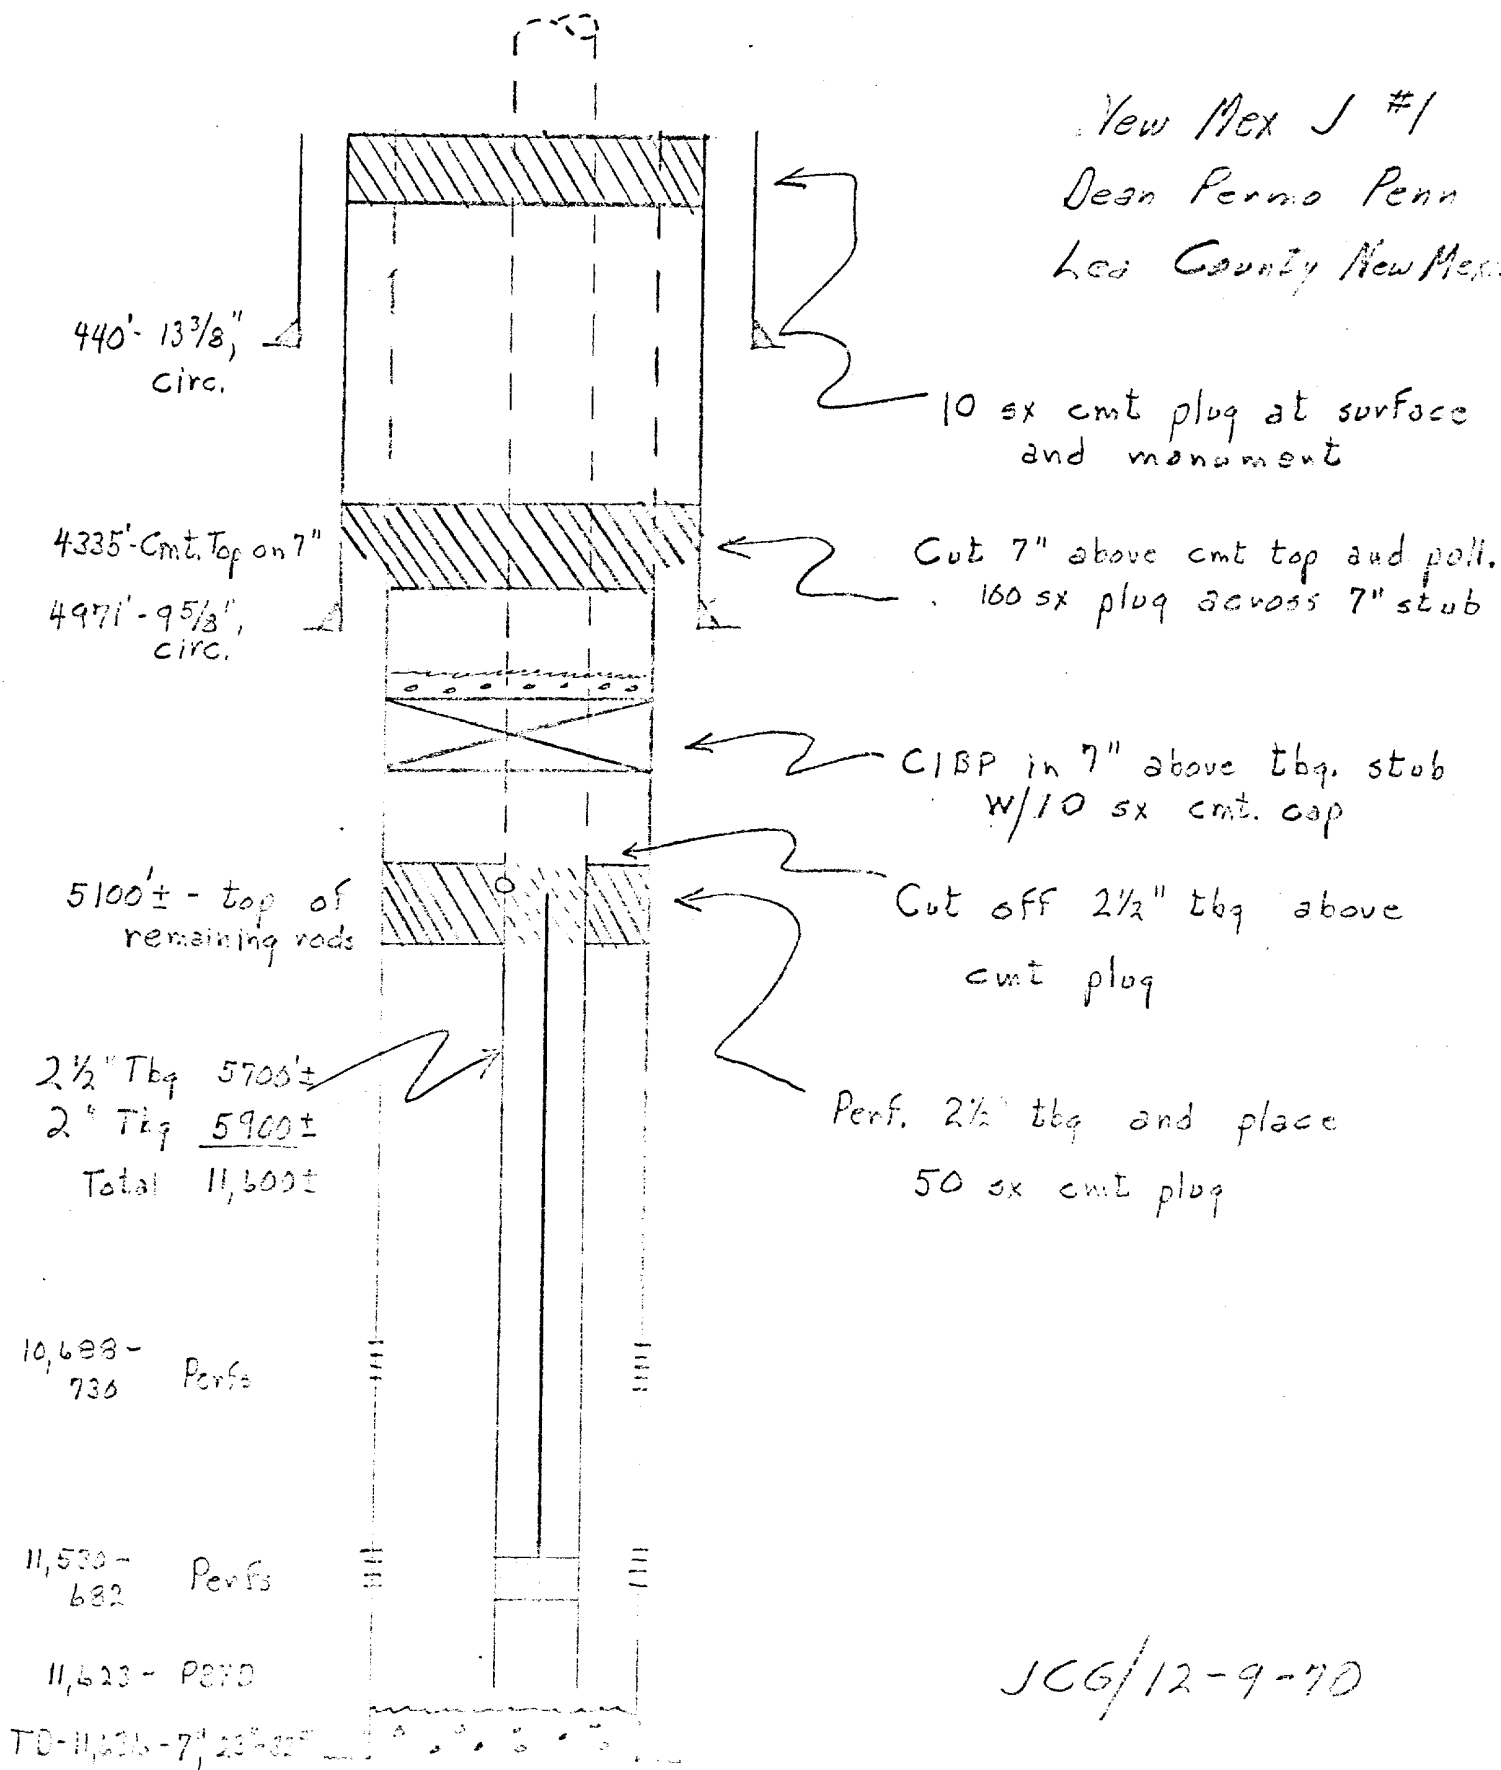

JCG/12-9-70