


PLUGGING & ABANDONMENT WORKSHEET (3 STRING CSNG)

OPERATOR CHEVRON - TEXACO Corp.
LEASENAME STATE "R"

WELL # 5
SECT 36 TWN 16-S RNG 36-E
FROM 330 N5L 2310 EWL
TD: 8450 FORMATION @ TD
PBD: 8400 FORMATION @ PBD ABO

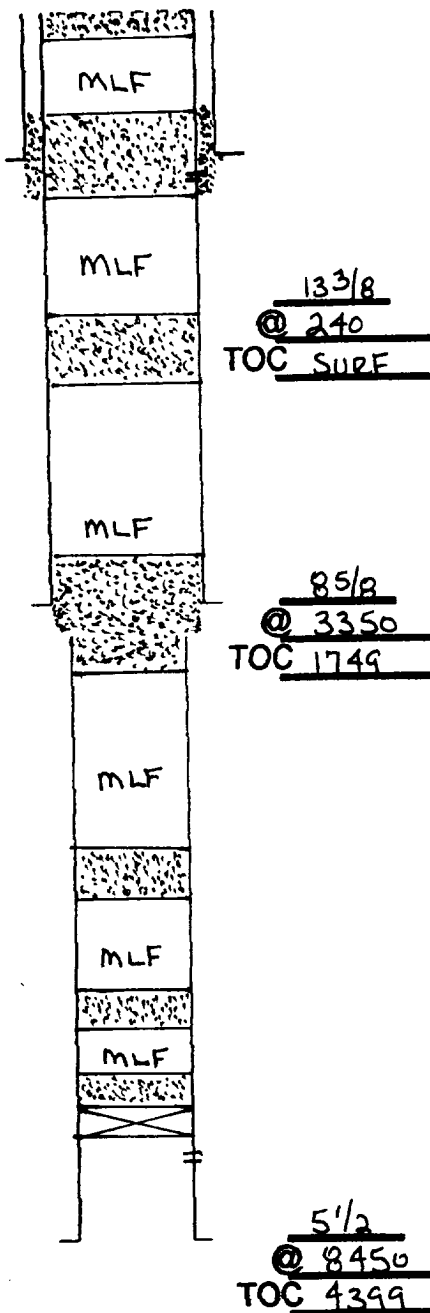

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	133/8	240	SURF	CIRC
INTMED 1	85/8	3350	1749	CALC
INTMED 2				
PROD	5 1/2	8450	4399	CALC
	SIZE	TOP	BOT	TOC DETERMINED BY
LINER 1				
LINER 2				
	CUT & PULL @		TOP - BOTTOM	
INTMED 1	3400		PERFS	8174 - 8274
INTMED 2			OPENHOLE	-
PROD				

* REQUIRED PLUGS DISTRICT I

PLUG	TYPE	SACKS	DEPTH
PLUG	PLUG	CMNT	
EXAMPLES			
PLUG #1	OH	25 SXS	9850'
PLUG #2	SHOE	50 SXS	8700'-8800'
PLUG #3	CIBP/35'		5300'
PLUG #3	CIBP	25 SXS	5300'
PLUG #4	STUB	50 SXS	4600'-4700'
PLUG #6	RETNR SQZ	200 SXS	400'
PLUG #7	SURF	10 SXS	0-10' 340'
PLUG #1	CIBP		8100'
PLUG #2	ABO	25 SX	8100'-7900'
PLUG #3	Glorieta	25 SX	6100'-5800'
PLUG #4	QUEEN	25 SX	4600'-4400'
PLUG #5	85/8 S	140 SX	3450'-3000'
PLUG #6	T-SALT	50 SX	2400'-2200'
PLUG #7	13 3/8 S	125 SX	300'-150'
PLUG #8	SURF	10 SX	10' - SURF
PLUG #9			
PLUG #10			
PLUG #			
PLUG #			
WC			
PEN			
STRAW			
ATOKA			
MORROW			
GEN			
DEVONIAN			

PLUG	TYPE	SACKS	DEPTH
PLUG	PLUG	CMNT	
EXAMPLES			
PLUG #1	OH	25 SXS	9850'
PLUG #2	SHOE	50 SXS	8700'-8800'
PLUG #3	CIBP/35'		5300'
PLUG #3	CIBP	25 SXS	5300'
PLUG #4	STUB	50 SXS	4600'-4700'
PLUG #6	RETNR SQZ	200 SXS	400'
PLUG #7	SURF	10 SXS	0-10' 340'
PLUG #1	CIBP		8100'
PLUG #2	ABO	25 SX	8100'-7900'
PLUG #3	Glorieta	25 SX	6100'-5800'
PLUG #4	QUEEN	25 SX	4600'-4400'
PLUG #5	85/8 S	140 SX	3450'-3000'
PLUG #6	T-SALT	50 SX	2400'-2200'
PLUG #7	13 3/8 S	125 SX	300'-150'
PLUG #8	SURF	10 SX	10' - SURF
PLUG #9			
PLUG #10			
PLUG #			
PLUG #			
WC			
PEN			
STRAW			
ATOKA			
MORROW			
GEN			
DEVONIAN			

TD 8450

6789101121314151617181920