

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO. 30-025-05155
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name: Denton North Wolfcamp Unit Tract 6

8. Well No. 28

9. Pool name or Wildcat Denton Wolfcamp
--

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other

2. Name of Operator Stephens & Johnson Operating Co.

3. Address of Operator P O Box 2249, Wichita Falls, TX 76307-2249
--

4. Well Location Unit Letter <u>I</u> : <u>1980</u> feet from the <u>South</u> line and <u>460</u> feet from the <u>East</u> line Section <u>26 (NE SE)</u> Township <u>14S</u> Range <u>37E</u> NMPM County <u>Lea</u>
--

10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3825 KB

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Well has been temporarily abandoned since 1-1-93. Will plug and abandon.

See attached plugging procedure.

THE COMMISSION MUST BE NOTIFIED 24
HOURS PRIOR TO THE BEGINNING OF
PLUGGING OPERATIONS FOR THE C-103
TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _____ TITLE Manager of Operations DATE 6-25-02

Type or print name Peyton S. Carnes, Jr. Telephone No. 940-723-2166
(This space for State use)

APPROVED BY _____ TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE 6-20-02
Conditions of approval, if any:


ORIGINAL SIGNED BY
GARY W. WINK

DENTON NORTH WOLFCAMP UNIT WELL NO. 6-28

Plugging Procedure:

- 1) Set 5 1/2" CIBP @ 9200' with 35' cement on plug.
- 2) Run tubing to 9165', tag plug and load hole with 9.5# mud laden salt water.
- 3) Spot 25 sack plug @ 6300' in 5 1/2" casing.
- 4) Spot 30 sack plug 50' inside of 5 1/2" liner (4709') to 4457' inside of 7 5/8" casing. Tag plug.
- 5) Spot 25 sack plug at 3150' in 7 5/8" casing.
- 6) Spot 25 sack plug at 2200' in 7 5/8" casing.
- 7) Spot 125 sack plug 50' below surface casing to surface in 7 5/8" casing.
- 8) Cut off casing 3' below ground and install permanent marker.

Diagrammatic Well Section
Denton, North Wolfcamp Unit Well No. 6-28
Denton N. (Wolfcamp) Field
Lea County, New Mexico

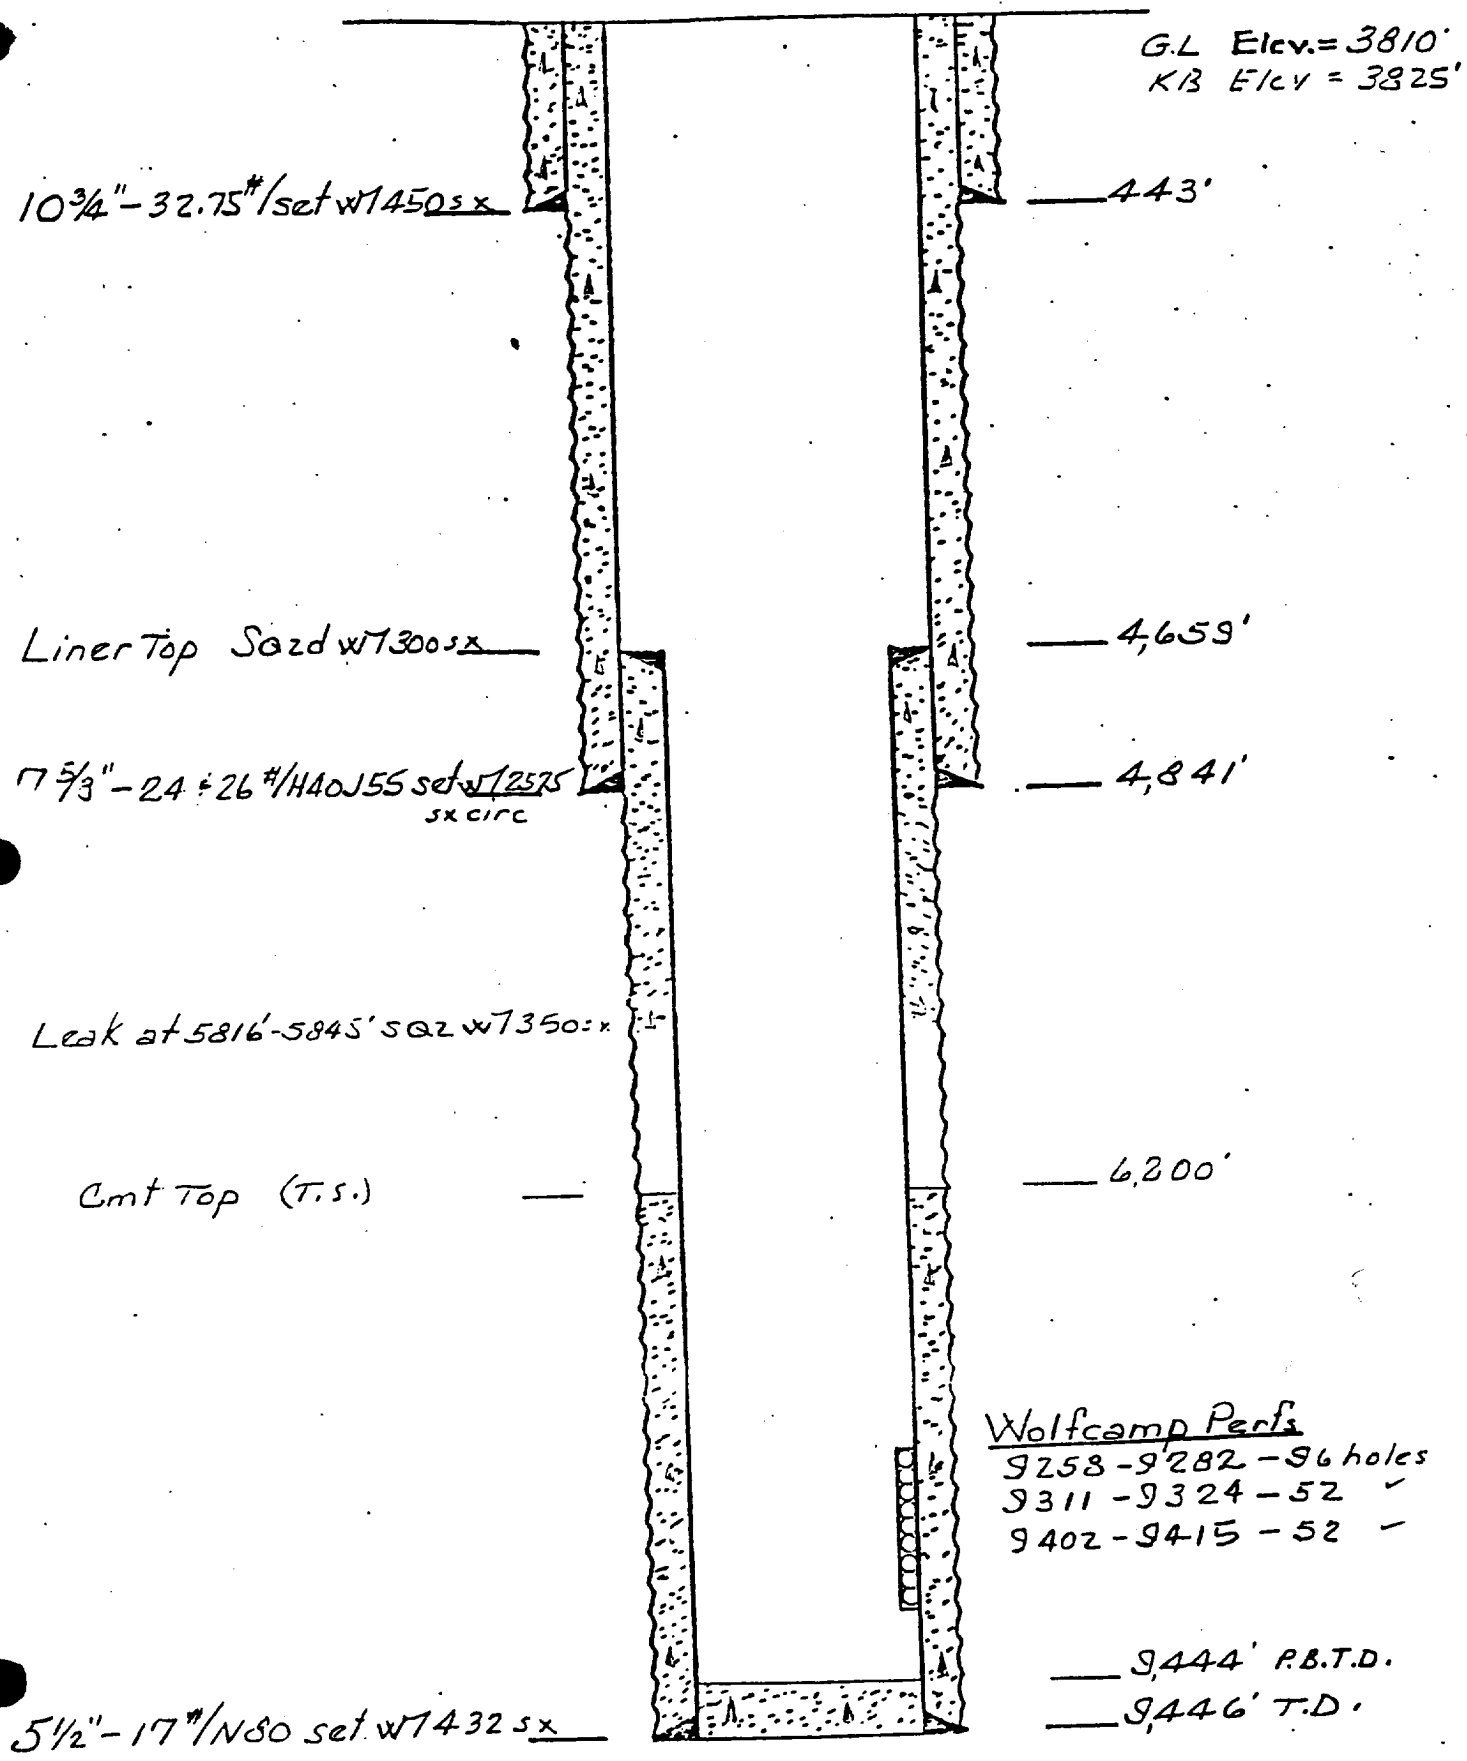

G.L Elev. = 3810'
 KB Elev = 3825'

Wolfcamp Perfs
 9258-9282 - 96 holes
 9311-9324 - 52 ✓
 9402-9415 - 52 -

9444' P.B.T.D.
 9446' T.D.

5-24-73
 IGW