

NEW MEXICO OIL CONSERVATION COMMISSION
Santa Fe, New Mexico

MISCELLANEOUS REPORTS ON WELL

Submit this report in triplicate to the Oil Conservation Commission or its proper agent within ten days after the work specified is completed. It should be signed and sworn to before a notary public for reports on beginning drilling operations, results of shooting well, results of test of casing shut-offs, results of plugging of well, and other important operations, even though the work was witnessed by an agent of the commission. Reports on minor operations need not be signed and sworn to before a notary public. See additional instructions in the Rules and Regulations of the Commission.

Indicate nature of report by checking below:

REPORT ON BEGINNING DRILLING OPERATIONS		REPORT ON REPAIRING WELL	
REPORT ON RESULT OF SHOOTING OR CHEMICAL TREATMENT OF WELL		REPORT ON PULLING OR OTHERWISE ALTERING CASING	
REPORT ON RESULT OF TEST OF CASING SHUT-OFF		REPORT ON DEEPENING WELL	
REPORT ON RESULT OF PLUGGING OF WELL	X		

Hobbs, New Mexico

August 20, 1938

Place

Date

OIL CONSERVATION COMMISSION,
Santa Fe, New Mexico.

DUPLICATE

Gentlemen:

Following is a report on the work done and the results obtained under the heading noted above at the

Continental Oil Company State **K-29** Well No. **1** in the
COMPANY OR OPERATOR LEASE
Center SW/4 of SE/4 of Sec. **29**, T. **16**, R. **37**, N. M. P. M.,
Field, **Lea** County


The dates of this work were as follows: **August 21, 22, 23, 24, & 25, 1938**

Notice of intention to do the work was ~~crossed out~~ submitted on Form C-102 on **August 20** 19**38**
and approval of the proposed plan was (was not) obtained. (Cross out incorrect words)

DETAILED ACCOUNT OF WORK DONE AND RESULTS OBTAINED

Cemented bottom of hole with 50 sacks cement from 5303 to 5178'. Filled hole with 12 $\frac{1}{2}$ mud from 5178 to 3266', set cement plug in bottom of 9-5/8" casing from 3266 to 3131'. Shot and parted 9-5/8" casing at 995'. Set cement plug from 1000' to 944'. Filled hole with 12 $\frac{1}{2}$ mud from 994 to point 25' below cellar inside 13" casing. Set bridge inside 13" at 25' and filled back with cement to bottom of cellar. Cellar filled and 4" marker set.

Witnessed by **C. R. Allen** **Harschbach Drilg. Co.**
Name Company

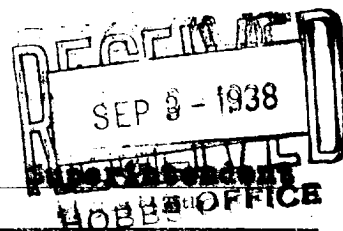

Subscribed and sworn to before me this **29th**
day of **August**, 19 **38**
J. D. McFarland
Notary Public

I hereby swear or affirm that the information given above is true and correct.

Name *H. J. Harschbach*
Position **District Supt.**

Representing **Continental Oil Company**
Company or Operator

My Commission expires **4-26-41**

Address **Box CC, Hobbs, N.M.**

Remarks:

Ross Walker L.M.
Name

Oil & Gas Inspector
Title

