M M Oil Com Division

form 3160-5 November 1994) I	U ED STATE DEPARTMENT OF THE	INTERIOR 16	25 N. French Di	OME Expi	RM APPROVED 8 No. 1004-0135 res July 31, 1996
	BUREAU OF LAND MANA		obbs, NM 38 24 (5. Lease Serial N	o.
•	Y NOTICES AND REPO				C 057210 g
Do not use the abandoned we	is form for proposals to ell. Use Form 3160-3 (AP.	drill or to re-ent D) for such propo	er an Sais. 	6. If Indian, Allo	ttee or Tribe Name
SUBMIT IN TR	IPLICATE - Other Instr	uctions on reve	rse side	7. If Unit or CA/	Agreement, Name and/or No.
l. Type of Weil Oil Weil Gas Well	Other Injection	on		8. Well Name and	
2. Name of Operator				9. API Well No.	.C.A. No. 302
Conoco Inc. 3a. Address 3b. Phone No. (include area code)				-	25-24298
10 Desta Dr. Ste 100W Midland, TX 915-686-5424				10. Field and Pool, or Exploratory Area	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)				Maljamar GB-SA	
Un. P, 510' FSL & 510' FEL Section 27, T-17S, R-32E				11. County or Pari	ish, State County, NM
12. CHECK AP	PROPRIATE BOX(ES) T	O INDICATE NA	TURE OF NOTICE, R	EPORT, OR OT	HER DATA
TYPE OF SUBMISSION			TYPE OF ACTION		
Notice of Intent	Acidize Alter Casing	Deepen Fracture Treat	Production (Star	· / _	Water Shut-Off Well Integrity
Subsequent Report	Casing Repair	New Constructi	on 🖸 Recomplete		Other
☐ Final Abandonment Notice	Change Plans Convert to Injection	Plug and Aband Plug Back	on Temporarily Ab Water Disposal		
Attach the Bond under which the	ectionally or recomplete horizont he work will be performed or pr volved operations. If the operation inal Abandonment Notices shall	ally, give subsurface le ovide the Bond No. or on results in a multiple	ecations and measured and transitions and transitions file with BLM/BIA. Requiremental completion or recompletion	ue vertical depths of ired subsequent repo in a new interval, a	all pertinent markers and zone its shall be filed within 30 da Form 3160-4 shall be filed on
1. Set a C.I.B.	P. at 4050'.	Circulate ḥ	ole with gell	ed brine n	mud.
2. Spot 25 sxs	cement on top of	of C.I.B.P.	at 4050'.		
3. Spot 25 sxs	cement plug 209	00'-2450'.	TAG		
4. Perforate th	ne 4 1/2" casing	g at 1040'.			
5. Set a cement	retainer at 94	10' and pum	p 35 sxs ceme	nt thru po	erfs at 1040'.
	ne 4 1/2" casing			sxs ceme	nt thru
7. Install dryh	nole marker and	clear loca	tion. SE	E ATTACH	ED FOR
				TIONS OF	APPROVAL
14. I hereby certify that the foregoin Name (Printed Typed)	ing is true and correct	Tid	Sr. Staff	Reg. 1	l ss+,
Signature Dan L	Vilhes	Da	s-4-	00	
	THIS SPACE	FOR FEDERAL C	R STATE OFFICE US	E	
Approved by (ORIG. SG	D.) ALEXIS C. SWOBOD		PETROLEUM EN		MAY 0 9 2000

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

RECEIVED
MAY 0 5 2000
BLM
ROSWELL, NM

Age Cost Asset (Age)

CURRENT WELLBORE 4/20/00 Elev. = 3948' GR + 11' KB990' - 8 5/8" Casing. Cemented w/550 sxs. Circulated to Surface. T.O.C. **9** 2400' (Temp. Survey) Perfs 4101'-4350' 4400' - 4 1/2", 9.5#, Casing. Cemented w/400 sxs T.D. @ 4400' CONOCO, INC. M.C.A. Unit #302

510' FSL & FEL

Lea County, NM


Sec. 27, T-17S, R-32E

RECEIVED
MAY 0 5 2000

BLM ROSWELL, NM A CONTRACTOR OF THE CONTRACTOR

PROPOSED PLUG AND ABANDONMENT 4/20/00

Elev. = 3948' GR +11' KB

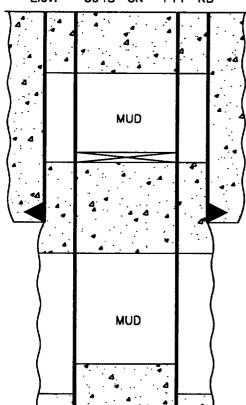

PERFORATE THE 4 1/2" CASING AT 300' CIRCULATE 80 SXS CEMENT THRU PERFS AT 300'

SET A CEMENT RETAINER AT 940' SQUEEZE 35 SXS CEMENT THRU PERFS AT 1040'

990' - 8 5/8" Casing. Cemented w/550 sxs. Circulated to Surface.

PERFORATE THE 4 1/2" CASING AT 1040'

SPOT 25 SXS CEMENT 2090'-2450'

T.O.C. **9** 2400' (Temp. Survey)

SPOT 25 SXS CEMENT ON TOP OF C.I.B.P.

SET A C.I.B.P. @ 4050'

Perfs 4101'-4350'

4400' - 4 1/2", 9.5#, Casing. Cemented w/400 sxs

T.D. @ 4400'

MUD

CONOCO, INC.
M.C.A. Unit #302
510' FSL & FEL
Sec. 27, T-17S, R-32E
Lea County, NM

RECEIVED

PROPERMENT

MAY 0 5 2000

BLM

ROSWELL, NM