

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30-025-35091

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil / Gas Lease No.

7. Lease Name or Unit Agreement Name

BLTN STATE

8. Well No.

1

9. Pool Name or Wildcat

SHOE BAR WOLFCAMP NORTH

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator
PO BOX 3109, MIDLAND, TX 79702

4. Well Location

Unit Letter F : 1653 Feet From The NORTH Line and 1690 Feet From The WEST Line

Section 20 Township 16S Range 36E NMPM LEA COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3939'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

REMEDIAL WORK ☐

ALTERING CASING ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

COMMENCE DRILLING OPERATION ☐

PLUG AND ABANDONMENT ☐

PULL OR ALTER CASING ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

TA PENN & WOLFCAMP ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

7-20-01: MIRU. NDWH. NUBOP.

7-23-01: TIH W/BIT & CSG SCRAPER ON 362 JTS 2 7/8" TBG. TAG @ 11,340'. DISPL W/270 BBLS 2% KCL WTR. TEST CSG & CIBP ON CHART TO 550# FOR 30 MINS-NO LOSS. (CHART ATTACHED) ABANDON LOWER PENN.

7-24-01: TIH & RUN PDC LOG 10,600-9600. TIH W/CMT BAILER & DUMP 35' CMT ON CIBP. NEW PBTD @ 11,305'. TIH W/PERF GUN & PERF WOLFCAMP FORMATION 10335-342, 10384-86, 10391-393, 10436-438, 10440-442, 10448-458. TIH W/2 7/8" TBG TO 1889'.

7-25-01: TIH W/PKR & SN ON 333 JTS 2 7/8" TBG. STOP PKR @ 10458. SPOT 3 BBLS 20% NEFE HCL ACR WOLFCAMP PERFS 10300-10458. PULL PKR TO 10207. REV 5 BBLS 2% KCL WTR DN CSG. SET PKR @ 10207. ATTEMPT TO BREAK DN PERFS. OPEN BY PASS & PUMP 10 BBLS 20% ACID TO PKR. CLOSE BY PASS. ACIDIZE PERFS W/6454 GALS 20% NEFE HCL.

7-26-01: RU SWAB. FL @ SURF. END FL @ 5600'.

8-02-01: REL PKR. TIH W/PPI TOOL W/26' SPACING, & SN ON TBG. STOP TOOL @ 10264.

8-03-01: LOWER PPI TOOL TO 10517. REL & LOWER TOOL TO 10577. PULL ABOVE PERFS & SET @ 10260.

8-06-01: TIH TO 10602. TRY TO TEST TOOLS. NO TEST. LOWER TOOLS TO 10917 & SET. NO HOLD.

8-07-01: TIH W/SN ON TBG. OPEN ENDED TO 10917. TIH W/PPI TOOL & SET @ 10539.

8-08-01: SET TOOL @ 10434. ACIDIZE WOLFCAMP PERFS 10436-10458 W/1100 GALS 15% NEFE HCL. TEST PERFS 10384-10393 W/300 GALS 15% NEFE HCL. MOVE TOOLS TO 10321 & SET. ACIDIZE PERFS 10335-10342 W/500 GALS 15% NEFE HCL. MOVE TOOLS TO 10290 & SET. ACIDIZE PERFS 10300-10308 W/600 GALS 15% NEFE HCL. UNSET TOOLS & LOWER TO 10917. SWABBING.

8-16-01: TIH W/BULL PLUG ON 4' PERF SUB, SN ON 356 JTS 2 7/8" TBG. SN @ 11156'. BTM OF TBG @ 11160. NDBOP. NUWH.

8-17-01: TIH W/RDS. INSTL PUMPING T & VALVE. RIG DOWN. EVALUATE TO RUN RBP & PKR TO SWAB EACH SET OF PERFS.

9-24-01: MIRU. TIH W/RBP & PKR, SN ON TBG. SET RBP @ 10320. PKR @ 10318. UNSET RBP & RESET @ 10330. PKR @ 10328. SWABBING.

10-01-01: TIH W/CIBP & SET @ 10255. TA WOLFCAMP. DUMP 35' CMT ON CIBP. NEW PBTD @ 10220. TIH W/SN ON TBG. 10-02-01: TIH W/TBG. DISPL W/240 BBLS PKR FLUID. PRESS CSG & PLUG TO 560# ON CHART FOR NMOC. CHART ATTACHED. TEMPORARILY ABANDONED.

This Approval of Temporary
Abandonment Expires 10/11/06

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

J. Denise Leake

TITLE

Engineering Assistant

DATE 10/8/01

Telephone No. 915-688-4752

TYPE OR PRINT NAME

J. Denise Leake

(This space for State Use)

APPROVED


CONDITIONS OF APPROVAL IF ANY:


TITLE


DATE

DeSoto/Nov 01 03 ver 1.0


West Dr
on Lexington Penn

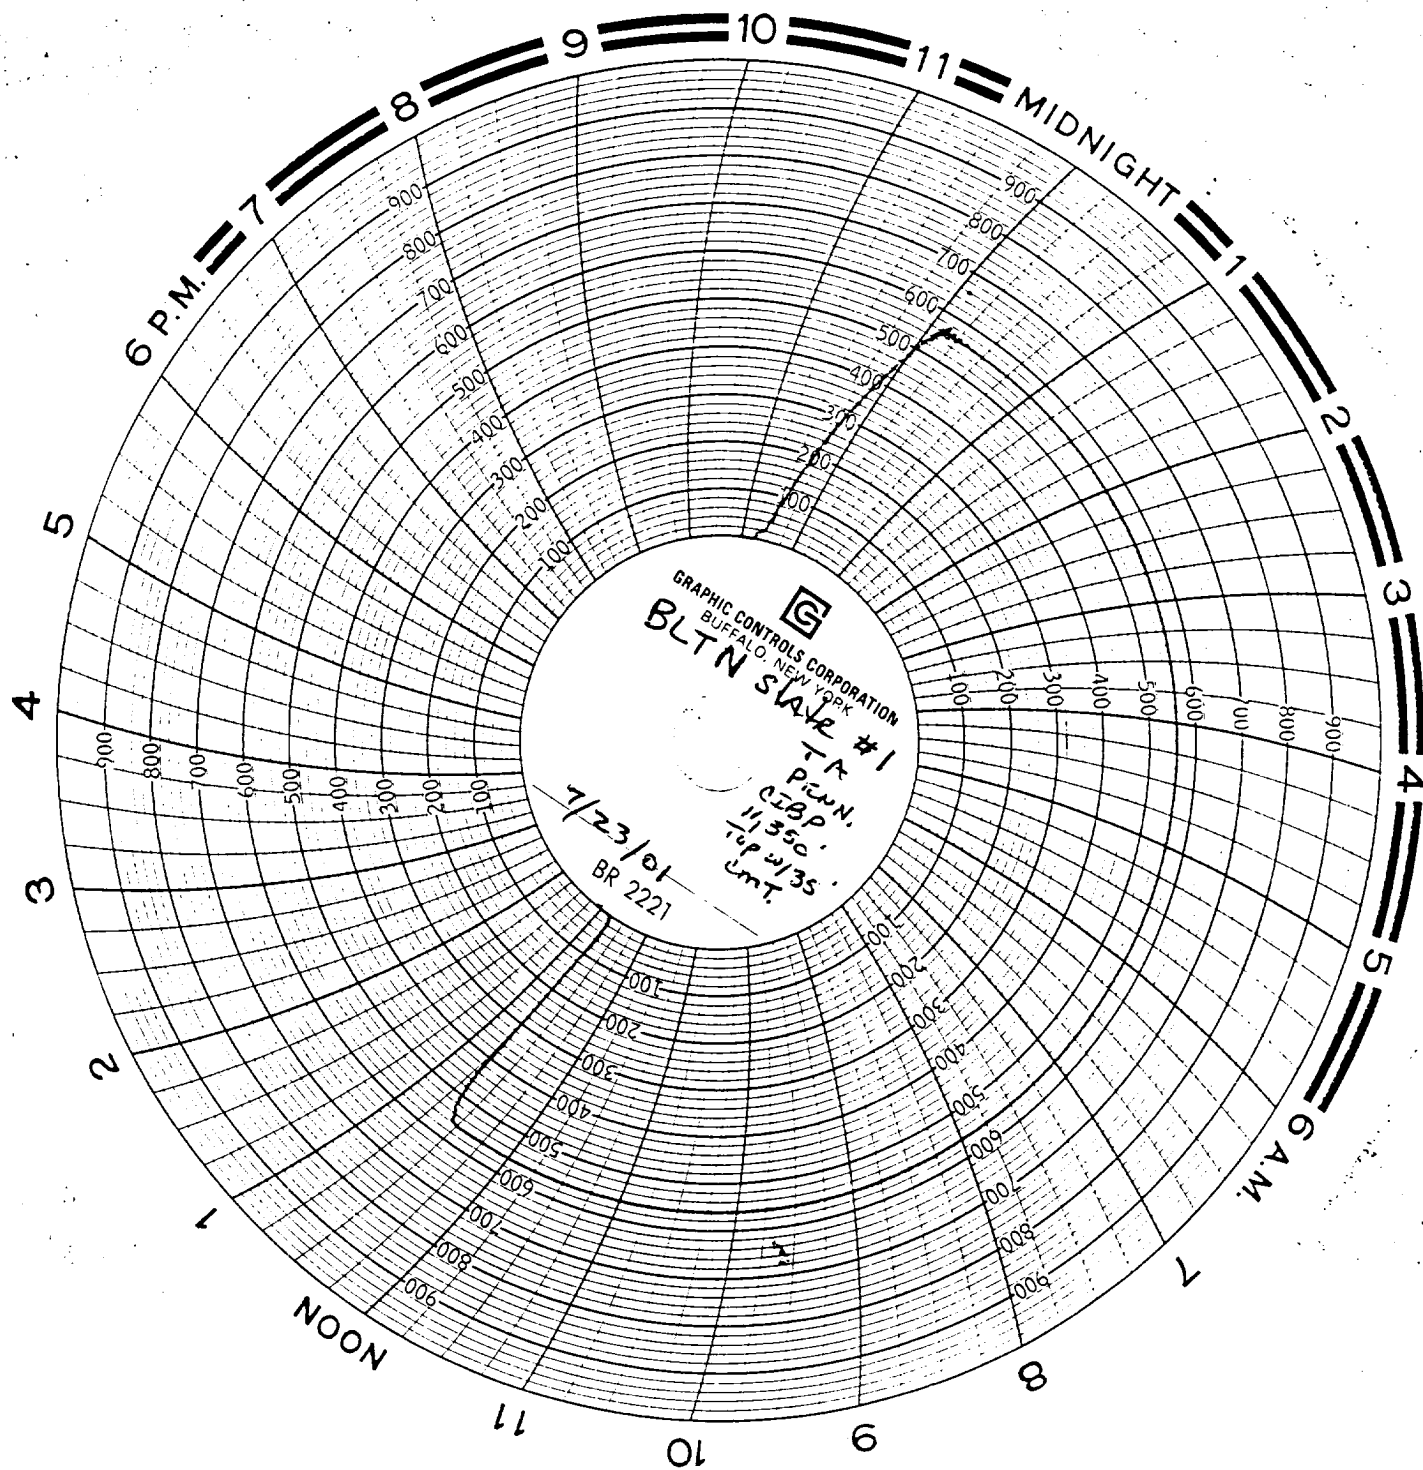

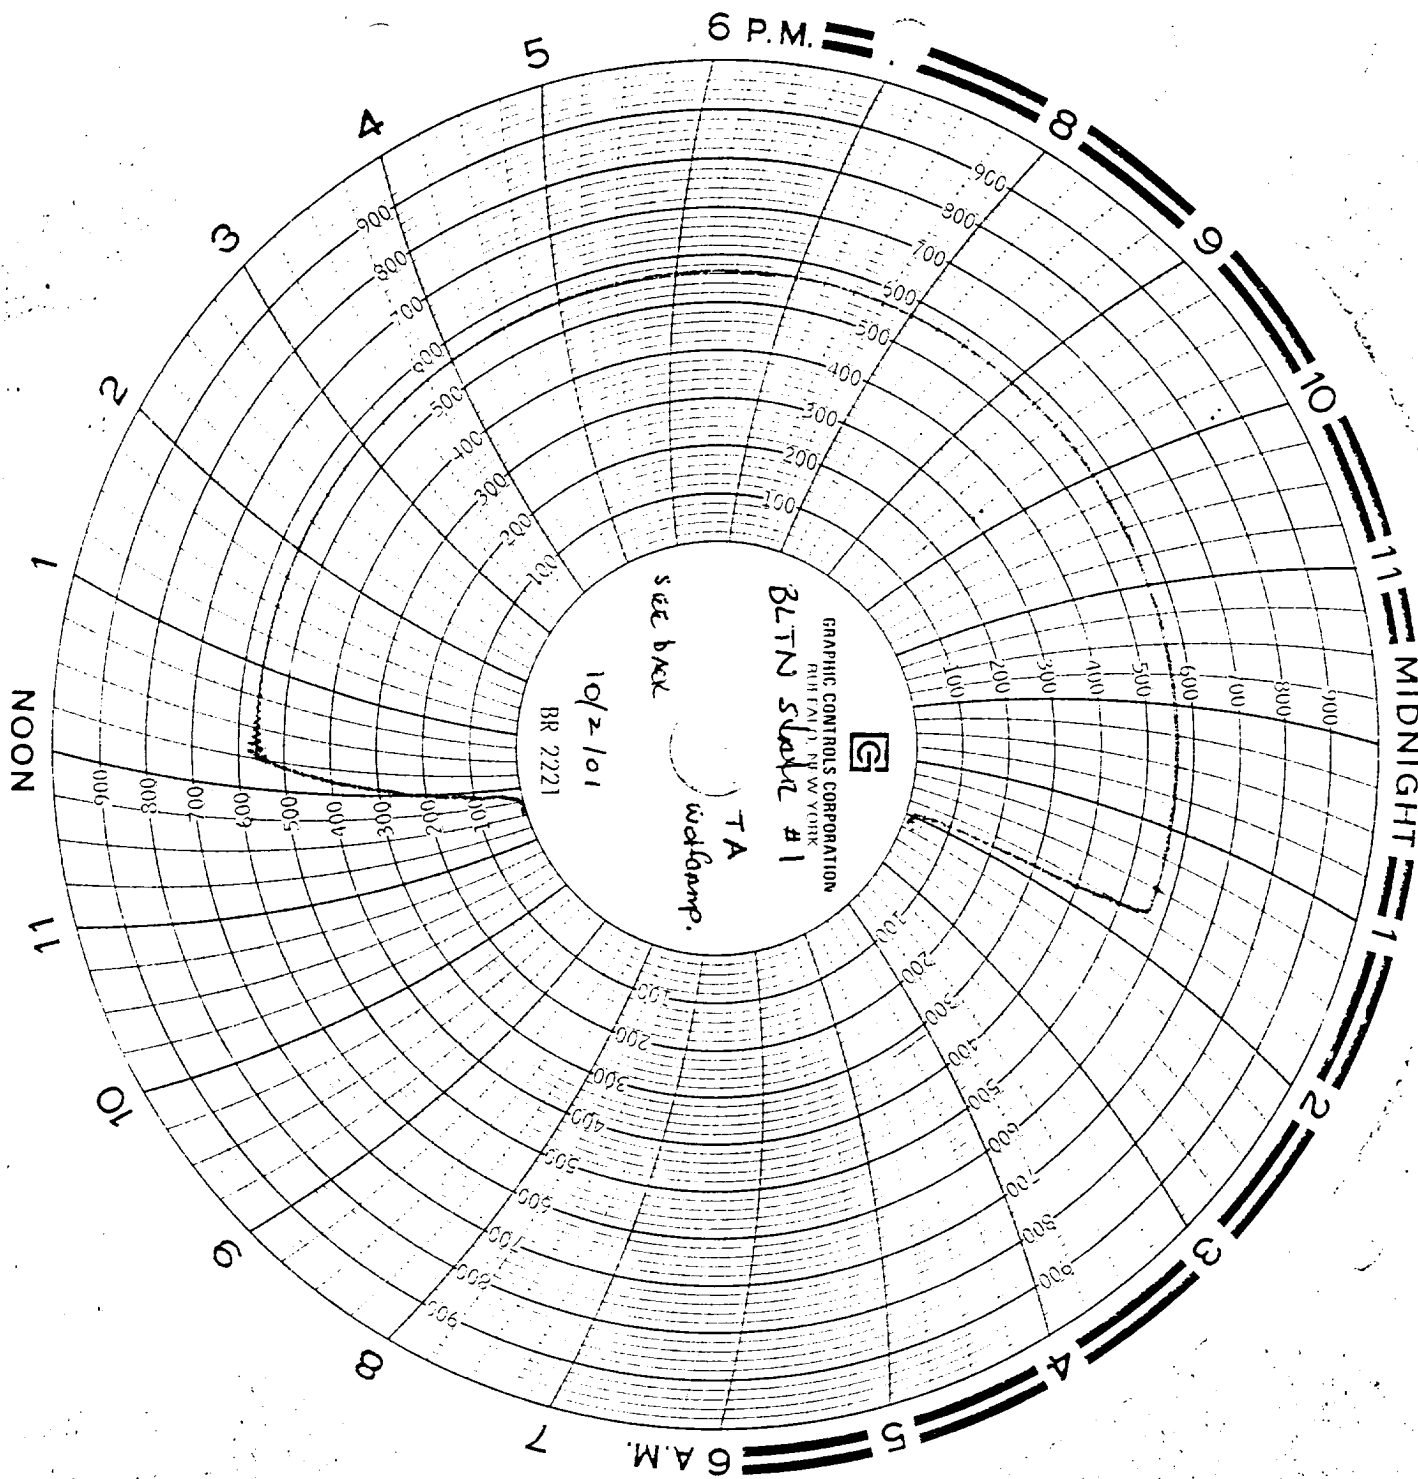

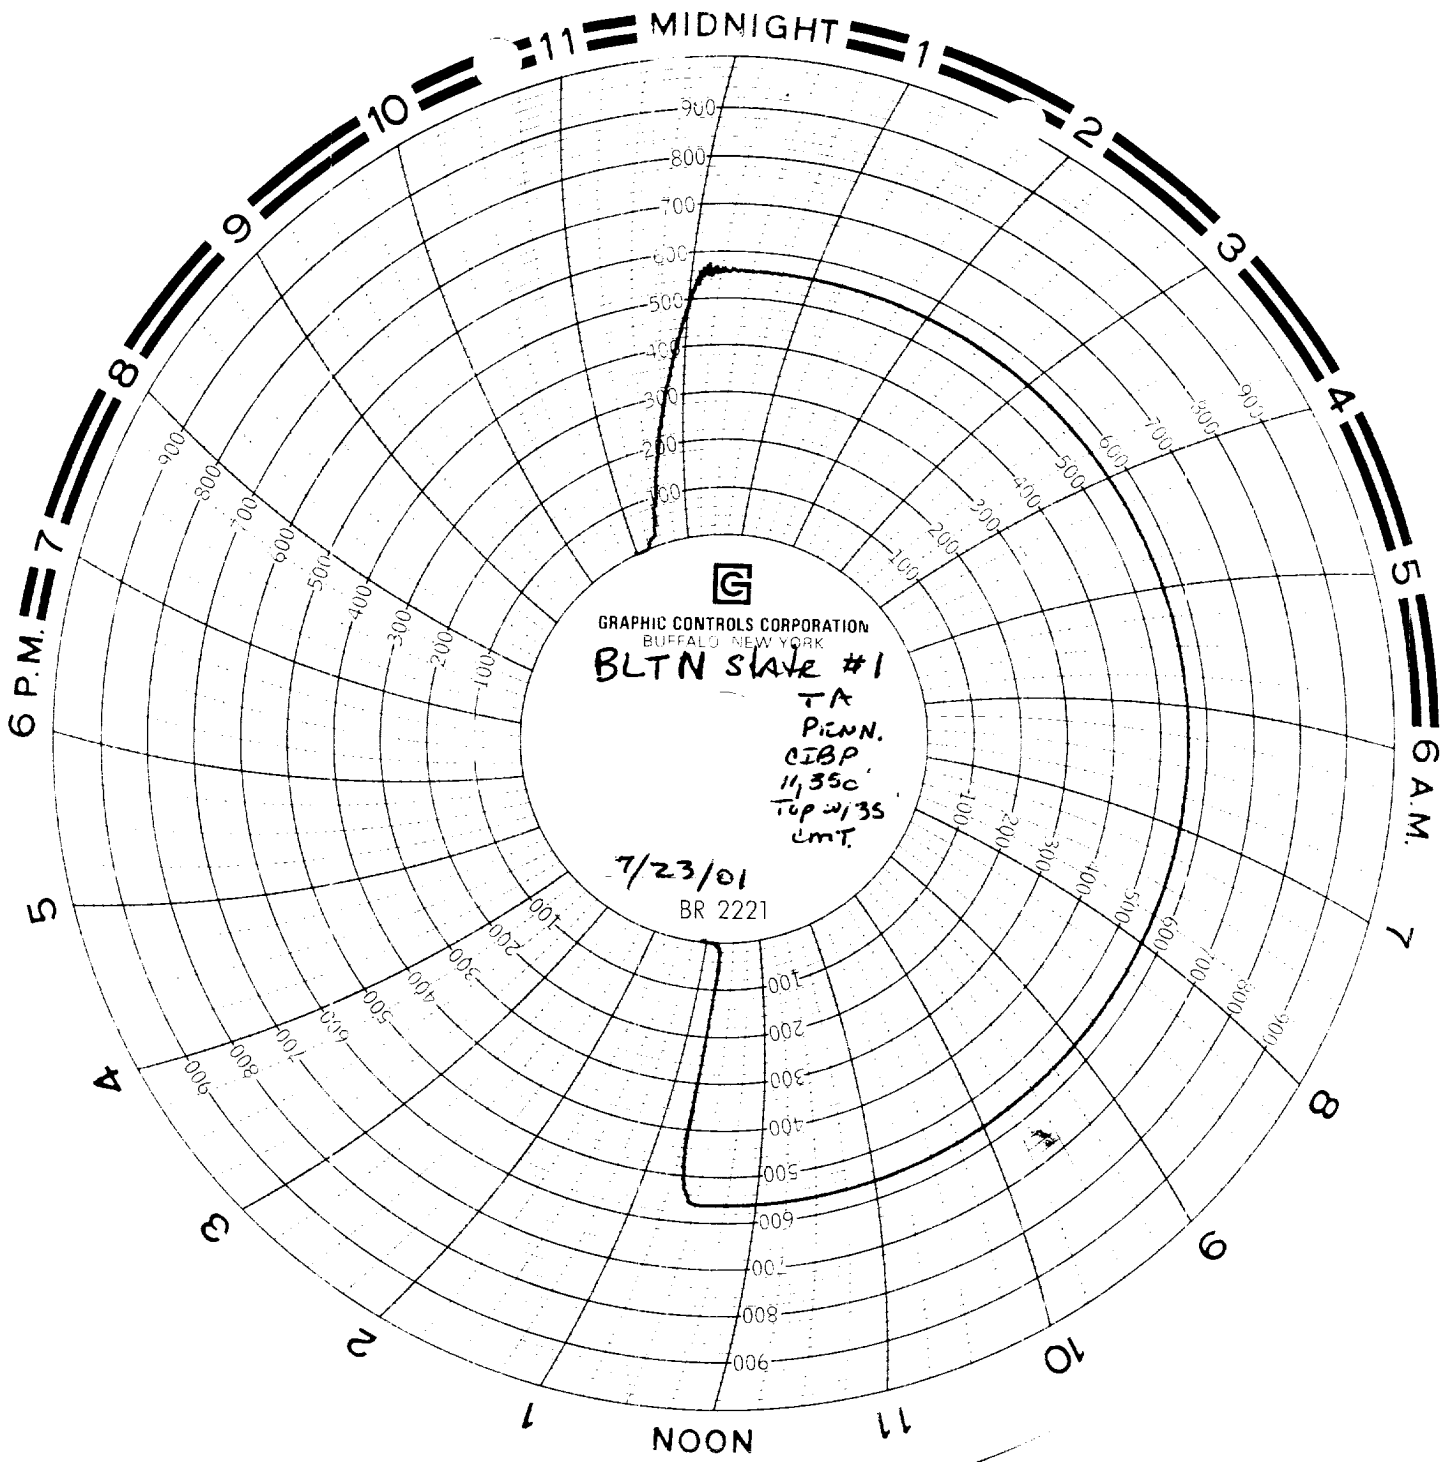

BLTN State # 1
GIBP @ 11350 w/10' sand
Date of Calibration 6-1-01
American Valve + Meter
Jerry Martin
1000 # Spring Lea Fishing Tel
Shawn Myers 7-23-01
Tested

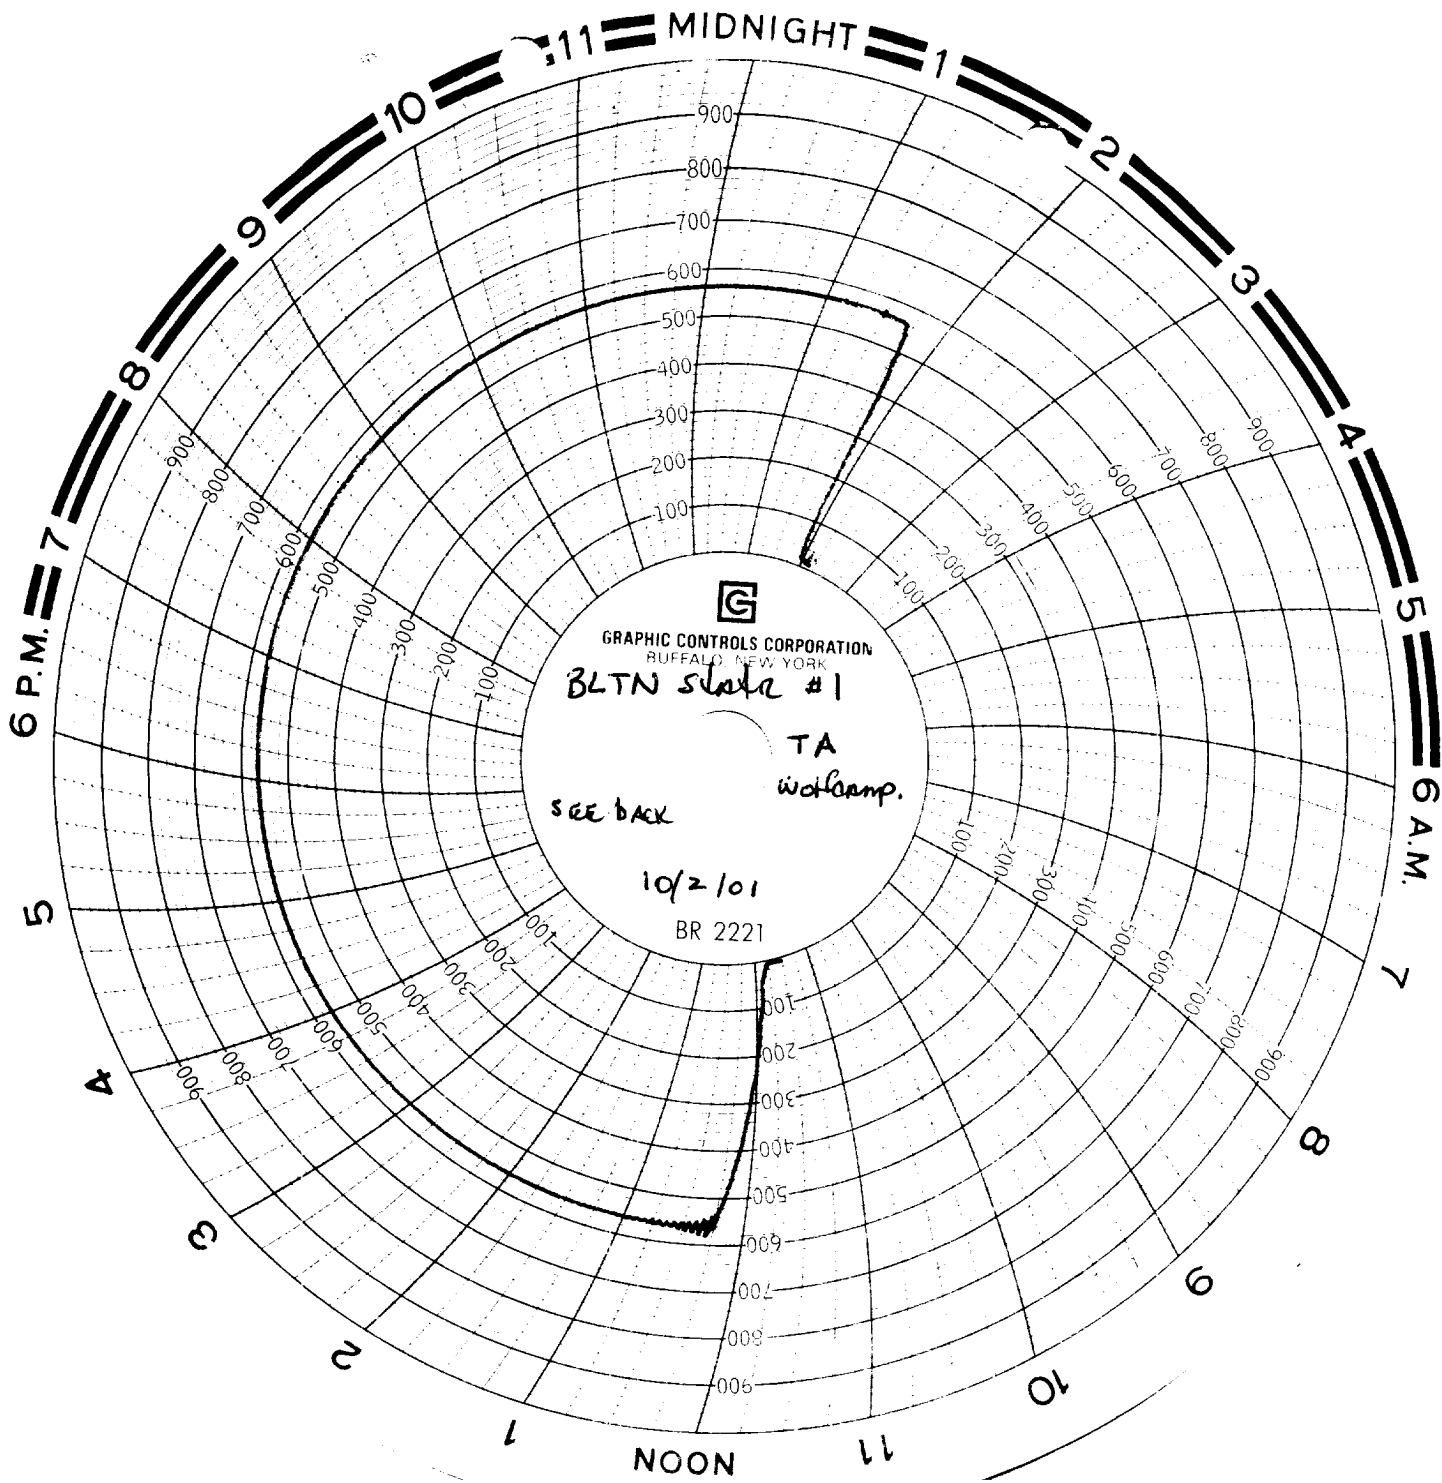

13L TN St. # 1
G1BP @ 10255 w/35' Gant.
American Value & Meter
Tony Flores
Date of Calibration 8-1-01
1000 # Spring
Test Date 10-2-01
Shawn Myers Lea Fishing
10/2/01

