

NEW MEXICO OIL CONSERVATION COMMISSION

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.
B-1582

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO REPERFORATE OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT TO DRILL (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator
Atlantic Richfield Company
3. Address of Operator
P. O. Box 1710, Hobbs, New Mexico 88240
4. Location of Well
UNIT LETTER N 330 FEET FROM THE South LINE AND 2310 FEET FROM THE West LIKE, SECTION 22 TOWNSHIP 18S RANGE 35E NMPM.
5. Elevation (Show whether DF, RT, GR, etc.)
3895' GR

7. Unit Agreement Name
8. Farm or Lease Name
Lea 403 State
9. Well No.
3
10. Field and Pool, or Wildcat
Reeves Queen
12. County
Lea

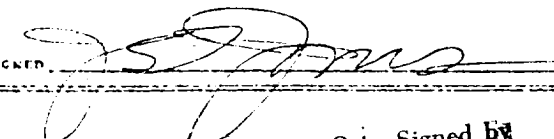
Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	OTHER Perf, Acidize & Frac Treat & Complete ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

On 8/2/77 ran DR plug in Model "N" pkr @ 7165'. Spotted 10' cmt on top of pkr & DR plug @ 7165'. Perf'd 4 squeeze holes @ 4803-05'. RIH w/cmt retr, set retr @ 4700'. Cmt'd thru squeeze holes 4803-05' w/200 bbls 9# brine cont'g 2 gal/1000 Morflow & 10 bbls SAM-5 spacer followed by 300 sx Cl C cmt cont'g 2% CaCl & 6# salt/sk. Rev out 10 sx cmt. Ran GR-N collar logs, CBL. TOC @ 3665' w/good bond across Queen. On 8/8/77 spotted 150 gals 15% HCL acid @ 4442'. Perf'd Queen zone 4400-4411' & 4428-4440' w/2 JSPF. RIH w/pkr on 2-7/8" tbg, set pkr @ 4297'. Acidized Queen perfs 4400-4440' w/150 gals 15% HCL acid. Swbd tbg down in 1 hr, no fluid entry. Acidized w/1000 gals 15% HCL acid & 70 ball sealers. Tbg swbd down in 1 hr. Swbd Queen 11 hrs, rec 14 BFW. Frac'd Queen perfs 4400-4440' w/20,000 gals 2% KCL wtr cont'g 2gals F-75 surfactant/1000 gal & 40# J337 gelling material/1000 gal & 33,000# sd in 2 equal stages. Swbd Queen 4 hrs, rec trace oil & 18 BLW. Rel pkr & POH. RIH w/compl assy w/SN @ 4484' on 2-3/8" OD EUE Tbg. Swbd Queen 4400-4440' 10 hrs, rec 24 BNO & 40 BLW, no gas. On 24 hr test 1/15/78 pmpd Queen perfs 4400-4440', 5 BO, 4 BW & 4 MCFG, GOR 800:1.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED 	TITLE Dist. Drlg. Supt.	DATE
APPROVED BY	TITLE	DATE
Orig. Signed By Jerry Sexton		
CONDITIONS OF APPROVAL, IF ANY: 1. Supp.		