

DISTRICT I

1625 N. French Drive, Hobbs, NM 88240

OIL CONSERVATION DIVISION

310 Old Santa Fe Trail, Room 206
Santa Fe, New Mexico 87503

WELL API NO. 30-025-07335

5. Indicate Type of Lease
FED STATE FEE

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101 FOR SUCH PROPOSALS.)



7. Lease Name or Unit Agreement Name
NORTH HOBBS (G/SA) UNIT

1. Type of Well:
Oil Well Gas Well Other Temporary Abandoned

Section 17


2. Name of Operator OCCIDENTAL PERMIAN, LTD.

8. Well No. 141

3. Address of Operator 1017 W STANOLIND RD.

9. Pool name or Wildcat
HOBBS (G/SA)

4. Well Location
Unit Letter M 660 Feet From The SOUTH Line and 330 Feet From The WEST Line
Section 18-17 Township 18-S 38-E NMPM LEA County



10. Elevation (Show whether DF, RKB, RT GR, etc.)
3650' GL



11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data


NOTICE OF INTENTION TO:				SUBSEQUENT REPORT OF:			
PERFORM REMEDIAL WORK	<input type="checkbox"/>	PLUG AND ABANDON	<input checked="" type="checkbox"/>	REMEDIAL WORK	<input type="checkbox"/>	ALTERING CASING	<input type="checkbox"/>
TEMPORARILY ABANDON	<input type="checkbox"/>	CHANGE PLANS	<input type="checkbox"/>	COMMENCE DRILLING OPNS.	<input type="checkbox"/>	PLUG & ABANDONMENT	<input type="checkbox"/>
PULL OR ALTER CASING	<input type="checkbox"/>			CASING TEST AND CEMENT JOB	<input type="checkbox"/>		
OTHER:	<input type="checkbox"/>			OTHER:	<input type="checkbox"/>		

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Well is TA'd with CIBP @4000' capped w/35' cmt. TOC @3965'.

RUPU. Install BOP.
Move in and rack 2-7/8" workstring. 2000'.
Perforate 7" csg @260'. Bottom of 12.5" surf csg @212'.
Spot cmt from 1600' to 1850'. Top of Anhy @1740'.
Tag cmt plug. @1600'.
Circ cmt behind 7" csg. Pump from surf thru sqz holes @260'.
Leave csg full of cmt from 270' to surf.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

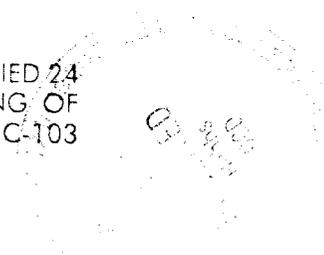

Install dry hole marker 4' above ground level with well information. NHU 17-141, UL "M", Sec. 17, TWN 18-S, RNG 38-E.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _____ TITLE COMPLETIONS SPECIALIST DATE 11/05/01
TYPE OR PRINT NAME ROBERT GILBERT TELEPHONE NO. 505/397-8206

(This space for State Use)

APPROVED BY _____ TITLE NATURAL SCIENCE MANAGER - 2 DATE _____

CONDITIONS OF APPROVAL IF ANY:

5
C

PLUGGING & ABANDONMENT

OPERATOR OH
 LEASE NAME NORTH Hobbs Unit
 SECT 17 TWN 18-5 WELL # 17-141
 FROM 660 N/S/L 330 RING 305
 TD: 4260 E/W/L
 PBTD: 3965' FORMATION @ TD
 FORMATION @ PBTD

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE				
INTMED 1				
INTMED 2				
PROD				

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL @	TOP - BOTTOM
INTMED 1		PERFS
INTMED 2		OPENHOLE
PROD		

***REQUIRED PLUGS DISTRICT I**

RUSTLER (ANHYD)	
YATES	
QUEEN	
GRAYBURG	
SAN ANDRES	
CAPTAN REEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BRUSHY CANYON	
BONE SPRING	
OLORIETA	
BLINEBRY	
TUBB	
DRINKARD	
ABO	
WC	
PENN	
STRAWN	
ATOKA	
MORROW	
MISS	
DEVONIAN	

PLUG	TYPE PLUG	SIZES	DEPTH
EXAMPLES			
PLUG #1	OH	55 SXS	6400'
PLUG #2	SHOE	50 SXS	5350'-5450'
PLUG #3	CIBP/35'		4800'
PLUG #4	CIBP	25 SXS	4800'
PLUG #5	STUB	50 SXS	3600'-3700'
PLUG #6	RETNR SQZ	200 SXS	400'
PLUG #6	SURF	10 SXS	0-10'
PLUG #1			
PLUG #2			
PLUG #3			
PLUG #4			
PLUG #5			
PLUG #6			
PLUG #7			
PLUG #8			
PLUG #9			
PLUG #10			
PLUG #			
PLUG #			

60' SURF Plug
 cmt plug
 Perf 260'
 160' → 260'
 1600'
 1800'

12.5"
 @ 212'
 TOC CIRC SURF
 Cmt CAP @ 3965'
 CIBP @ 4000
 7"
 @ 4056
 TOC 1637

OH
 4056'
 4260

TD 4260