

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

Well API NO. 3002520937
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. 011045
7. Lease Name or Unit Agreement Name New Mexico "L" State
8. Well No. 7
9. Pool name or Wildcat Vacuum Grayburg San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator Texaco E&P Inc.
3. Address of Operator P.O. Box 3109 Midland, Tx 79702	4. Well Location Unit Letter <u>A</u> : <u>760</u> Feet From The <u>North</u> Line and <u>560</u> Feet From The <u>East</u> Line

Section <u>1</u>	Township <u>18S</u>	Range <u>34E</u>	NMPM <u>Lea</u>	County <u>Lea</u>
10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>3991 DF</u>				

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data.	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. 4-4-95 Notify OCD of intent to plug.
2. Set 2-7/8 CIBP at 5900ft.
3. 4-5-95 Tag CIBP at 5900ft. Circ. hole w/10PPC.Salt gel mud. Spot 10sx cmt. at 5900ft. to cap CIBP TOC at 5494'.
4. Spot 10sx at 4500. TOC at 4094'.
5. Spot 20sx cmt. at 3800'. TOC at 3006'. Tagged.
6. 4-6-95 Spot 10sx cmt. at 2900'. TOC at 2494'.
7. 4-6-95 Spot 10sx at 1600'. TOC at 1194'.
8. Cut 2-7/8 tbg. at 790'. Spot 40sx cmt. at 790. WOC 4-7-95 Tag TOC at 656'.
9. 4-7-95 Spot 45sx cmt. at 400'. TOC at 234'.
10. Spot 10sx cmt. at surf. from 30'.
11. Cut off well head & install dryhole marker. Clean location.

Plugging OK'd by J.S. per Donna 5-1-95

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Larry Dickson TITLE PEA Supervisor DATE 4-7-95

TYPE OR PRINT NAME Larry Dickson TELEPHONE NO. 915-563-2805

(This space for State Use)


APPROVED BY Larry W. Hill OIL & GAS INSPECTOR DATE JUN 9 1995

CONDITIONS OF APPROVAL, IF ANY:

Handwritten initials

P&A: 4-07-95

TEXACO E&P INC.
NM "L" State No. 7
API# 30 025 20937

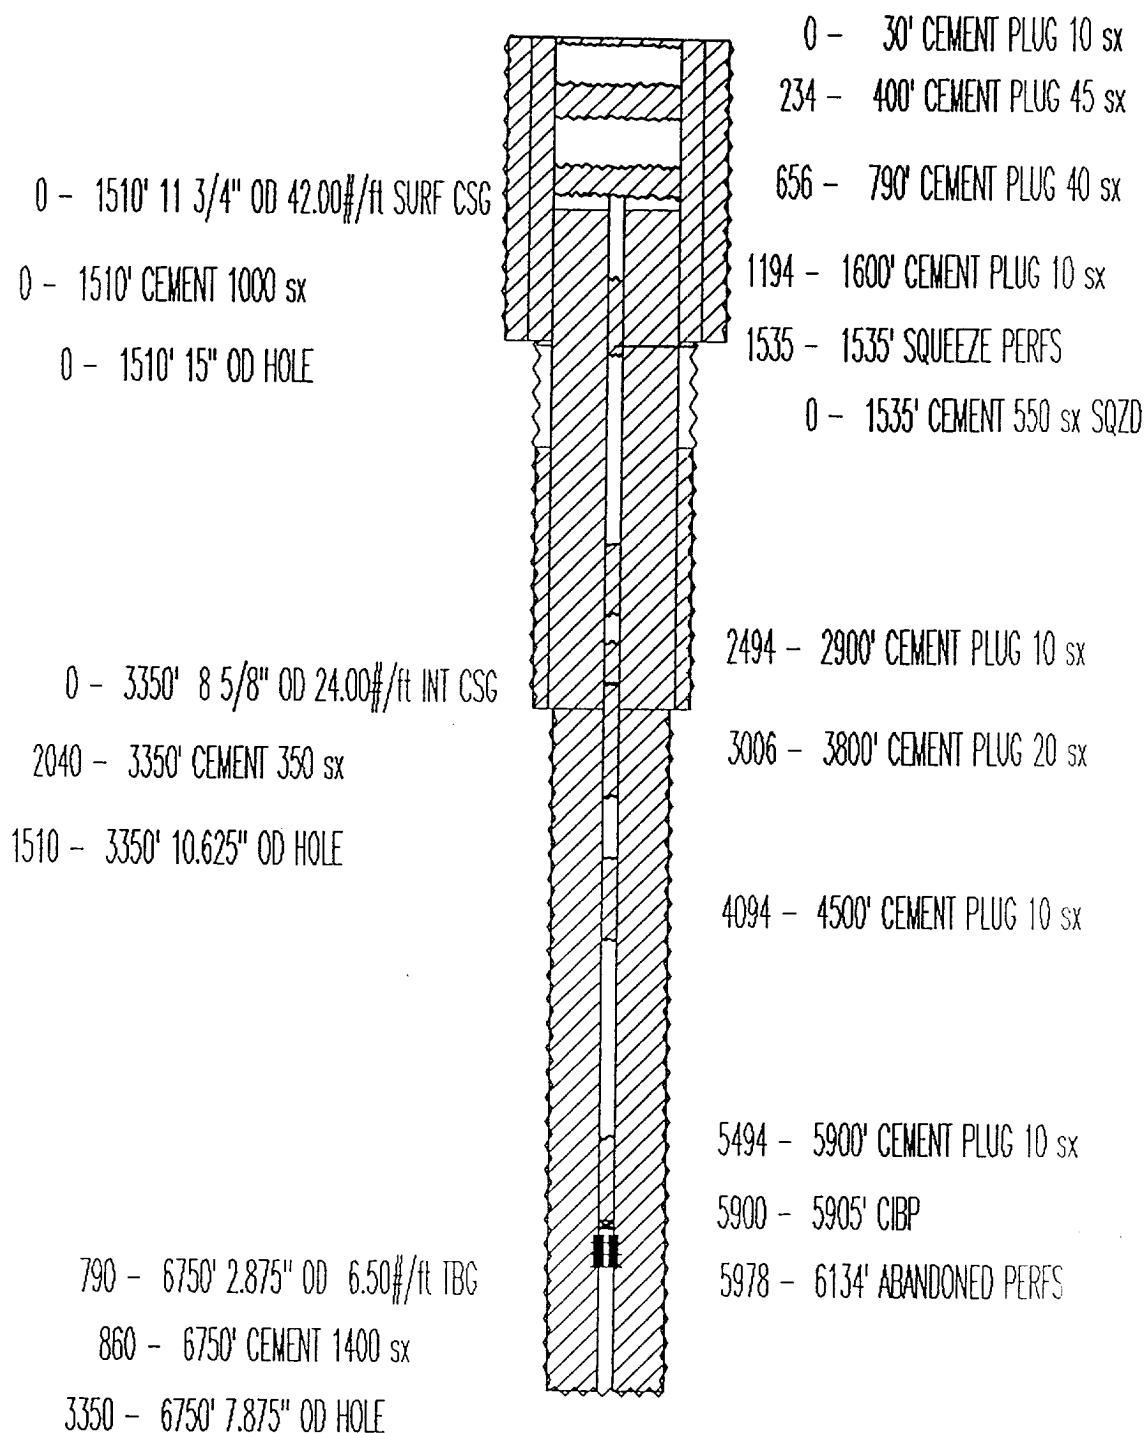

760 FNL & 560 FEL

SEC 1, T14N 18 S, RANGE 34 E

ELEVATION: 3991 DF

COMPLETION DATE: 03-03-64

COMPLETION INTERVAL: 5978 - 6134 (GLOR)