

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

LC-064944

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Federal "M"

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Corbin, Strawn, South &
Corbin, Morrow, South11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREASec. 27, T-18-S, R-33-E,
NMPM

12. COUNTY OR PARISH 13. STATE

Lea

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL ☐ GAS ☒ OTHER SI (Strawn); P&A (Morrow)

2. NAME OF OPERATOR

Southland Royalty Company

3. ADDRESS OF OPERATOR

1100 Wall Towers West, Midland, TX 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

1980' FSL & 990' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether D.P., H.G., etc.)

3805' KB

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) Shut in Strawn(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☒

(Morrow)

☒17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)*

5 1/2" set @ 13,325'; TD 13,406'.

7-15-78 RUPU, loaded hole w/KCL wtr. Laid down 2 1/16" tbg.
7-16-78 WIH w/2 3/8" tbg, hydrostatic bailer, tagged fill @ 13,340'.
7-18-78 Cleaned out to 13,372', could not make any more hole. POH.
7-19-78 Ran wash pipe, bit; could not get below 13,372' due to junk in hole.
7-20-78 WIH w/packer on tbg.
7-21-78 Set pkr @ 13,352', swabbed, slight show.
7-22-78 Acidized open hole 13,325-13,406' (Morrow) w/3000 gal 7 1/2% MS acid,
123,000 SCF nitrogen. Swabbed load water.
7-23-78 Swabbed dry, no show.
7-24-78 Swabbed - no fluid entry, no show.
7-25-78 Swabbed - recovered 12 BLW, no show, POH.
7-26-78 Ran GR Correlation log, checked bottom casing @ 13,325'.
7-27-78 Set CIBP @ 13,100'. Spotted 35' cement 13,065-13,100'. RDPU.
Morrow - plugged and abandoned.

Well shut-in in Strawn perms 12,306-16'.

18. I hereby certify that the foregoing is true and correct

SIGNED

E. Harvey Can

TITLE

District Engineer

DATE

7-26-78


(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

*See Instructions on Reverse Side

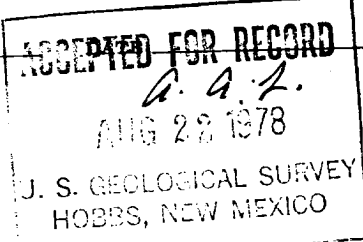

RECEIVED

JUL 28 1978

CLC

LIBRARY H. H. ...