

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

**SUBMIT IN TRIPLICATE**

1. Type of Well <input checked="" type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other	5. Lease Designation and Serial No. NM-6863
2. Name of Operator Mewbourne Oil Company	6. If Indian, Allottee or Tribe Name
3. Address and Telephone No. P.O. Box 5270 Hobbs, New Mexico 88241	7. If Unit or CA, Agreement Designation
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Unit Letter N: 990' FSL & 1650' FWL Sec. 27-T18S-R32E	8. Well Name and No. Anadarko Federal #6
	9. API Well No. 30-025-25260
	10. Field and Pool, or Exploratory Area
	11. County or Parish, State Lea Co., N.M.

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
<input checked="" type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input type="checkbox"/> Other
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Dispose Water

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

NOTIFY BLM AT 393-3612 PRIOR TO COMMENCING PLUGGING OPERATION.

Set CIBP at 3850'<sup>±</sup>. Set 3 sx. cement plug on top of CIBP. Displace hole with mud. Cut off and pull out of hole with 2300' of casing. Set 30 sx. plug 50' below <sup>AND ABOVE</sup> cut off. Wait on cement and tag top of plug. Set 45 sx. plug at 405'. Set 20 sx. plug at 50' and circulate cement to surface.

Cut off wellhead and install P & A marker. Mud between all plugs.

\* SET 100' CEMENT PLUG AT TOP OF SALT (1305'-1205'). TAG. CEMENT: USE CLASS 'C' WITH 2% CaCl<sub>2</sub>; Mix w/6.3 GALS WTR./SACK. MUD: USE MUD OF AT LEAST 9.0 PPg.

14. I hereby certify that the foregoing is true and correct

Signed W. H. Craney Title District Supt. Date 06/06/91

(This space for Federal or State office use)

Approved by \_\_\_\_\_ Title \_\_\_\_\_ Date 6-10-91

Conditions of approval, if any:

RECEIVED


JUN 11 1964

U.S. DEPT. OF JUSTICE  
FEDERAL BUREAU OF INVESTIGATION

Anadarko Fed #0 (Formerly: ELKAM Fed #1)  
990 FSL 11650 FNL 27-18-32  
LEA Co., N.M.

ELEV: 3722

KB:

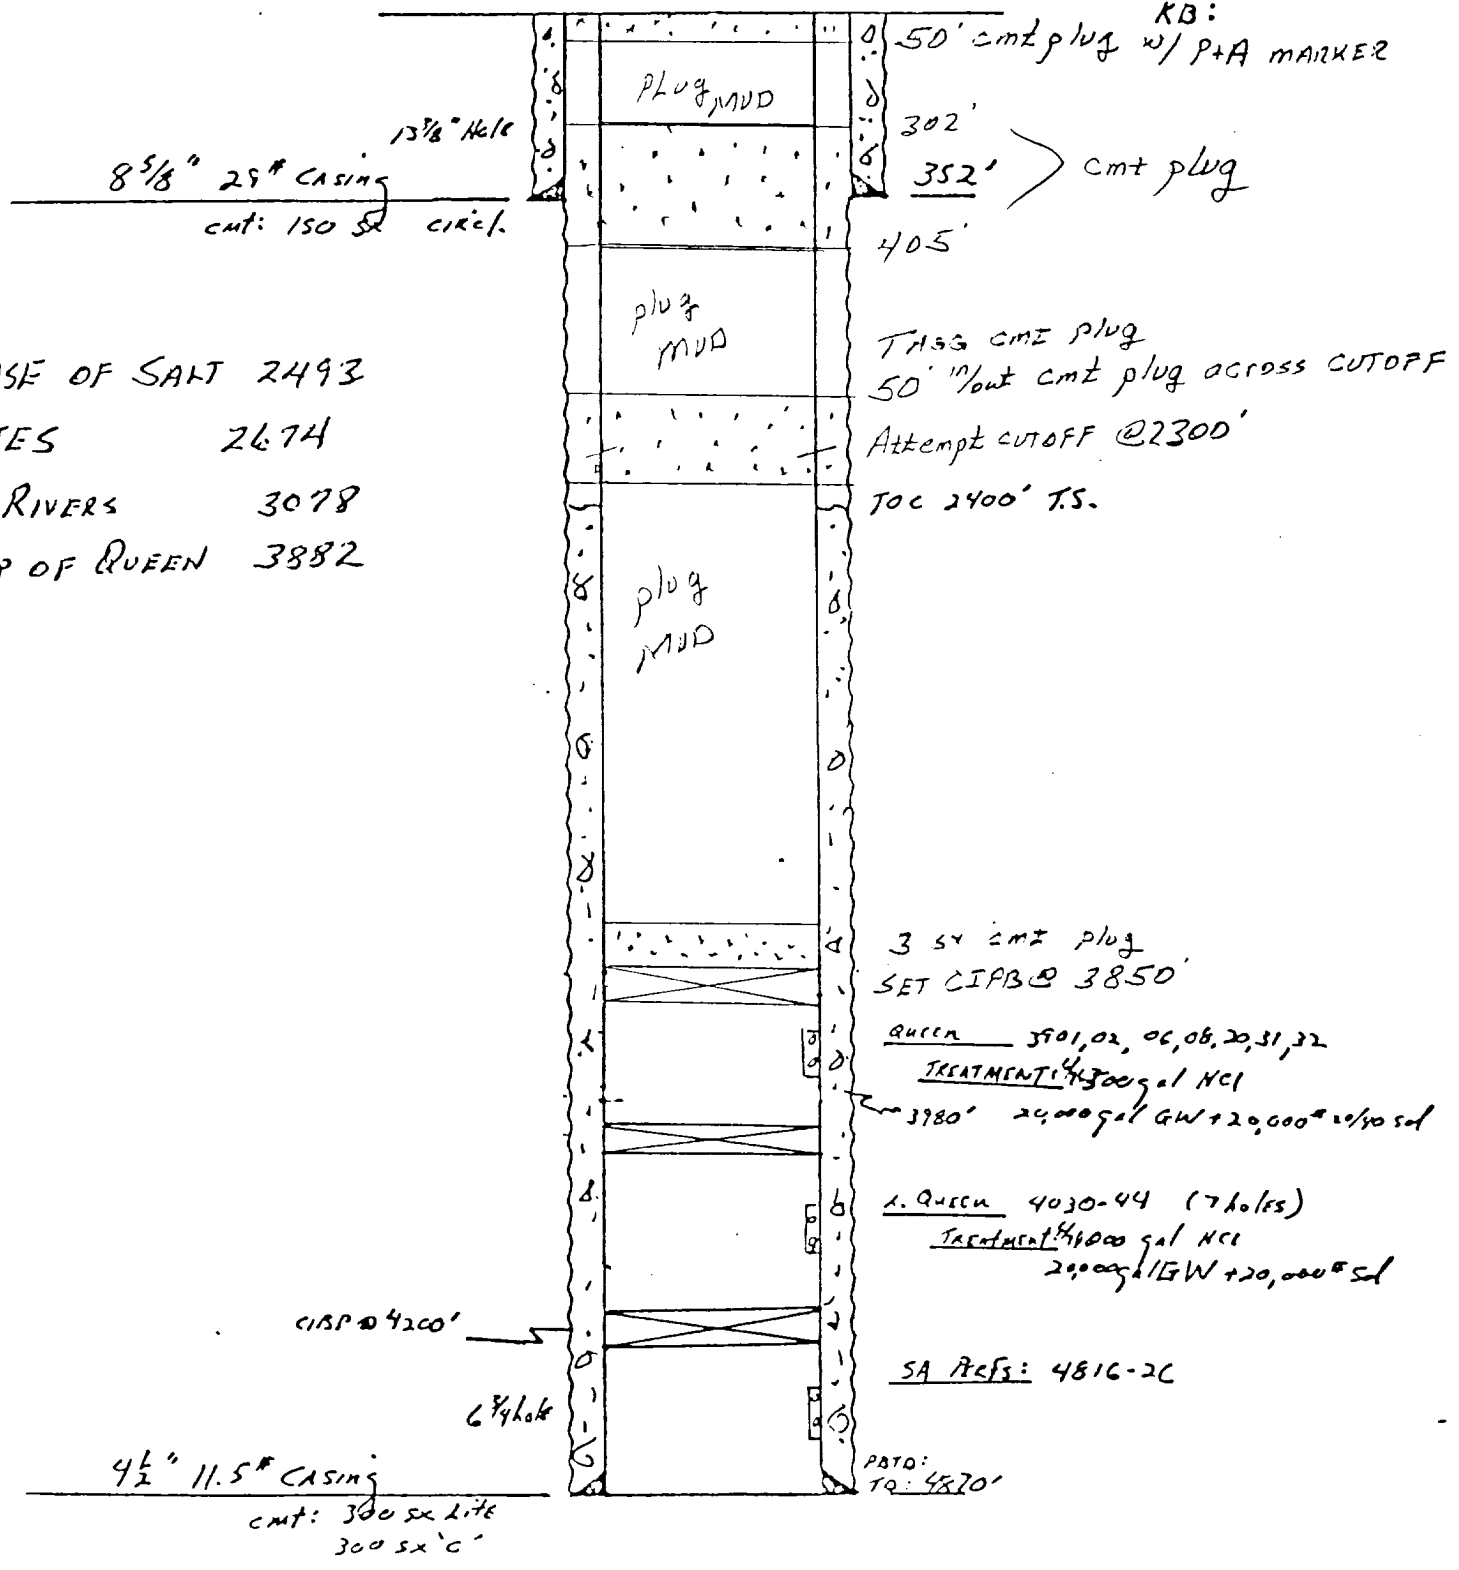

BASE OF SALT 2493  
 YATES 2674  
 7-RIVERS 3078  
 TOP OF QUEEN 3882

SA Refs: 4816-2C

Pumping Unit - Make:  
 Size: