

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other Instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT--" for such proposals.)		5. LEASE DESIGNATION AND SERIAL NO. NMNM84603X	
1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER WATER INJECTION		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
2. NAME OF OPERATOR OXY USA INC.		7. UNIT AGREEMENT NAME CENT. CORBIN QUEEN UT.	
3. ADDRESS OF OPERATOR P.O. BOX 50250 MIDLAND, TX 79710		8. FARM OR LEASE NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface I 1980 FSL 660 FEL Sec 4 T18S R33E		9. WELL NO. 204	
10. FIELD AND POOL, OR WILDCAT CORBIN QUEEN, CENTRAL		11. SEC. T., R., M., OR BLK. AND SURVEY OR AREA Sec 4 T18S R33E	
14. PERMIT NO. 300252973800S01	15. ELEVATIONS (Show whether DF, RT, GR, etc.)	12. COUNTY OR PARISH LEA	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notices, Report, or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)

☐
☐
☐
☐
☐

PULL OR ALTER CASING
MULTIPLE COMPLETE
ABANDON*
CHANGE PLANS

☐
☐
☐
☐
☐

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other)

☐
☐
☒

REPAIRING WELL
ALTERING CASING
ABANDONMENT*

☐
☐
☒

CONVERT TO WATER INJECTION

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

R9337

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and five pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

TD - 4350' PBTD - 4314' PERFS - 4200'-4217'

MIRU PU, POOH W/ RODS, PUMP & TBG, NDWH, NUBOP. CO TO 4248', RIH W/ RTTS & SET @ 4095', TEST CSG TO 500#, HELD OK. ACIDIZE QUEEN PERFS (4200-4217') W/ 2000 GAL 15% NEFE HCL ACID, SWAB BACK LOAD. POOH, RIH W/ GUIBERSON C-6 PKR & 2-3/8 CL TBG & SET @ 4091'. NDBOP, NUWH, CIRC W/ PKR FLUID, TEST CSG TO 300#, HELD OK, RDP. WELL READY FOR INJECTION.

AS

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

PRODUCTION ACCOUNTANT

DATE

11/11/91

(This space for Federal or State office use)


APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

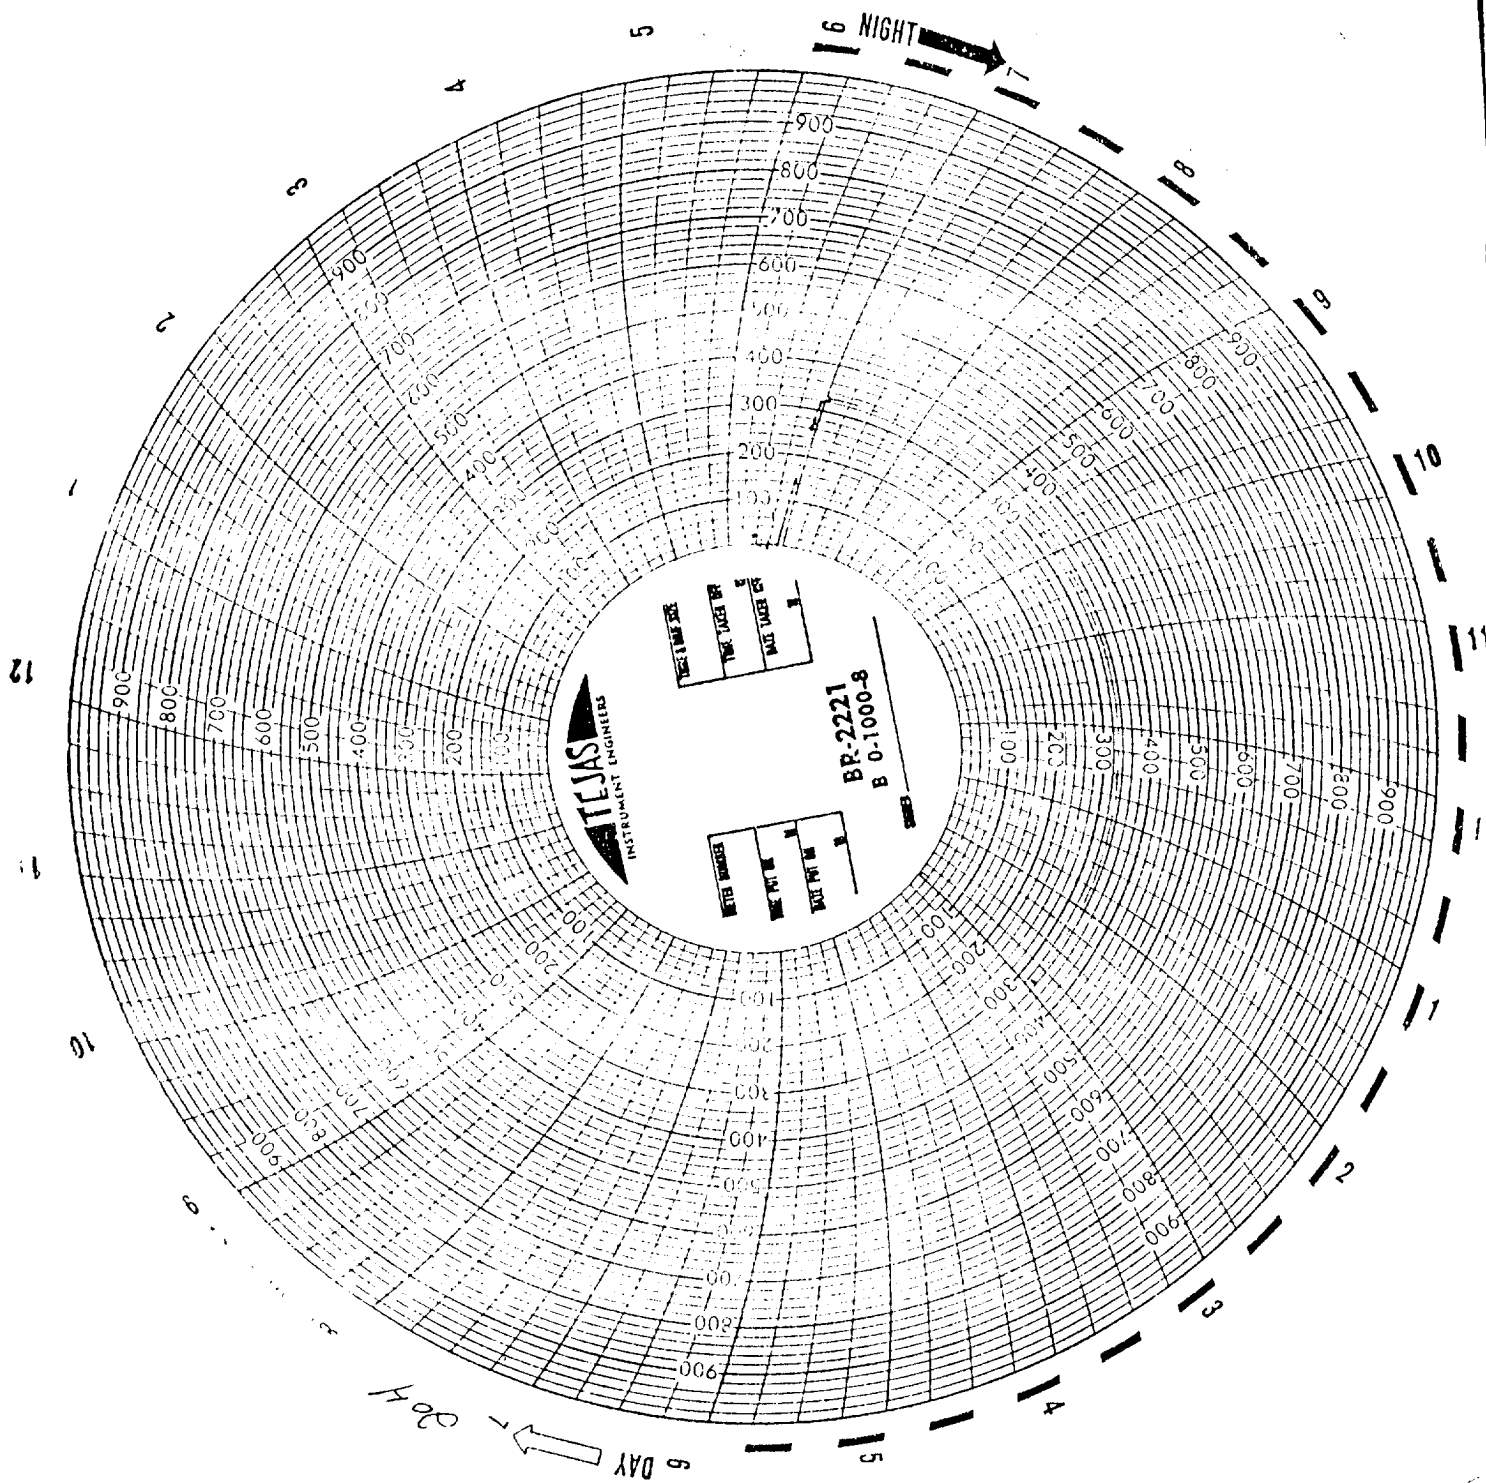

CXY USA INC

CCQU 204

10 14-91