

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-025-30096

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
B-2148

7. Lease Name or Unit Agreement Name

Leamex

8. Well No.
43

9. Pool name or Wildcat

Maljamar GBLSA

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator
Phillips Petroleum Company

3. Address of Operator
4001 Penbrook Street, Odessa, TX 79762

4. Well Location
Unit Letter P : 660 Feet From The South Line and 660 Feet From The East Line
Section 25 Township 17S Range 33E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4099' GR; 4108' RKB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

REMEDIAL WORK ☐

ALTERING CASING ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

PULL OR ALTER CASING ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

OTHER: Temporary Abandon ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 08-05-94 - POOH with sucker rod pump and sucker rods. Install Class 1 BOP. POOH with 2-3/8" production tubing. Pick up 5-1/2" casing scraper on 2-3/8" tubing and WIH to depth of 4225'. POOH with casing scraper. WIH with 5-1/2" CIBP on 2-3/8" tubing to 4200' and set CIBP.
- 08-06-94 - Circulate well with fresh water containing 1% corrosion inhibitor. Test 5-1/2" casing and CIBP to 500 psi for 30 minutes. Buddy Hill with NMOC from Hobbs office witnessed test. Test O.K. POOH w/2-3/8" tubing LD tubing. Remove BOP and install wellhead. Clean location. Close well in. Well T/A'd.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE 

TITLE Supv. Regulatory Affairs

DATE 08-09-94

TYPE OR PRINT NAME L. M. Sanders

(915)
TELEPHONE NO. 368-1488

(This space for State Use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:


This Approval of Temporary
Abandonment Expires

TITLE

DATE

ORIGINAL FILED IN ENERGY SECTION
SUPERVISOR

AUG 11 1994

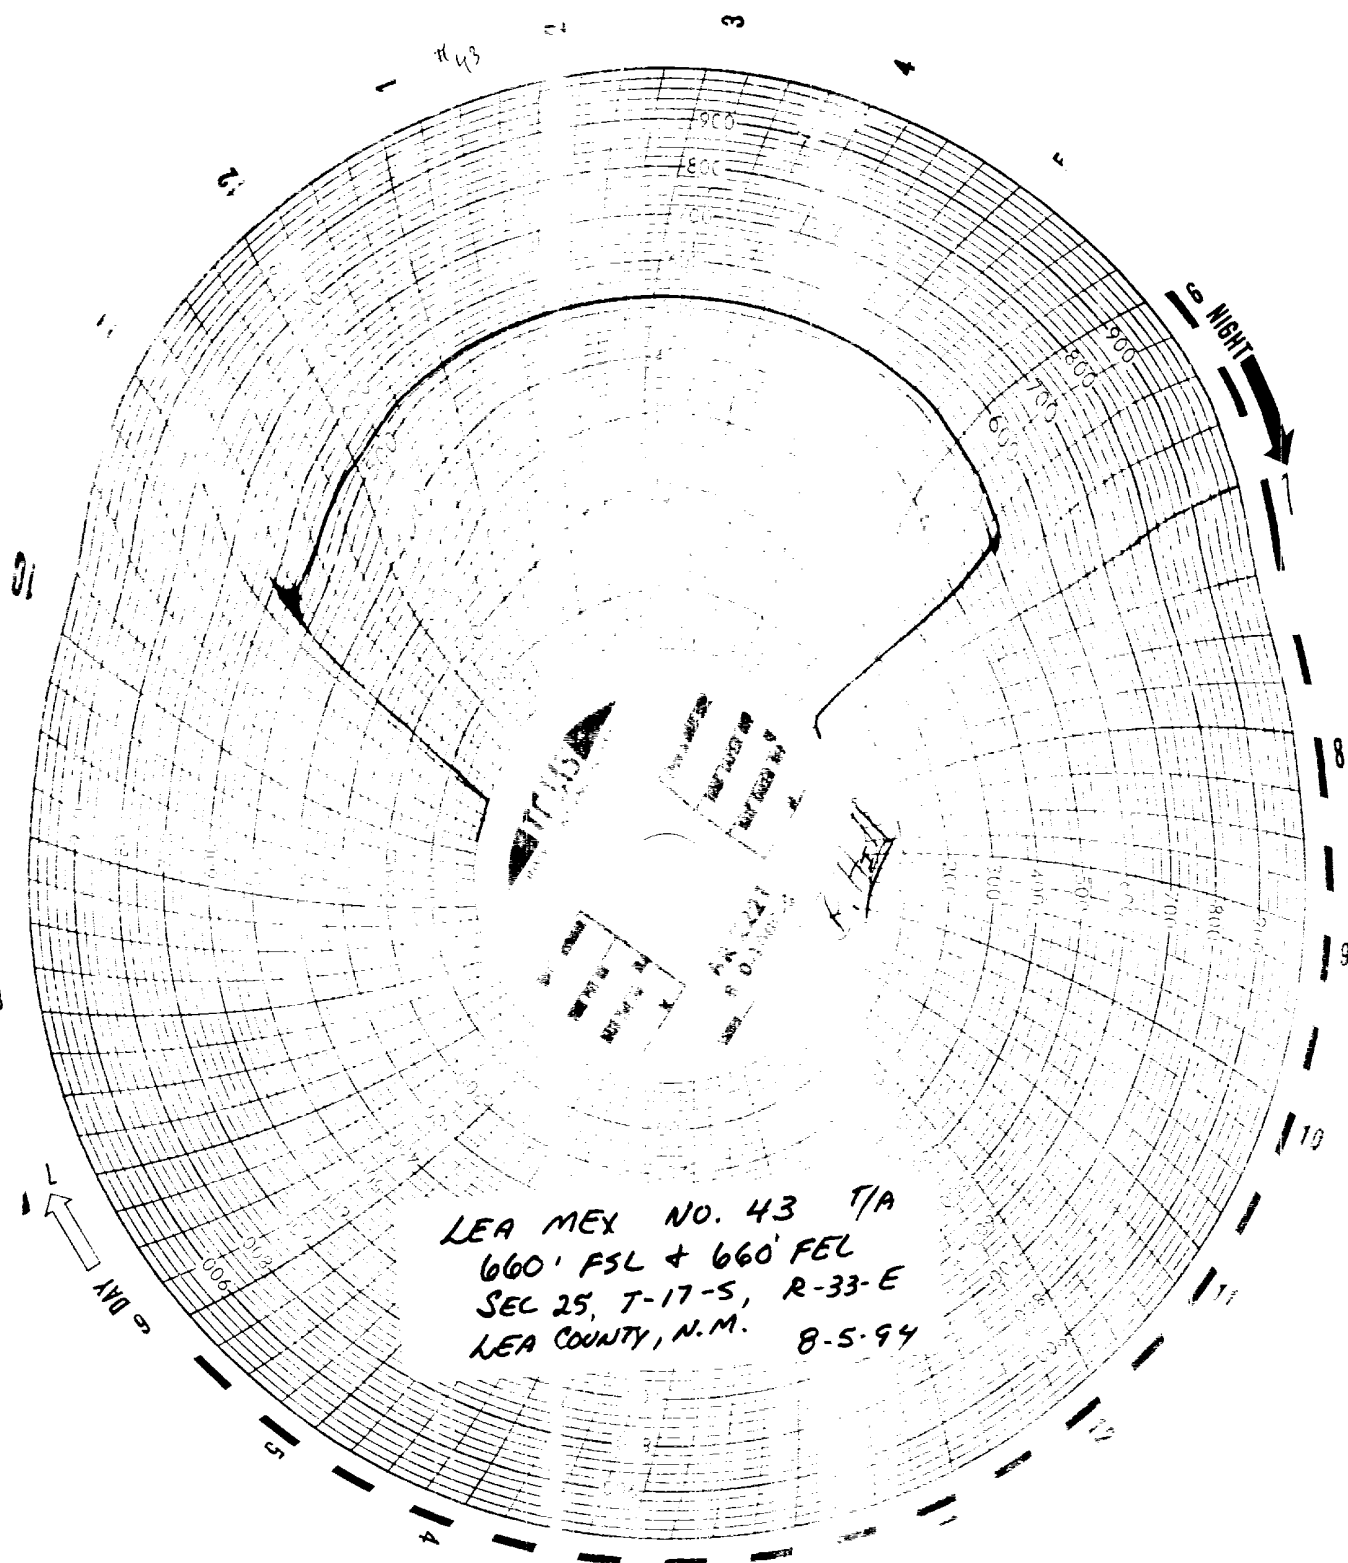

LEA MEX NO. 43 T/A
 660' FSL + 660' FEL
 SEC 25, T-17-S, R-33-E
 LEA COUNTY, N.M. 8-5-94