

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO. 3002530847	
5. Indicate Type of Lease STATE ☒ FEE	
6. State Oil / Gas Lease No. 857948	
7. Lease Name or Unit Agreement Name VACUUM GRAYBURG SAN ANDRES UT	
8. Well No. 149	
9. Pool Name or Wildcat VACUUM GRAYBURG SAN ANDRES	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER ☐ WATER INJECTION ☐
2. Name of Operator TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator 205 E. Bender, HOBBS, NM 88240
4. Well Location Unit Letter C : Feet From The Line and Feet From The Line Section 1 Township 18S Range 34E NMPM LEA COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPERATION ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: CLEAN OUT, PERF, ACIDIZE ☒	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11-13-00: MIRU. NDWH. NUBOP. REL PKR.
11-14-00: TIH W/BIT, PU WS. TAG FILL @ 4065'. RU REV UNIT. C/O TO 4420'. CIRC CLN.
11-15-00: LOWER BIT TO 4420'. C/O 390' TO PBD @ 4810'.
11-16-00: TIH W/PERF GUN. PERF 4268-71, 4344-56, 4496-4500, 4522-32, 4539-46, 4563-66, 4573-78, 4625-28, 4634-41, 4674-79, 4698-4710, TIH W/TP, PKR & TBG TO 1901'.
11-17-00: SET TP @ 4705'. SPOT 1000 GALS 15% DAD ACID ACR PERFS 4132-4710. PULL TP TO 4611'. SET PKR @ 3988'. PSI CSG TO 500. DISPL W/12 BBLs ACID. RU SWAB. REL PKR. TIH W/PKR, SN & TBG. SET PKR @ 1900'. REL PKR. SET PKR @ 3988'.
11-20-00: PRESS CSG TO 500 PSI. ACIDIZE PERFS 4132-4710 W/10,000 GALS 20% NEFE & 5000 LBS RK SLT. FL @ 100'. END FL @ 700'.
11-21-00: FL @ 200'. END FL @ 900'. REL PKR. TIH W/PKR/RBP. SET RBP @ 3983'. PULL PKR TO 3952'. TEST PKR TO 1000 PSI-OK. TEST CSG TO 700 PSI-OK. FISH RBP. TIH W/BIT & TBG TO 1488'.
11-22-00: TIH W/TBG. TAG FILL @ 4675'. C/O 235' TO 4810'. LDWS.
11-27-00: MIRU TBG TESTER. TEST IN HOLE TO 5000 PSI: 7" PLASTIC COATED LOC SET PKR, PU TBG. CIRC W/PKR FLUID. PSA 13' KB @ 4043'. NDBOP. NUWH. TEST CSG & PKR TO 560 PSI. CHART FOR 30 MINS-OK. RIG DOWN.
12-10-00: ON 24 HR OPT. INJ'G 2041 BWPD @ 1402 PSI.
FINAL REPORT


I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 1/9/01
TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use)

APPROVED _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: _____

JCS

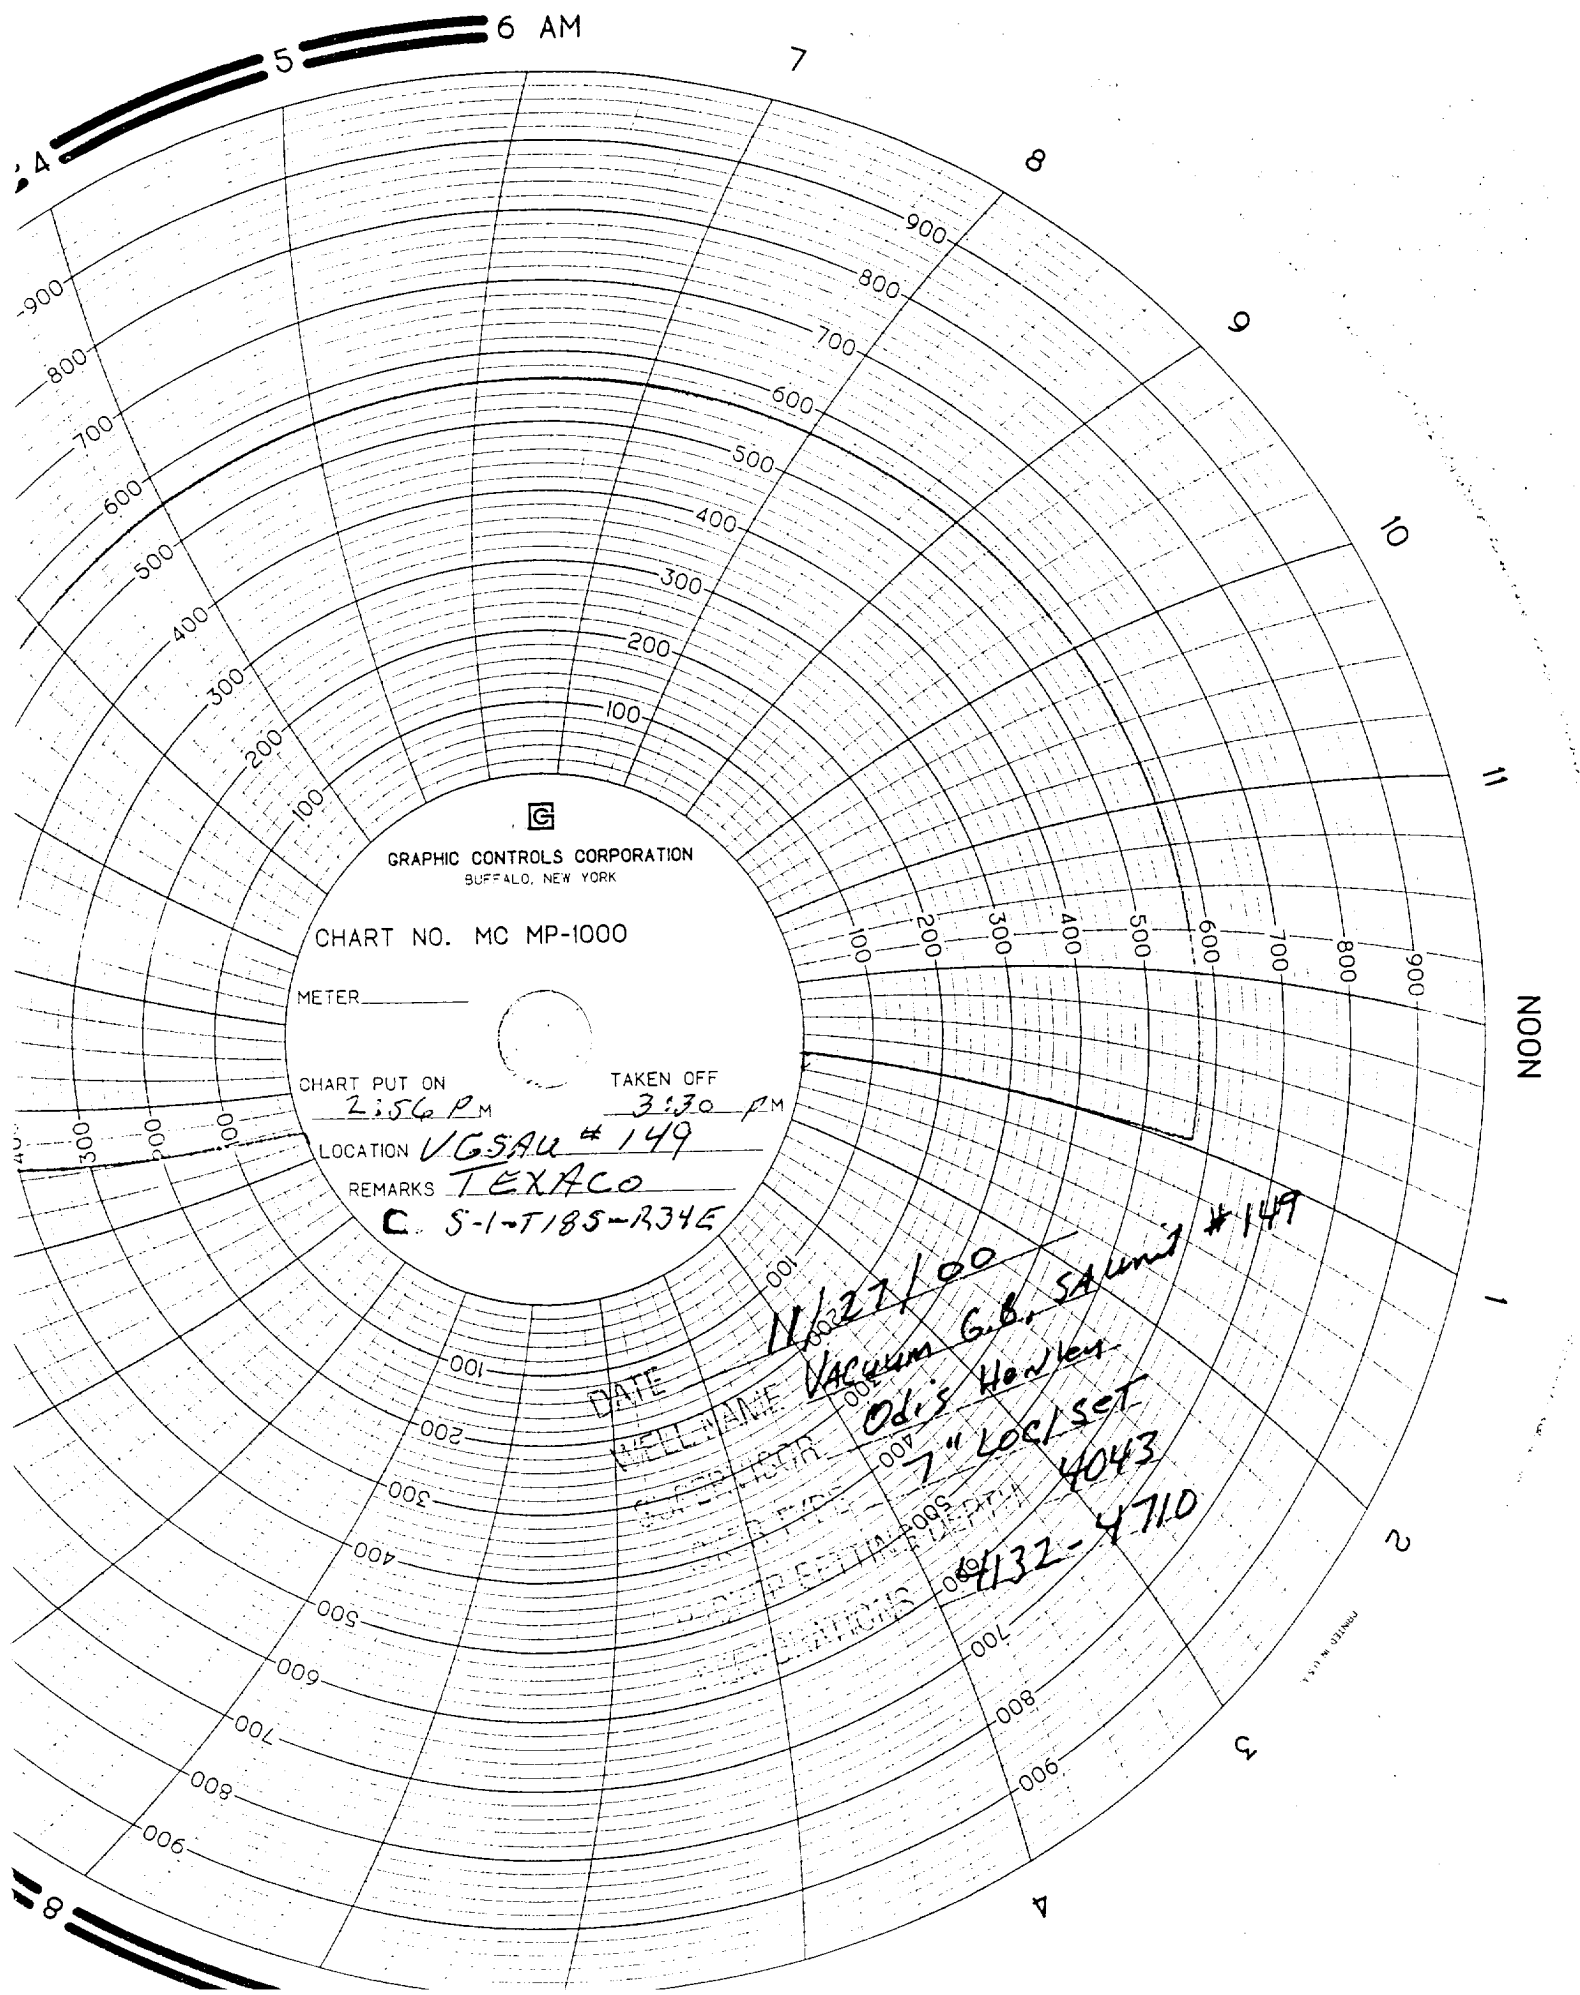

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK

CHART NO. MC MP-1000

METER _____

CHART PUT ON
2:56 P.M.

TAKEN OFF
3:30 P.M.

LOCATION UGSAU #149

REMARKS TEXACO

C. S-1-T185-R34E

DATE

WELL NAME

SUPERVISOR

WELL TYPE

WELL DEPTH

WELL STATUS

WELL LOCATION

WELL DIRECTION

WELL DIAMETER

WELL AREA

WELL VOLUME

WELL WEIGHT

WELL PRESSURE

WELL TEMPERATURE

WELL HUMIDITY

WELL RAINFALL

11/27/00
Vacuum G.B. SA Unit #149
Odis Hawley
7" LOC/SET
4043
4132-4710

PRINTED IN U.S.A.