

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-33301
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	B-1733
7. Lease Name or Unit Agreement Name	NEW MEXICO L STATE
8. Well No.	18
9. Pool Name or Wildcat	VACUUM WOLFCAMP

SUNDRY NOTICES AND REPORTS ON WELL (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	205 E. Bender, HOBBS, NM 88240
4. Well Location	Unit Letter <u>A</u> : <u>810</u> Feet From The <u>NORTH</u> Line and <u>650</u> Feet From The <u>EAST</u> Line Section <u>1</u> Township <u>18S</u> Range <u>34E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3982' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☒
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPERATION ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: SET CIBP, LOWER WC, PERF UPPER WC ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.


10/25/99: MIRU. UNSEAT PUMP. CLN PARAFFIN FR TBG TO 3000'. NDWH. NUBOP. REL TAC. TIH W/BIT, CSG SCRAPER, TBG TO 1272'.
 10/26/99: TIH W/BIT & SCRAPER TO 9675'. RUN GR/CCL FR 9650-8600'. TIH W/CIBP & SET @ 9440'. PERF CSG IN WOLFCAMP FORMATION 9304-14, 9318-28, 9336-50. TIH W/BAILER. CAP CIBP @ 9440' W/15' CMT. NEW PBTD @ 9425'.
 10/27/99: TIH W/PKR, SN & TBG TEST TO 5000 PSI TO 9373'. CIRC 2% KCL. SET PKR @ 9373'. TET CIBP @ 9440' TO 1000 PSI-OK. PULL PKR TO 9238'.
 10/28/99: TIH W/PKR TO 9350'. SPOT 100 GALS ACID FR 9304-9350'. RAISE & SET PKR @ 9186'. PSI CSG-OK. ACIDIZE WOLCAMP PERFS 9304-9350' W/3000 GALS 15% NEFE HCL AICD. RU SWAB. FL @ 2700'. END FL @ 3200'.
 10/29/99: FL @ 3200'. END FL @ 3400'.
 10/30/99: FL @ 3200'. END FL @ 3400'. RIG DOWN SWAB.
 11/04/99: REL PKR. TIH W/CIBP, TBG. SET CIBP @ 9254'. TOP PERF @ 9304'. TEST CIBP TO 500 PSI-OK. CIRC TRTD WTR. TET CSG & CIBP AGAIN TO 500 PSI-30 MIN-CHART FOR NMOC-OK.
 11/05/99: MADE 2 CMT DUMP RUNS ON WL. CAP CIBP @ 9254' W/35' CMT. NEW PBTD @ 9214'. TIH W/BULL PLUG IN PERF SUB, & TBG. STOP TBG @ 9116'. NDBOP. NUWH. TIH W/RDS.
 11/06/99: RIG DOWN.
 CLASSIFY WELL AS SHUT IN OIL.


I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 11/22/1999

TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405

(This space for State Use) ORIGINALLY BY CHRIS WILLIAMS
 APPROVED BY DISTRICT SUPERVISOR TITLE _____ DATE _____
 CONDITIONS OF APPROVAL, IF ANY:

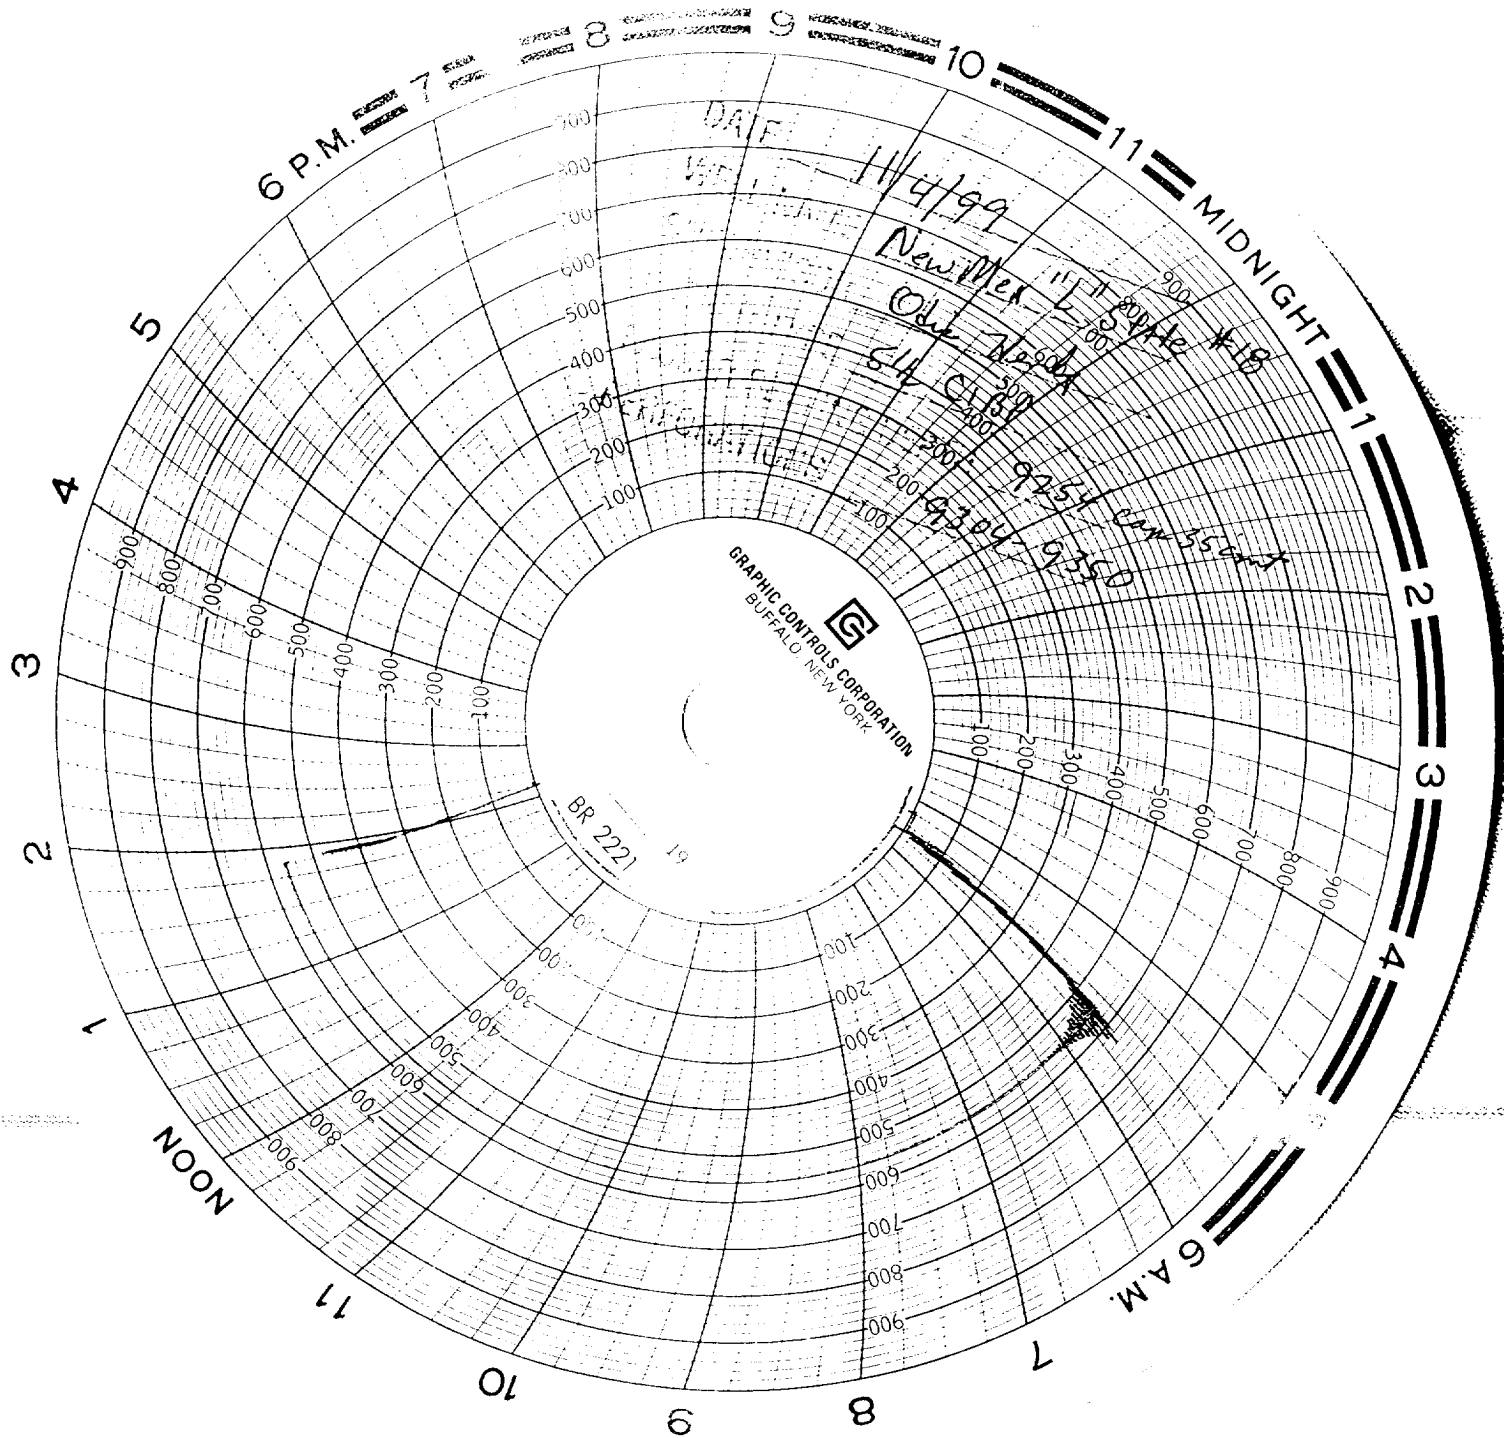

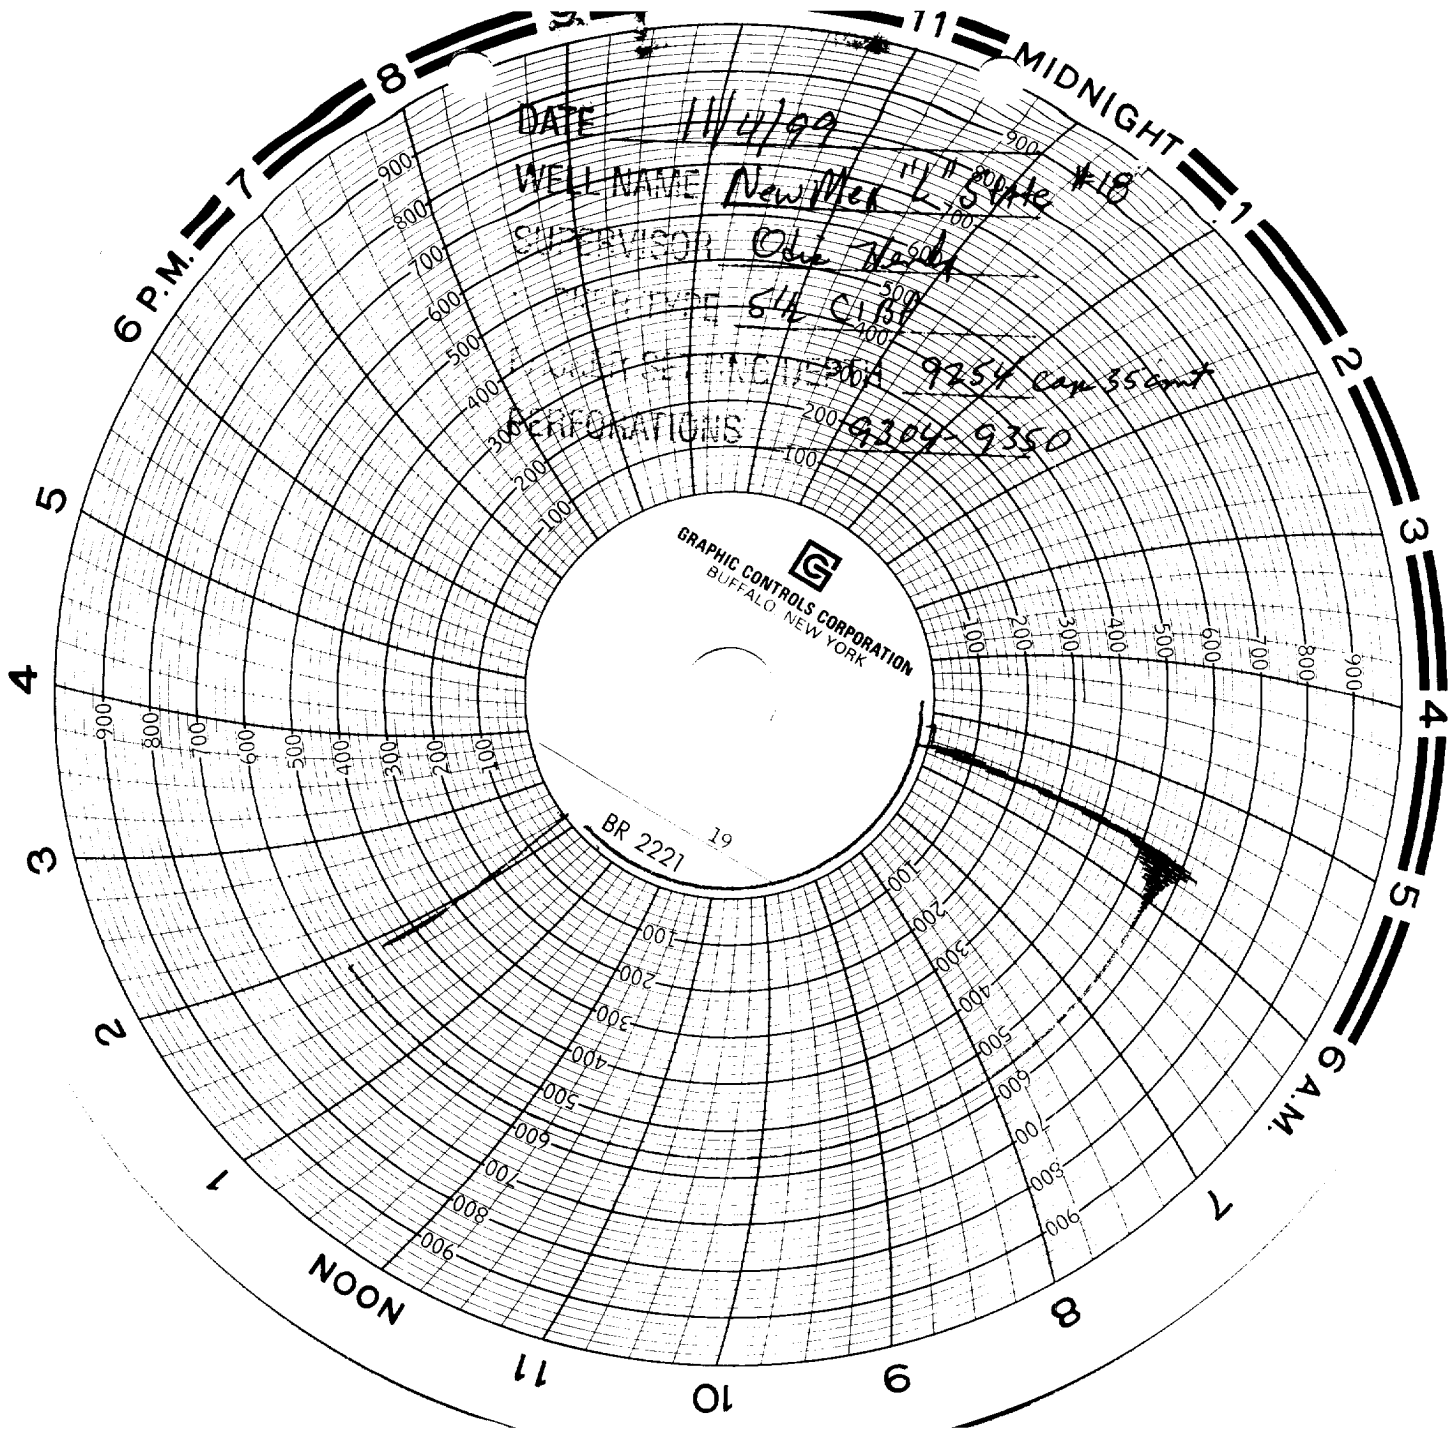

192 # 261
Jany (out)
Key Energy

8/7 75 7 MV

11 4 99

TEXACO