

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-33588
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	B-1030
7. Lease Name or Unit Agreement Name	WEST VACUUM UNIT
8. Well No.	58
9. Pool Name or Wildcat	VACUUM GRAYBURG SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER Water injection

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator
205 E. Bender, HOBBS, NM 88240

4. Well Location
Unit Letter B : 1330 Feet From The NORTH Line and 1330 Feet From The EAST Line
Section 3 Township 18-S Range 34-E NMPM LEA COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4027' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐ Convert to WIW ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

7-01-99: MIRU. UNSEAT PUMP. NDWH. NUBOP. REL TAC. TIH W/BIT, CSG SCRAPER. TAG @ 4768'. (PBTD 4770').
7-02-99: CHANGE RAMS IN BOP. UNLOAD, RACK, TALLY 145 JTS 2 3/8" TBG. TIH W/PKR & TBG. PKR SWING @ 4522'. NDBOP. NUWH.
7-06-99: PUMP 130 BBLS PKR FLUID. SET PKR @ 4522'. (PERFS @ 4620-4718) ATTEMPT TO CHART. PKR FLUID FOAMED UP. NO TEST.
7-07-99: RESET PKR @ 4493'. NDWH. NUBOP. REL PKR. TIH W/PKR, 2 3/8" TBG. CIRC PKR FLUID. SET PKR @ 4492'. (PERFS 4562-4718).
NDBOP. NUWH. PKR FLUID FOAMED. LEFT OPEN TO REV PIT.
7-08-99: ATTEMPT TO TEST. NO TEST. NDWH. NUBOP. REL PKR. CHANGE RAMS IN BOP. UNLOAD, RACK, TALLY WS. TIH W/BIT. PU WS TO 3704'.
7-09-99: TAG @ 4103'. WRKD THRU TITE SPOT & TAG SOLID 4726'. SPUD TO 4768'. PULL UP TO 4100'. PU SWIVEL & ROTATE 4100-4543'. TIH W/RBP & PKR ON WS. SET RBP @ 4530'. TEST TO 1000#-OK. REL PKR & TEST & CHART 4530-SURF TO 550# FOR 30 MIN-OK. REL RBP.
7-12-99: LEFT RBP IN HLE. TIH W/RET TOOL. PU WS TO 1160'. FISH RBP. C/O RAMS IN BOP. UNLOAD & RACK-TALLY TBG.
7-13-99: TIH W/PKR, & TBG. SET @ 14' KB. PKR SET @ 4493'. (PERFS 4562-4718). NDBOP. NUWH. CIRC PKR FLUID. TEST & CHART CSG FOR 30 MINS TO 540 PSI-OK. RIG DOWN.
7-20-99: ON 24 HR OPT. INJ'G 135 BWPD @ VAC. TAC 4483'
FINAL REPORT

Order # WFX-735

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 7/26/99

TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405


ORIGINAL SIGNED BY GARY WINK

APPROVED BY GARY WINK TITLE Engineering Assistant DATE 8-19-99

CONDITIONS OF APPROVAL, IF ANY:

705X

J. Denise Leake

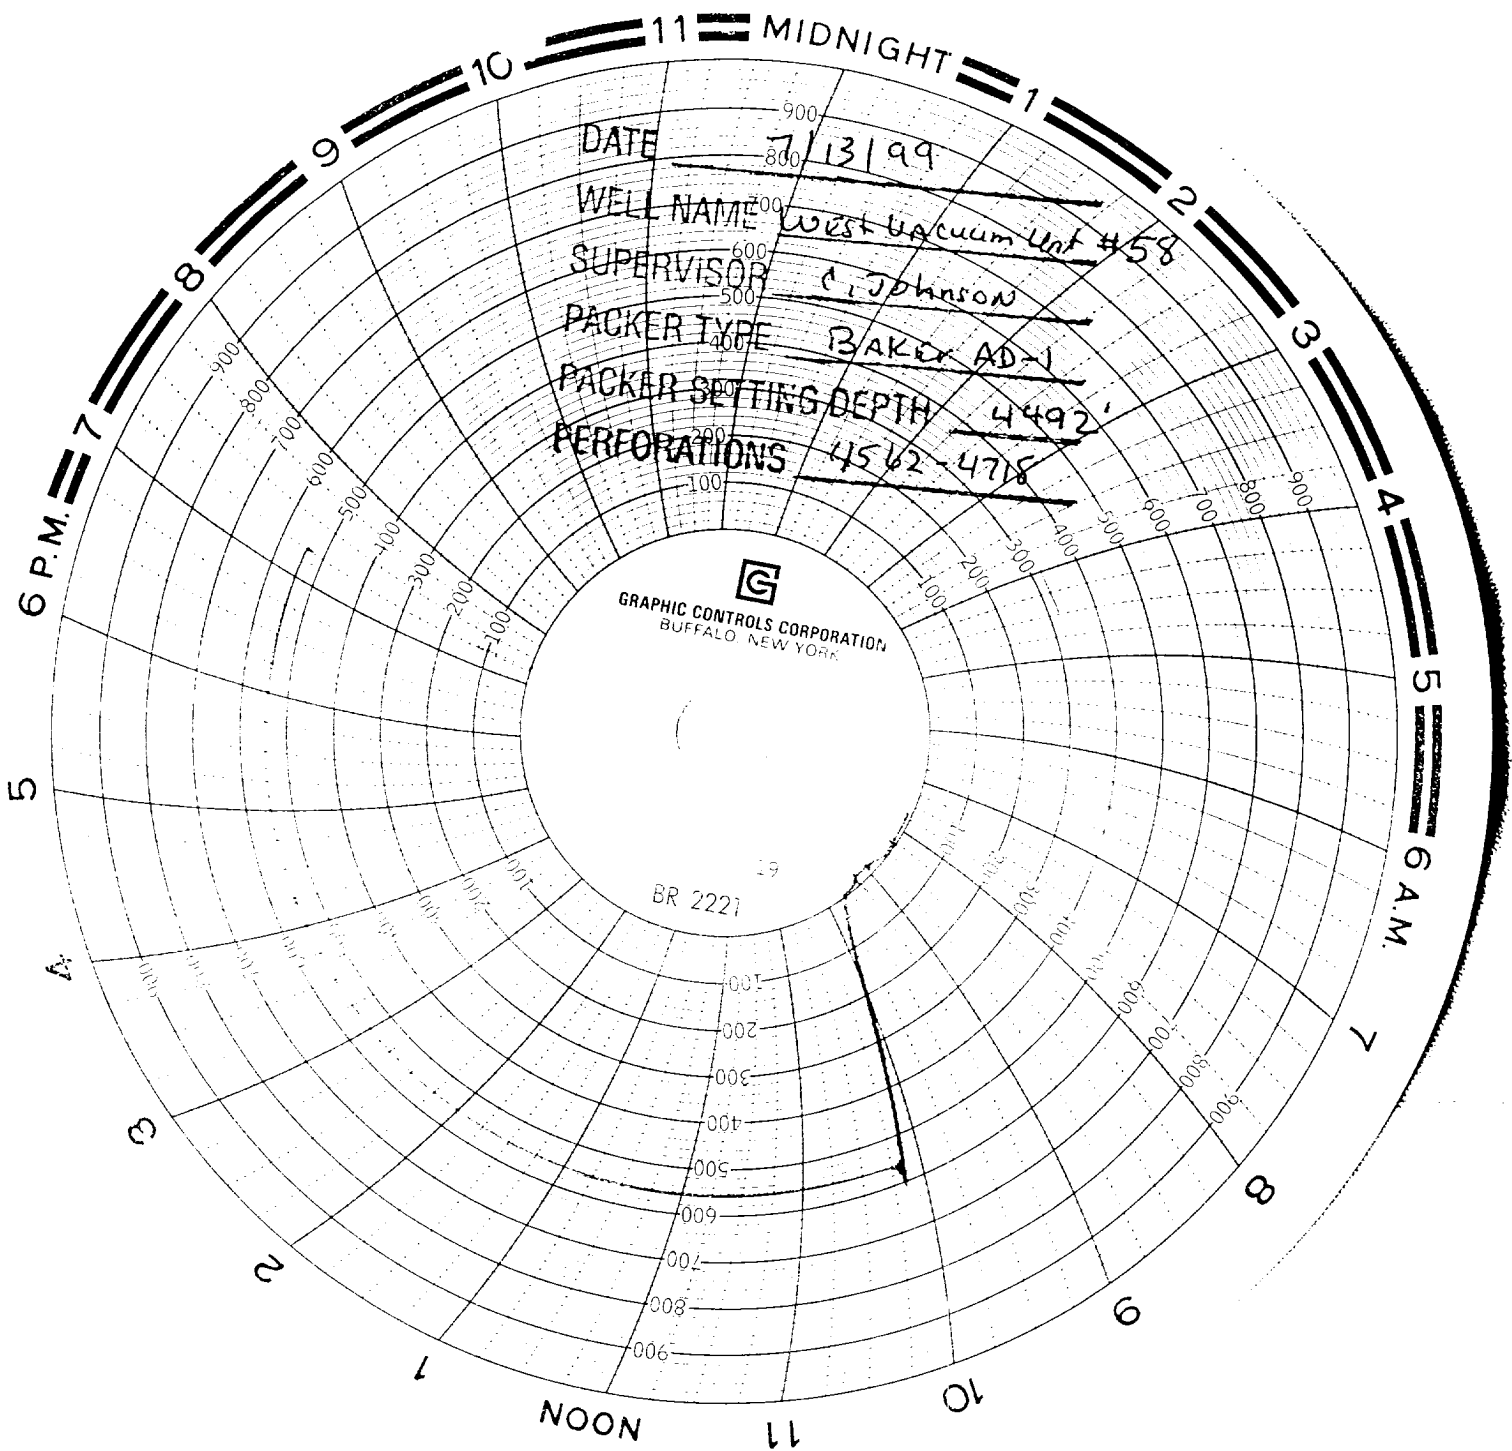

DATE 7/13/99
WELL NAME West Vacuum Unit #58
SUPERVISOR C. Johnson
PACKER TYPE BAKER AD-1
PACKER SETTING DEPTH 4492'
PERFORATIONS 4562-4718

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK

BR 2221

CP