

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-02084
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Bridges State
8. Well No. 57
9. Pool name or Wildcat Vacuum Grayburg (San Andres)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☒

GAS
WELL ☐

OTHER ☐

2. Name of Operator Mobil Producing TX & NM Inc.*

*Mobil Exploration & Producing US Inc as agent for MPTM

3. Address of Operator

P.O. Box 633, Midland, TX 79702

4. Well Location

Unit Letter D : 660 Feet From The North Line and 660 Feet From The West Line

Section 23

Township 17-S

Range 34-E

NMPM

Lea

County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
KB-4044

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.

RIH W/ WS TO 4123'. LOAD HOLE W/ 10 PPG GELLED BRINE. PUH TO 2780'. SPOT 30 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 2730' AND TOC @ 2698' FROM 2780-2648'.

PUH TO 1843'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1793' FROM 1843-1743'. **PLUG MUST BE TAGGED!**

PUH TO 876'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 826' FROM 876-776'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). **PLUG MUST BE TAGGED!**

PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS.

ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kaye Pollock

TITLE Regulatory Technician

DATE 08-06-93

TYPE OR PRINT NAME Kaye Pollock

915-

TELEPHONE NO. 688-2584

(This space for State Use)

Orig. Signed by
Paul Kautz
Geologist

APPROVED BY _____ DATE AUG 11 1993

CONDITIONS OF APPROVAL, IF ANY: THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED

BRIDGES STATE # 57
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO

RECOMMENDED WORKOVER PROCEDURE


1. MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
2. RIH W/ WS TO 4123'. LOAD HOLE W/ 10 PPG GELLED BRINE. PUH TO 2780'. SPOT 30 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 2730' AND TOC @ 2698' FROM 2780-2648'.
3. PUH TO 1843'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1793' FROM 1843-1743'. **PLUG MUST BE TAGGED!**
4. PUH TO 876'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 826' FROM 876-776'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). **PLUG MUST BE TAGGED!**
5. PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS.
6. ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

BRIDGES STATE
WELL # 57
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO
CURRENT COMPLETION

KB = 4044'

GL = 4033'

D, 23, T 17-S, R 34-E, 660' FNL, 660' FWL

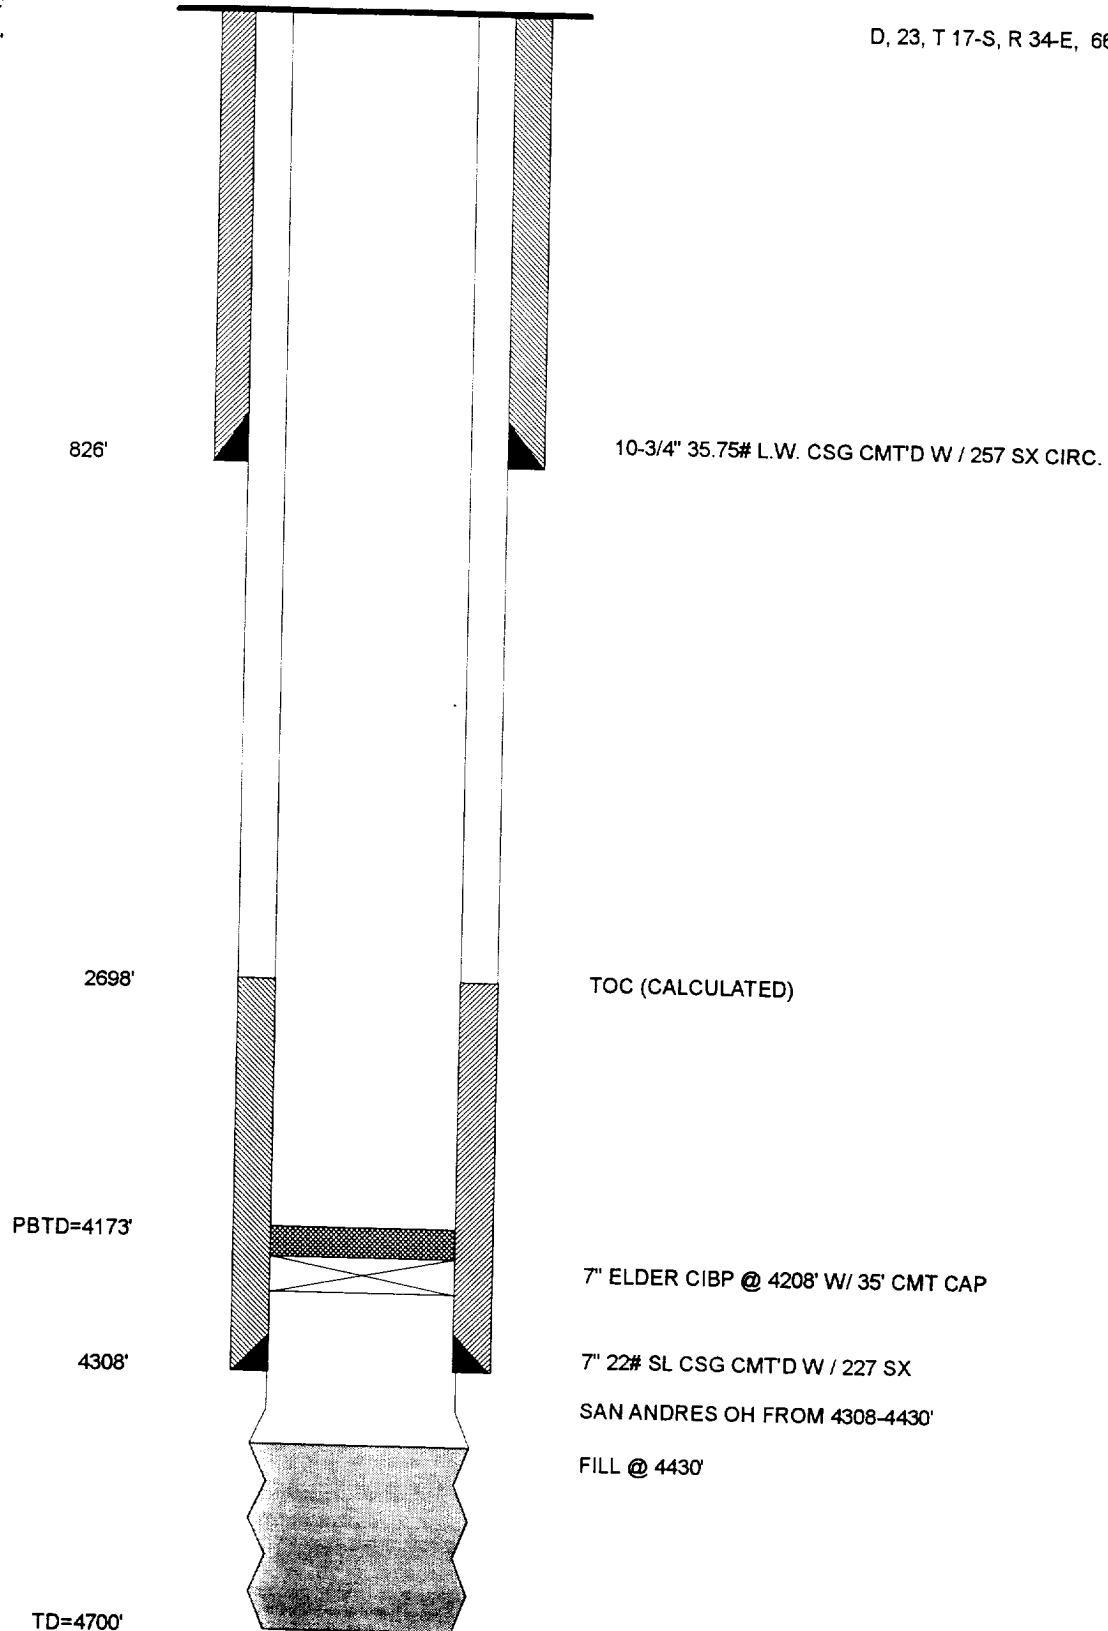

BRIDGES STATE
WELL # 57
VACUUM GRAYBURG (SAN ANDRES) FIELD
LEA COUNTY, NEW MEXICO
PROPOSED COMPLETION

KB = 4044'
GL = 4033'

D, 23, T 17-S, R 34-E, 660' FNL, 660' FWL

10-3/4" 35.75# L.W. CSG @ 826'
CMT'D W / 257 SX CIRC.

15 SX CLASS C NEAT CMT PLUG
FROM 30'-SURFACE

50 SX CLASS C NEAT CMT PLUG ACROSS CSG SHOE
FROM 876-776'
PLUG MUST BE TAGGED!

50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @
1793' AND 7" CSG STUB FROM 1843-1743'
PLUG MUST BE TAGGED!

TOC @ 2698' (CALCULATED)

30 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @
2730' AND TOC @ 2698' FROM 2780-2648'

PBTD=4173'

7" ELDER CIBP @ 4208' W/ 35' CMT CAP

7" 22# SL CSG @ 4308'
CMT'D W / 227 SX

SAN ANDRES OH FROM 4308-4430'

FILL @ 4430'

TD=4700'