
Submit 3 Copies To Appropriate District State of New Mexico Form C-103 Office Energy, Minerals and Natural Resources Revised March 25, 1999 District I WELL API NO. 1625 N. French Dr., Hobbs, NM 87240 District II 30-025-02092 OIL CONSERVATION DIVISION 811 South First, Artesia, NM 87210 5. Indicate Type of Lease 2040 South Pacheco District III 1000 Rio Brazos Rd., Aztec, NM 87410 STATE X Santa Fe, NM 87505 FEE District IV 6. State Oil & Gas Lease No. 2040 South Pacheco, Santa Fe, NM 87505 B-1520 SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreement Name: (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH Vacuum Glorieta West Unit PROPOSALS.) 1. Type of Well: Oil Well A Gas Well Other 2. Name of Operator 8. Well No. 2 Chevron U.S.A. Inc. 3. Address of Operator 9. Pool name or Wildcat 15 Smith Road, Midland Texas 79705 Vacuum Glorieta 4. Well Location 1980 Unit Letter feet from the south 660 feet from the west line and line 24 Township 17_S Range 34-E Section **NMPM** County Lea 10. Elevation (Show whether DR, RKB, RT, GR, etc.) 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON \mathbf{x} REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND **ABANDONMENT** PULL OR ALTER CASING **MULTIPLE** CASING TEST AND COMPLETION **CEMENT JOB** OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation. 1. Notify OCD 24hrs Prior to MI & RU. 2. RIH Tag 4 / CIBP @ 5822 spot 25sx plug 5822-5600(Glorieta)WOC Tag. 3. Displace hole w/MLF 9.5# Brine w/25# Gel p/bbl. 4. Spot 60sx plug 4400-3800(7" shoe,4 1/2 liner top ,Queen) WOC Tag. 5. Perf 4 holes @ 2600, sqz 40sx plug 2600-2500(B-salt, Yates) WOC Tag 6. Perf 4 holes @ 900, sqz 60sx plug 900-700(10 3/4 shoe)WOC Taq. 7. Perf 4 holes @ 250.sqz 75sx plug 250-surf(surf)WOC Tag. Hobbs 8. Install dry hole marker. OCD THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE REGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED. I hereby certify that the information above is true and complete to the best of my knowledge and belief. __ TITLE HES Specialist Type or print name Telephone No. 915, 687,7153 (This space for State) APPROVED BY GARY WWINK Conditions of approva, FIELD REPRESENTATIVE II/STAFF MANAGER

PLUGGING & ABANDONMENT WORKSHEET

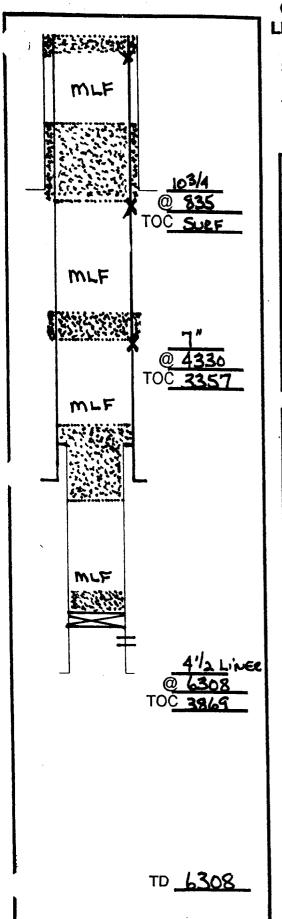

OPERATOR		EVED			•
LEASENAME	VACU	UM	COLORIETA	WES	T UNIT
			WELL		a
SECT _	24	TWN	<u> 17-5</u>	RNG	34-€
FROM	1980	N(S)L	660	E(W)L	
TD:	0308	_ F	ORMATION	@TD	GlORIETA
PBTD:		F	ORMATION	l@PB	TD

	SIZE	SET @	TOC	TOC DET	ERMINED BY
SURFACE	1034	835	SURF	Cie	C.
INTMED 1	7"	4330	3357	CAI	
INTMED 2					
PROD					-
	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1	41/2	3869	6308	3869	ciec
LINER 2					
	CUT &	PULL @		TOI	- BOTTOM
INTMED 1			PERFS	5945	- 6034
INTMED 2			OPENHOLE		•
PROD					

* REQUIRED PLUGS DISTRICT I

RUSTLER (ANHYD)		
YATES		
QUEEN		
GRAYBURG		l
SAN ANDRES		
CAPITAN REEF		
		l
DELAWARE		
BELL CANYON		l
CHERRY CANYON		l
BRUSHY CANYON		١
BONE SPRING		۱
	ļ	l
CLORIETA	ļ	I
BLINEBRY		l
TUBB	ļ	l
DRINKARD		1
ABO	-	1
		-
wc		4
PENN		-
STRAWN	 	-
ATOKA	-	1
MORROW	-	$\frac{1}{2}$
DELCARAN	 	4
DEVORIAN	 	-

PLUG	TYPE	SACKS	DEPTH
	PLUG	CMNT	
EXAMPLES			
PLUG#1	ОН	25 SXS	9850°
PLUG#2	SHOE	50 SXS	8700'-8800'
PLUG#3	CIBP/35'		5300°
PLUG#3	CIBP	25 SXS	5300°
PLUG#4	STUB	50 SXS	4600-4700
PLUG#6	RETNR SQZ	200 SXS	400
PLUG#7	SURF	10 SXS	0-10'
PLUG #1	GOLIETA	25	5822
PLUG#2	7" SHOE	60	4400
PLUG#3	B-SALT	40	2600
PLUG#4	16345	60	900
PLUG#5	SURF	75	250
PLUG#6			
PLUG#7			
PLUG#1	ļ		
PLUG#9		ļ. <u></u>	
PLUG # 10			<u></u>
PLUG#		-	5000 9773
PLUG #		<u> </u>	ED
	 		Habbs
ļ	ļ	 	OCD
		 	
	 	 	1
	<u> </u>	 	<u> </u>
1 .	1	.1	ie:

, •

and the second s

•