

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-02195
1. Type of Well: Oil Well ☐ Gas Well ☐ Other Injector ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Texaco Exploration & Production, Inc.		6. State Oil & Gas Lease No. B-871
3. Address of Operator P. O. Box 3109, Midland, TX 79702		7. Lease Name or Unit Agreement Name: Vacuum Grayburg San Andres
4. Well Location Unit Letter <u>M</u> : <u>660</u> feet from the <u>South</u> line and <u>660</u> feet from the <u>West</u> line Section <u>33</u> Township <u>17S</u> Range <u>34E</u> NMPM Lea County		8. Well No. 30
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat West Vacuum Unit

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐ OTHER: ☐	SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐ CASING TEST AND CEMENT JOB ☐ OTHER: ☐

12. **Describe proposed or completed operations.** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.
1. Set 5 1/2" CIBP @ 4325' (Grayburg - San Andres) Spot 25 Sx plug 4325'-4100'. WOC Tag.
 2. Displace hole w/MLF, 9.5# brine w/25# gel P/BBL
 3. Spot 25 Sx plug 3800'-3600', (Queen)
 4. Spot 25 Sx plug 2800'-2600' (Yates, B-Salt) WOC Tag
 5. Spot 25 Sx plug 1800'-1600' (T-Salt) WOC Tag.
 6. Perf 6 holes @ 950', Sqz 125 Sx plug 950-700' (8 5/8" shoe) WOC Tag
 7. 10 Sx Surf, Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24
HOURS PRIOR TO THE BEGINNING OF
PLUGGING OPERATIONS FOR THE CLOS
TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE James T. Corbitt TITLE FACILITY ENGINEER DATE 8/27/01
Type or print name JAMES T. CORBITT Telephone No. 915 688-4438
(This space for State use)

APPROVED BY _____ TITLE _____ DATE _____
Conditions of approval, if any:

(2 STRING CSNG)

OPERATOR Texaco Exploration & Production

LEASENAME VACUUM GRAY BUE SAN ANDRES

WELL # 30

SECT 33 TWN

175 RNG 34 E

FROM 660 NASL


660 EW L

TD: 4766

FORMATION @ TD GRAY BUEG

PBTD: _____

FORMATION @ PBTD S. ANDRES

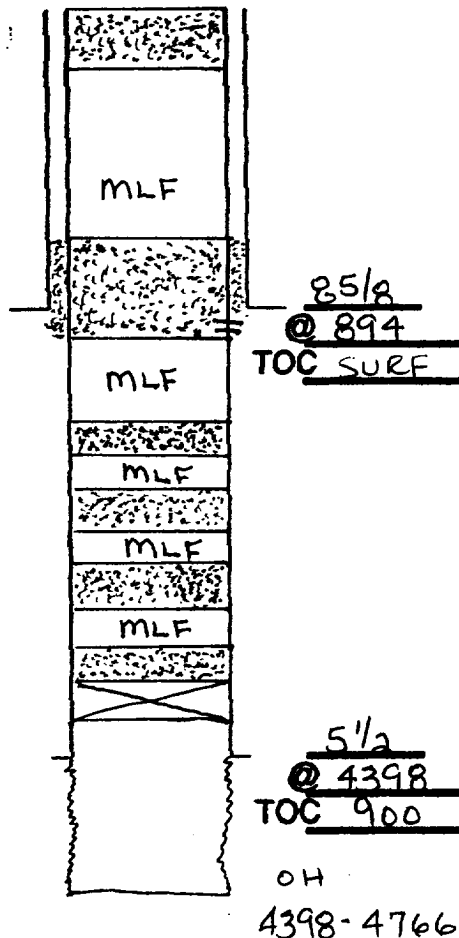

TD 4766

	SIZE	SET @	TOC	TOC DETERMINED BY	
SURFACE	8 5/8	894	SURF	Circ	
INTMED 1					
INTMED 2					
PROD	5 1/2	4398	900	CALC	
	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					
	CUT & PULL @			TOP - BOTTOM	
INTMED 1			PERFS	/ -	
INTMED 2			OPENHOLE	4398 - 4766	
PROD					

***REQUIRED PLUGS DISTRICT 1**

RUTLER (AMITY)	
YATES	
QUEEN	
GRAYBURG	
JEAN ANDRE	
CAPTAIN REEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BRUNY CANYON	
BOONE SPRING	
GLORIETA	
GLIMERY	
TUBS	
DEBHEARD	
ARO	
WC	
FENG	
STRAWN	
ADOKA	
MORROW	
AGE	
DEVONIAN	

[illegible]