

Submit 3 Copies To Appropriate District

Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.

30-025-02198

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

B-1406-1

7. Lease Name or Unit Agreement Name:

West Vacuum Unit

8. Well No.

12

9. Pool name or Wildcat

Vacum Grayburg San Andres

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Chevron USA, Inc.

3. Address of Operator

15 Smith Rd. Midland, Tx 79705

4. Well Location

Unit Letter B : 330 feet from the north line and 1650 feet from the east line

Section 34

Township 17-S Range 34-E

NMPM

County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Notify OCD 24hrs prior to MI & RU.

2. RIH Tag 5 1/2 CIBP @ 4183 , spot 40sx plug 4183-3800(Grayburg, San Andres, Queen) WOC Tag

3. Displace hole w/MLF, 9.5# Brine w/25# Gel P/BBL.

4. Perf 4 holes @ 2700,sqz 50sx plug 2700-2600(yates, B-salt) WOC Tag.

5. Perf 4 holes @ 1620,sqz 50sx plug 1620-1500 (8 5/8 shoe)WOC Tag.

6. Perf 4 holes @ 300, sqz 75sx plug 300-surf, 5 1/2 X 8 5/8 csqs(surf)WOC Tag.

7. Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE D.R. Hecker

TITLE HES Specialist

DATE 12/19/2002

Type or print name

(This space for State use)

Telephone No.

APPROVED BY

Conditions of approval, if any:

ORIGINAL SIGNED BY

TITLE GARY W. WINK

OC FIELD REPRESENTATIVE II/STAFF MANAGER

DEC 20 2002

PLUGGING & ABANDONMENT WORKSHEET

(2 STRING CSNG)

OPERATOR CHEVRON USA INC.

LEASE NAME WEST VACUM UNIT


WELL # 12

SECT 34 TWN 17-S RNG 34-E

FROM 330 NSL 1650 EWL

TD 4635 FORMATION @ TD G.S.A.

PBTD FORMATION @ PBTD

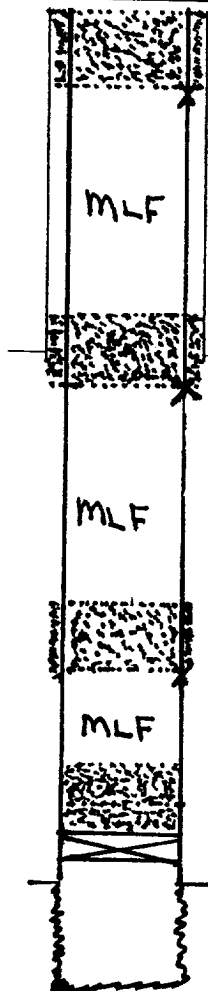

8 5/8
@ 1563
TOC SURF

5 1/2
@ 4283
TOC 2683

TD 4635

	SIZE	SET @	TOC	TOC DETERMINED BY
SURFACE	<u>8 5/8</u>	<u>1563</u>	<u>SURF</u>	<u>Circ</u>
INTMED 1				
INTMED 2				
PROD	<u>5 1/2</u>	<u>4283</u>	<u>2683</u>	<u>CALC</u>

	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1					
LINER 2					

	CUT & PULL	TOP - BOTTOM
INTMED 1	PERFS	
INTMED 2		
PROD	OPENHOLE	<u>4238 - 4635</u>

*REQUIRED PLUGS DISTRICT

	PLUG	TYPE PLUG	SACKS CEMENT	DEPTH
RUSTLER (ANHYD)	<u>1</u>	<u>G.S.A</u>	<u>40</u>	<u>4183</u>
YATES	<u>2</u>	<u>B-SALT</u>	<u>50</u>	<u>2700</u>
QUEEN	<u>3</u>	<u>8 5/8 S</u>	<u>50</u>	<u>1600</u>
GRAYBURG	<u>4</u>	<u>SURF</u>	<u>75</u>	<u>300</u>
SAN ANDRES				
CAPTAN REEF				
DELAWARE				
BELL CANYON				
CHERRY CANYON				
BRUSHY CANYON				
BONE SPRING				
GLORIETA				
BLINBRY				
TUBB				
DRINKARD				
ABO				
WC				
PENN				
STRAWN				
ATOKA				
MORROW				
MISS				
DEVONIAN				