

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

## OIL CONSERVATION DIVISION

P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

|                                                                                                     |
|-----------------------------------------------------------------------------------------------------|
| WELL API NO.<br>30-025-12704                                                                        |
| 5. Indicate Type of Lease<br>STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/> |
| 6. State Oil & Gas Lease No.                                                                        |
| 7. Lease Name or Unit Agreement Name<br>Bridges State                                               |
| 8. Well No.<br>33                                                                                   |
| 9. Pool name or Wildcat<br>Vacuum Grayburg (San Andres)                                             |

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

|                                                                                                                                                                                                                            |                                                                                                               |                   |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------|-------------------|
| 1. Type of Well:<br>OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>                                                                                          | 2. Name of Operator Mobil Producing TX & NM Inc.*<br>*Mobil Exploration & Producing US Inc. as agent for MPTM | 8. Well No.<br>33 |
| 3. Address of Operator<br>P.O. Box 633, Midland, TX 79702                                                                                                                                                                  | 9. Pool name or Wildcat<br>Vacuum Grayburg (San Andres)                                                       |                   |
| 4. Well Location<br>Unit Letter J : 1980 Feet From The South Line and 1980 Feet From The East Line<br>Section 26 Township 17-S Range 34-E NMPM Lea County<br>10. Elevation (Show whether DF, RKB, RT, GR, etc.)<br>KB 4025 |                                                                                                               |                   |

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

## SUBSEQUENT REPORT OF:

|                                                |                                                      |                                                     |                                               |
|------------------------------------------------|------------------------------------------------------|-----------------------------------------------------|-----------------------------------------------|
| PERFORM REMEDIAL WORK <input type="checkbox"/> | PLUG AND ABANDON <input checked="" type="checkbox"/> | REMEDIAL WORK <input type="checkbox"/>              | ALTERING CASING <input type="checkbox"/>      |
| TEMPORARILY ABANDON <input type="checkbox"/>   | CHANGE PLANS <input type="checkbox"/>                | COMMENCE DRILLING OPNS. <input type="checkbox"/>    | PLUG AND ABANDONMENT <input type="checkbox"/> |
| PULL OR ALTER CASING <input type="checkbox"/>  | OTHER: <input type="checkbox"/>                      | CASING TEST AND CEMENT JOB <input type="checkbox"/> | OTHER: <input type="checkbox"/>               |

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
2. RIH W/ WS TO 4250'. LOAD HOLE W/ 10 PPG GELLED BRINE. SPOT 40 SX CLASS C NEAT CMT PLUG ACROSS 5" LINER TOP @ 4054' AND 7" CSG SHOE @ 4200' FROM 4250-4004'
3. PUH TO 2770'. SPOT 40 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 2720' AND TOC @ 2665' FROM 2770-2615'
4. PUH TO 1690'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1640' FROM 1690-1590'. PLUG MUST BE TAGGED!
5. PUH TO 871'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 821' FROM 871-771'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). PLUG MUST BE TAGGED!
6. PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS
7. ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kaye Pollock TITLE Regulatory Technician DATE 08-04-93  
TYPE OR PRINT NAME Kaye Pollock TELEPHONE NO. 915-688-2584

(This space for State Use)

Orig. Signed by  
Paul Kautz  
GeologistAPPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE AUG 09 1993  
CONDITIONS OF APPROVAL, IF ANY:THE COMMISSION MUST BE NOTIFIED 24  
HOURS PRIOR TO THE BEGINNING OF  
PLUGGING OPERATIONS FOR THE C-103  
TO BE APPROVED.

BRIDGES STATE # 33  
VACUUM GRAYBURG (SAN ANDRES) FIELD  
LEA COUNTY, NEW MEXICO

RECOMMENDED WORKOVER PROCEDURE


1. MIRU PU. DIG PIT. FLOW WELL BACK TO PIT. ND WH. NU BOP.
2. RIH W/ WS TO 4250'. LOAD HOLE W/ 10 PPG GELLED BRINE. SPOT 40 SX CLASS C NEAT CMT PLUG ACROSS 5" LINER TOP @ 4054' AND 7" CSG SHOE @ 4200' FROM 4250-4004'.
3. PUH TO 2770'. SPOT 40 SX CLASS C NEAT CMT PLUG ACROSS SALT BASE @ 2720' AND TOC @ 2665' FROM 2770-2615'.
4. PUH TO 1690'. CUT AND PULL 7" CSG OR PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG ACROSS SALT TOP @ 1640' FROM 1690-1590'. **PLUG MUST BE TAGGED!**
5. PUH TO 871'. SPOT 50 SX CLASS C NEAT CMT PLUG ACROSS 10-3/4" CSG SHOE @ 821' FROM 871-771'. (IF 7" CSG NOT RECOVERED, PERFORATE AND SQUEEZE 50 SX CLASS C NEAT CMT PLUG). **PLUG MUST BE TAGGED!**
6. PUH TO 30'. SPOT 15 SX CLASS C NEAT CMT PLUG FROM 30'-SURFACE. POOH W/ WS.
7. ND BOP. RD PU. DIG OUT CELLAR AND CUT CSG 3' BELOW SURFACE. WELD STEEL PLATE ON CSG STUB. ERECT P&A MARKER WITH WELL NAME AND PLUGGED DATE. FILL CELLAR AND CLEAN SURFACE LOCATION.

BRIDGES STATE  
WELL # 33  
VACUUM GRAYBURG (SAN ANDRES) FIELD  
LEA COUNTY, NEW MEXICO  
CURRENT COMPLETION

KB = 4025'

GL = 4014'

J, 26, T 17-S, R 34-E, 1980' FSL, 1980' FEL

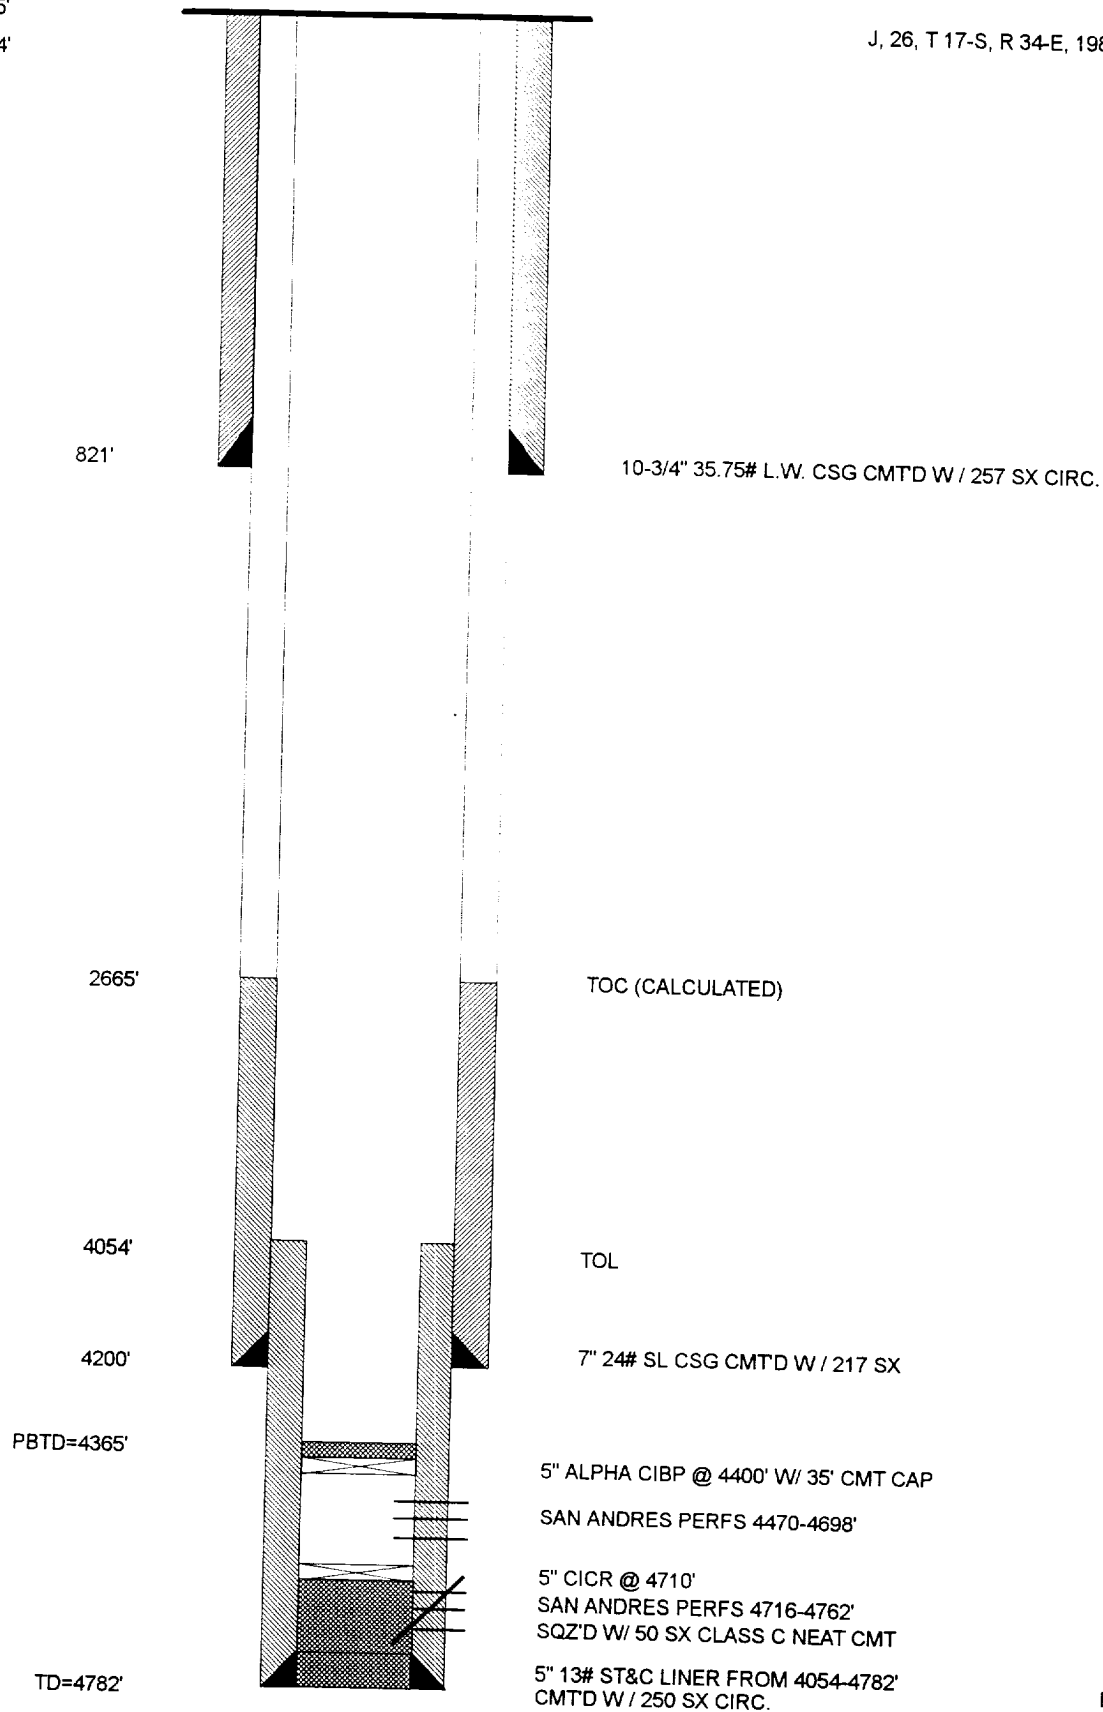

BS33C.PRE

ALS 08/03/93

J, 26, T 17-S, R 34-E, 1980' FSL, 1980' FEL

GL = 4014'

10-3/4" 35.75# CSG @ 821' CMTD  
W / 257 SX CIRC.

BS33P.PRE  
ALS 08/03/93