

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-20125
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Texaco Exploration & Production, Inc.		6. State Oil & Gas Lease No. B-155-1
3. Address of Operator P. O. Box 3109, Midland, TX 79702		7. Lease Name or Unit Agreement Name: New Mexico O State NCT-1
4. Well Location Unit Letter <u>N</u> : <u>760</u> feet from the <u>South</u> line and <u>2080</u> feet from the <u>West</u> line Section <u>36</u> Township <u>17S</u> Range <u>34E</u> NMPM <u>Lea</u> County		8. Well No. <u>1</u> <u>17</u>
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat <u>Vacuum Wolfcamp, Vacuum Upper Penn, Vacuum Devonian</u>

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. **Describe proposed or completed operations.** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. RU on Y-Side, RIH set 2 7/8" CIBP @ 9350' (Penn) above collapsed csg @ 9358' fill 2 7/8" csg w/185 Sx plug 9350-'1625' WOC Tag.
2. RU on Z-Side, RIH tag CIBP @ 9300' (Devonian) fill 3 1/2" csg w/275 Sx plug 9300'-1625' WOC Tag
3. RU on X-Side, RIH Tag CIBP @ 9000' (Wolfcamp) Fill 2 7/8" csg w/180 Sx plug 9000'-1625' WOC Tag.
4. Cut 3 csg strings @ 1625', L/D csgs.
5. Perf 9 5/8" csg w/6 holes @ 1625', Sqz 150 Sx 1625'-1200' (T-Salt- 13 3/8" shoe) WOC Tag.
6. Displace hole w/MLF, 9.5# Brine w/25# gel P/BBL.
7. 10 Sx Surf, Install dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE James T. Corbitt TITLE FACILITY ENGINEER DATE 4/16/01
Type or print name JAMES T. CORBITT Telephone No. 915 688-4438
(This space for State use)

APPROVED BY _____ TITLE _____ DATE _____
Conditions of approval, if any:

IC

CP

exp. 10/1/01

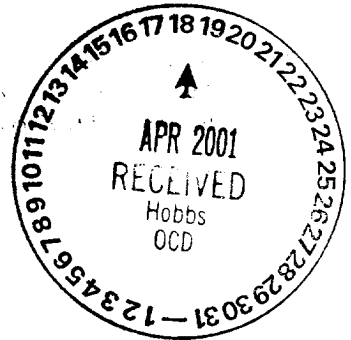

PLUGGING & ABANDONMENT WORKSHEET (1 STRING CSNG)

OPERATOR TEXACO EXPLORATION & PRODUCTION

LEASENAME NGW Mexico D NCT-1

SECT 36 TWN 2

FROM 760 NISL

TD: 12.082

PBTD: 9358


WELL # 17

17S RNG 34E

2080 EWL

FORMATION @ TD ABo

FORMATION @ PBTD WGLFCamp

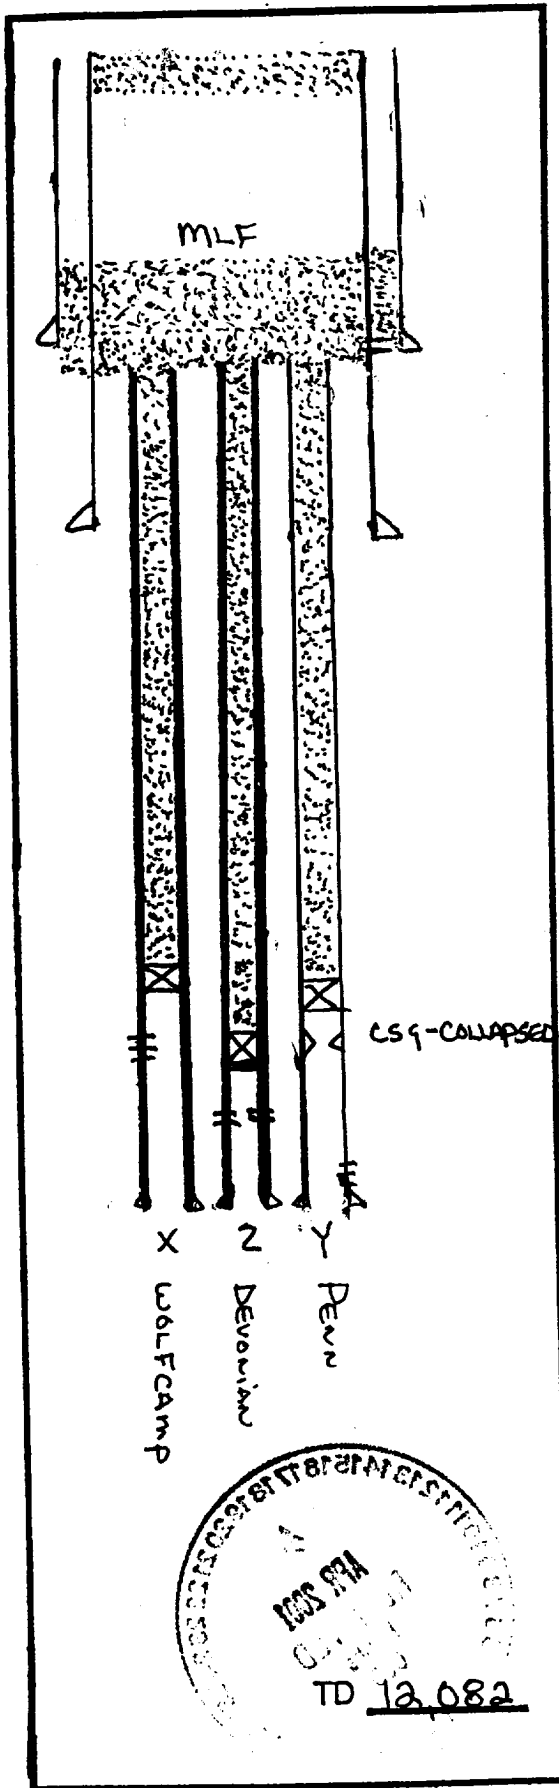

	SIZE	SET @	TOC	TOC DETERMINED BY	
SURFACE	13 3/8	1612	SURF	CIRC	
INTMED 1	9 5/8	4750	2700	2700 TS	
INTMED 2	2 7/8	10,975	1625	TS	
PROD	3 1/2	12,082	1625	TS	
	SIZE	TOP	BOT	TOC	DETERMINED BY
LINER 1	2 7/8	10,964	1625	TS	
LINER 2					
	CUT & PULL @			TOP - BOTTOM	
INTMED 1			PERFS	-	
INTMED 2			OPENHOLE	-	
PROD					

*** REQUIRED PLUGS DISTRICT I**

RUSTLER (ANHYD)	
YATES	
QUEEN	
GRAYBURG	
SAN ANDRES	
CAPTAN REEF	
DELAWARE	
BELL CANYON	
CHERRY CANYON	
BRUSHY CANYON	
BONE SPRING	
GLORIETA	
BLINEBRY	
TUBB	
ORINKARD	
ABO	
WC	
PENN	
STRAWN	
ATOEKA	
MORROW	
MISS	
DEVONIAN	

[illegible]