
Office			
District I	Energy, Minerals and Natural Res	sources WELL A	Revised March 25,
1625 N. French Dr., Hobbs, NM 87240 District II	OIL CONSERVATION DIV		API NO. 30-025-20710
811 South First, Artesia, NM 87210	2040 South Pacheco	5. Indic	ate Type of Lease
District III 1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505		TATE 😿 FEE 🗌
District IV 2040 South Pacheco, Santa Fe, NM 87505	2 4, 11,12 0, 505	6. State	Oil & Gas Lease No.
	CES AND REPORTS ON WELLS	7. Lease	e Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROP DIFFERENT RESERVOIR. USE "APPL PROPOSALS.)	OSALS TO DRILL OR TO DEEPEN OR PLUC CATION FOR PERMIT" (FORM C-101) FOR	S BACK TO A SUCH	·
1. Type of Well: Oil Well 🕱 Gas Well	Other	VACUUM TRACT O	GLORIETA EAST UNIT 001
2. Name of Operator	Ollo	8. Well	No.
Phillips Petroleum Company 3. Address of Operator		11 0 Page	nome on Wildoot
3. Address of Operator 4001 Penbrook Street Odessa	. TX 79762	İ	name or Wildcat GLORIETA
4. Well Location		, vicodi	
Unit Letter P :	330 feet from the SOUTH	line and 330	feet from theEAST
Section 28	Township 17s Range	35E NMPM	County LEA
	10. Elevation (Show whether DR, RK 3947' RKB	· · · · · · · · · · · · · · · · · · ·	
	Appropriate Box to Indicate Natur	, .	
NOTICE OF INT			ENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON REME	DIAL WORK	☐ ALTERING CASING
EMPORARILY ABANDON	CHANGE PLANS COMM	MENCE DRILLING OPNS	S. PLUG AND ABANDONMENT
PULL OR ALTER CASING	MULTIPLE CASIN	IG TEST AND	
		NT JOB	
OTHER:	COMPLETION CEME	NT JOB R: <b>ist csg ireat w/</b> o	CORR INHIBITOR & T.A.
OTHER: 12. Describe Proposed or Complete	COMPLETION CEME	R: TST CSG TREAT W/C details, and give pertine	ent dates, including estimated dat
DTHER:  12. Describe Proposed or Complete of starting any proposed work). or recompilation.  09/26/01 MIRU DOU ND WH  09/27/01 ND WH INSTALL N  RAN BIT & SCRP  09/28/01 FIN GIH W/5-1/2  FL PRESS TST C	COMPLETION CEME  OTHE  ed Operations (Clearly state all pertinent	R: TST CSG TREAT W/C details, and give pertine etions: Attach wellbore  FLANGE OFF WH. ON 195 JTS 2-3/8 WS SIH W/5-1/2 EZ DRIL EZ DRL BP 5950' CTR RT RECORDER OK COOH	ent dates, including estimated dat diagram of proposed completion is TALLY GIH LL BP RAN 15 STDS CC W/100 BBL PKR W/WS LD ND BOP NU
DTHER:  12. Describe Proposed or Complete of starting any proposed work). or recompilation.  09/26/01 MIRU DOU ND WH  09/27/01 ND WH INSTALL N  RAN BIT & SCRP  09/28/01 FIN GIH W/5-1/2  FL PRESS TST C	COMPLETION  CEME  OTHE  ed Operations (Clearly state all pertinent SEE RULE 1103. For Multiple Comple  THREADS ON WH BAD COULDN'T TAKE:  EW WH NU BOP GIH W/BIT & SCRAPER  PER T/6119' COCH W/BIT & SCRAPER  EZ DRI, BP 190 JTS 2-3/8 TBG SET  ESG & CIBP T/500 PSI 30 MIN W/CHAI	R: TST CSG TREAT W/C details, and give pertine etions: Attach wellbore  FLANGE OFF WH. ON 195 JTS 2-3/8 WS SIH W/5-1/2 EZ DRIL EZ DRL BP 5950' CTR RT RECORDER OK COOH	ent dates, including estimated dat diagram of proposed completion is TALLY GIH LL BP RAN 15 STDS CC W/100 BBL PKR W/WS LD ND BOP NU
DTHER:  12. Describe Proposed or Complete of starting any proposed work). or recompilation.  09/26/01 MIRU DOU ND WH  09/27/01 ND WH INSTALL N  RAN BIT & SCRP  09/28/01 FIN GIH W/5-1/2  FL PRESS TST C	COMPLETION  CEME  OTHE  ed Operations (Clearly state all pertinent SEE RULE 1103. For Multiple Comple  THREADS ON WH BAD COULDN'T TAKE:  EW WH NU BOP GIH W/BIT & SCRAPER  PER T/6119' COCH W/BIT & SCRAPER  EZ DRI, BP 190 JTS 2-3/8 TBG SET  ESG & CIBP T/500 PSI 30 MIN W/CHAI	R: TST CSG TREAT W/C details, and give pertine etions: Attach wellbore  FLANGE OFF WH. ON 195 JTS 2-3/8 WS SIH W/5-1/2 EZ DRIL EZ DRL BP 5950' CTR RT RECORDER OK COOH	ent dates, including estimated dat diagram of proposed completion is TALLY GIH LL BP RAN 15 STDS CC W/100 BBL PKR W/WS LD ND BOP NU
DTHER:  12. Describe Proposed or Complete of starting any proposed work). or recompilation.  09/26/01 MIRU DOU ND WH 09/27/01 ND WH INSTALL N RAN BIT & SCR 09/28/01 FIN GIH W/5-1/2 FL PRESS TST C	COMPLETION  CEME OTHE  cd Operations (Clearly state all pertinent SEE RULE 1103. For Multiple Comple THREADS ON WH BAD COULDN'T TAKE: EW WH NU BOP GIH W/BIT & SCRAPER PER T/6119' COCH W/BIT & SCRAPER EZ DRL BP 190 JTS 2-3/8 TBG SET ESG & CIBP T/500 PSI 30 MIN W/CHAI STATUS T/A WILL TST W/NMOCD (CHAIN) This Approval of Tempora	R: TST CSG TREAT W/C details, and give pertine etions: Attach wellbore FLANGE OFF WH. ON 195 JTS 2-3/8 WS SIH W/5-1/2 EZ DRIL EZ DRL BP 5950' CIR RT RECORDER CK COCH ART ATTACHED) - DROP	ent dates, including estimated dat diagram of proposed completion is TALLY GIH LL BP RAN 15 STDS CC W/100 BBL PKR W/WS LD ND BOP NU
DTHER:  12. Describe Proposed or Complete of starting any proposed work). or recompilation.  09/26/01 MIRU DOU ND WH 09/27/01 ND WH INSTALL N RAN BIT & SCR 09/28/01 FIN GIH W/5-1/2 FL PRESS TST C	COMPLETION  CEME OTHE  CHE  CHE  CHE  CHE  CHE  CHE  CHE	R: TST CSG TREAT W/C details, and give pertine etions: Attach wellbore FLANGE OFF WH. ON 195 JTS 2-3/8 WS SIH W/5-1/2 EZ DRIL EZ DRL BP 5950' CIR RT RECORDER CK COCH ART ATTACHED) - DROP	ent dates, including estimated dat diagram of proposed completion is TALLY GIH LL BP RAN 15 STDS CC W/100 BBL PKR W/WS LD ND BOP NU
OTHER:  12. Describe Proposed or Complete of starting any proposed work). or recompilation.  09/26/01 MIRU DOU ND WH 09/27/01 ND WH INSTALL N RAN BIT & SCR 09/28/01 FIN GIH W/5-1/2 FL PRESS TST C WH RD DOU WELL	COMPLETION  CEME OTHE  cd Operations (Clearly state all pertinent SEE RULE 1103. For Multiple Comple THREADS ON WH BAD COULDN'T TAKE: EW WH NU BOP GIH W/BIT & SCRAPER PER T/6119' COCH W/BIT & SCRAPER EZ DRL BP 190 JTS 2-3/8 TBG SET ESG & CIBP T/500 PSI 30 MIN W/CHAI STATUS T/A WILL TST W/NMOCD (CHAIN) This Approval of Tempora	R: TST CSG TREAT W/C details, and give pertine etions: Attach wellbore FLANGE OFF WH. ON 195 JTS 2-3/8 WS SIH W/5-1/2 EZ DRIL EZ DRL BP 5950' CIR RT RECORDER CK COCH ART ATTACHED) - DROP	ent dates, including estimated dat diagram of proposed completion is TALLY GIH LL BP RAN 15 STDS CC W/100 BBL PKR W/WS LD ND BOP NU
DTHER:  12. Describe Proposed or Complete of starting any proposed work). or recompilation.  09/26/01 MIRU DOU ND WH 09/27/01 ND WH INSTALL N RAN BIT & SCR. 09/28/01 FIN GIH W/5-1/2 FL PRESS TST OWH RD DOU WELL OF THE PRESS TST OWH RD DOU WELL OW THE PRESS TST OWN RD DOU WELL OWN RD DOU WELL OW THE PRESS TST OWN RD DOU WELL OWN RD DOU WELL OW THE PRESS TST OWN RD DOU WELL OW THE PRESS TST OWN	COMPLETION  CEME OTHE  cd Operations (Clearly state all pertinent SEE RULE 1103. For Multiple Comple THREADS ON WH BAD COULDN'T TAKE: EW WH NU BOP GIH W/BIT & SCRAPER FER T/6119' COCH W/BIT & SCRAPER EZ DRL BP 190 JTS 2-3/8 TBG SET ESG & CIBP T/500 PSI 30 MIN W/CHAI STATUS T/A WILL TST W/NMOCD (CHAI This Approval of Tempora Abandonment Expires  cis true and complete to the best of my know	R: TST CSG TREAT W/C details, and give pertine etions: Attach wellbore FLANGE OFF WH. ON 195 JTS 2-3/8 WS SIH W/5-1/2 EZ DRIL EZ DRL BP 5950' CIR RT RECORDER CK COCH ART ATTACHED) - DROP	ent dates, including estimated dat diagram of proposed completion  S. TALLY GIH  LL BP RAN 15 STDS  NC W/100 BBL PKR  W/WS LD ND BOP NU  P. F/DIMS REPORT.
DTHER:  12. Describe Proposed or Complete of starting any proposed work). or recompilation.  09/26/01 MIRU DDU ND WH 09/27/01 ND WH INSTALL N RAN BIT & SCRE 09/28/01 FIN GIH W/5-1/2 FL PRESS TST C WH RD DDU WELL	COMPLETION  CEME OTHE  cd Operations (Clearly state all pertinent SEE RULE 1103. For Multiple Comple THREADS ON WH BAD COULDN'T TAKE: EW WH NU BOP GIH W/BIT & SCRAPER PER T/6119' COCH W/BIT & SCRAPE	R: TST CSG TREAT W/C details, and give pertine etions: Attach wellbore  FLANCE OFF WH.  ON 195 JTS 2-3/8 WS SIH W/5-1/2 EZ DRIL EZ DRL BP 5950' CIR RT RECORDER CK COOH ART ATTACHED) - DROP	ent dates, including estimated dat diagram of proposed completion  S. TALLY GIH  L. BP RAN 15 STDS  C. W/100 BBL PKR  W/WS ID ND BOP NU  P. F/DIMS REPORT.
DTHER:  12. Describe Proposed or Complete of starting any proposed work). or recompilation.  09/26/01 MIRU DDU ND WH 09/27/01 ND WH INSTALL N RAN BIT & SCR. 09/28/01 FIN GIH W/5-1/2 FIL PRESS TST C WH RD DDU WELL	COMPLETION  CEME OTHE  cd Operations (Clearly state all pertinent SEE RULE 1103. For Multiple Comple THREADS ON WH BAD COULDN'T TAKE: EW WH NU BOP GIH W/BIT & SCRAPER PER T/6119' COCH W/BIT & SCRAPER EZ DRI, BP 190 JTS 2-3/8 TBG SET ESG & CIBP T/500 PSI 30 MIN W/CHAI STATUS T/A WILL TST W/NMOCD (CHAI  This Approval of Tempora Abandonment Expires  sis true and complete to the best of my know  TITLE SUPV	R: TST CSG TREAT W/C details, and give pertine etions: Attach wellbore  FLANCE OFF WH.  ON 195 JTS 2-3/8 WS SIH W/5-1/2 EZ DRIL EZ DRL BP 5950' CIR RT RECORDER CK COOH ART ATTACHED) - DROP	ent dates, including estimated dat diagram of proposed completion  S. TALLY GIH  L. BP RAN 15 STDS  C. W/100 BBL PKR  W/WS LD ND BOP NU  P. F/DIMS REPORT.
OTHER:  12. Describe Proposed or Complete of starting any proposed work). or recompilation.  09/26/01 MIRU DOU ND WH 09/27/01 ND WH INSTALL N RAN BIT & SCR 09/28/01 FIN GIH W/5-1/2 FL PRESS TST C WH RD DOU WELL	COMPLETION  CEME OTHE  cd Operations (Clearly state all pertinent SEE RULE 1103. For Multiple Comple THREADS ON WH BAD COULDN'T TAKE: EW WH NU BOP GIH W/BIT & SCRAPER PER T/6119' COCH W/BIT & SCRAPE	R: TST CSG TREAT W/C details, and give pertine etions: Attach wellbore  FLANCE OFF WH.  ON 195 JTS 2-3/8 WS SIH W/5-1/2 EZ DRIL EZ DRL BP 5950' CIR RT RECORDER CK COOH ART ATTACHED) - DROP	ent dates, including estimated dat diagram of proposed completion  S. TALLY GIH  L. BP RAN 15 STDS  C. W/100 BBL PKR  W/WS LD ND BOP NU  P. F/DIMS REPORT.

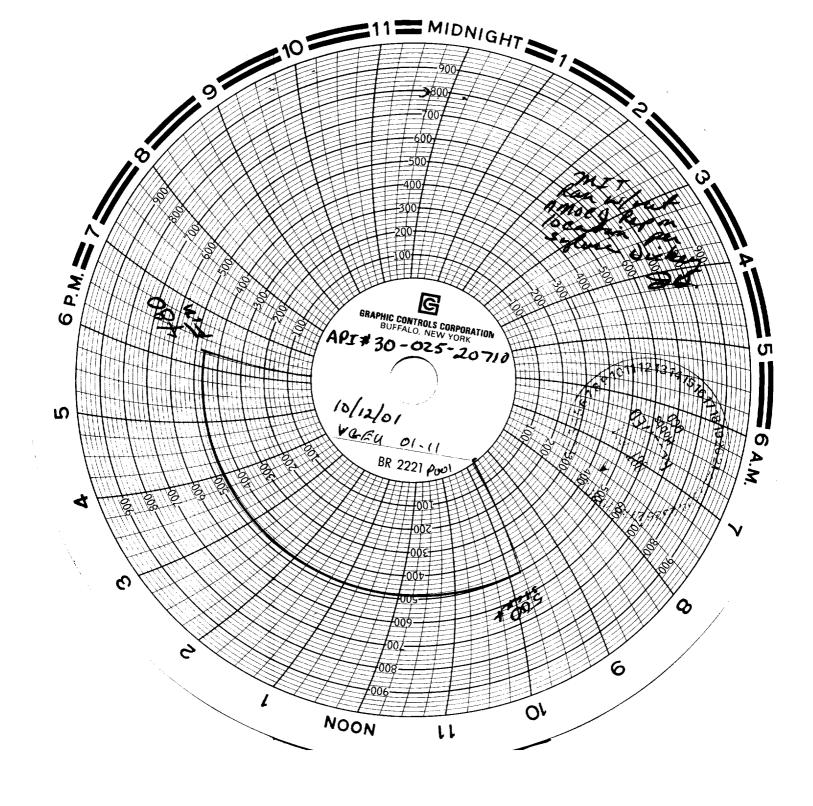

MITT 01-11
Start 500
Valling Unix Used on this well.

CIBP C 5950

OCT 2 6 2001