

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE
(Other instructions
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 12024

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Byron McKnight

3. ADDRESS OF OPERATOR

P. O. Box 297, Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)

At surface

330 feet FNL and 330 Feet FNL

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Mark Smith Ranch

9. WELL NO.

One (1)

10. FIELD AND POOL, OR WILDCAT

Undesignated

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

35. 7-19-S, R-33-E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

GL 3583 feet

12. COUNTY OR PARISH

Lea

13. STATE

NMex

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Perforate 3387 feet - 90 feet. Acidize with 200 gallons 15%.
2. Acidize with 2,000 gallons 20%.
3. Perforate 3391 feet - 95 feet. Acidize with 2,000 gallons 20%.
4. Squeeze perforations with 38 sacks cement, WOC 24 hours.
5. Drill out cement; spot 250 gallons 20% acid. Perforate 3389-3390 feet.
6. Acidize with 1,500 gallons 28%.
7. Frac with 16,000 gallons and 15,000 pounds sand.
8. Swabbed well dry. Well shut in. Set whipstock and milled window in 5 1/2 inch casing from 3287 feet to 3290 feet.
9. Drill 4 5/8 inch sidetracked hole to 3407 feet.
10. Drill sidetracked hole to TD of 3407 feet.
11. Swabbed dry in sidetracked hole.
12. Temporarily abandoned.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Operator

DATE

8-2-71

(This space for Federal or State office use)


APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

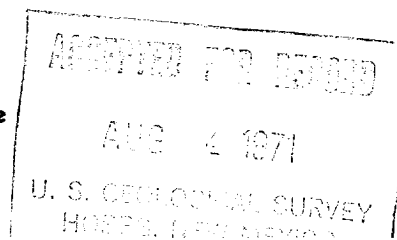

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963-O-685229
GPO 8 37-499 867-651

RECEIVED

AUG 1 1971

OIL CONSERVATION COMM.
HOBBS, R. M.