

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	3002523880
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	857947
7. Lease Name or Unit Agreement Name	NORTH VACUUM ABO WEST UNIT
8. Well No.	19
9. Pool Name or Wildcat	VACUUM ABO NORTH

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	PO BOX 3109, MIDLAND, TX 79702
4. Well Location	Unit Letter <u>J</u> : <u>2104</u> Feet From The <u>SOUTH</u> Line and <u>1856</u> Feet From The <u>EAST</u> Line Section <u>28</u> Township <u>17S</u> Range <u>34E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT,GR, etc.)	4062' RKB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☒	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPERATION ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	ACIDIZE/FRAC ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

9-17-01: MIRU.
9-18-01: NDWH. NUBOP. REL TAC. TIH W/BIT & CSG SCRAPER TO 8841'. NO FILL.
9-19-01: TIH W/LOG TOOL. RAN GR/CCL FR 8840-6970. TIH W/PORT PLUG PERF GUNS & PERF ABO FORMATION FR 8736-8812. TIH W/PKR, SN, & 2 7/8" TBG TESTING TO 5000 PSI. SET PKR @ 8689.
9-20-01: ACIDIZE ABO PERFS FR 8736-8812 W/2000 GALS 15% NEFE ACID. RU SWAB.
9-21-01: REL PKR. TAG @ 8841. NO FILL.
9-24-01: TIH W/PKR & TEST 274 JTS 3 1/2" TBG TO 8000 PSI. SET PKR @ 8650.
9-25-01: FRAC STIMULATE ABO PERFS 8736-8812 W/40,000 GALS YF-140, 27,271 GALS YF-135.
9-26-01: TBG ON VAC. REL PKR. TIH W/BIT, DC'S & TBG. TAG SAND @ 8805.
9-27-01: TAG @ 8805. C/O TO 8841. TIH W/OPMA, PERF SUB, SN, TBG, & TAC. BTM OF STRING @ 8830. SN @ 8794. TAC @ 8600.
9-28-01: TIH W/PMP, GAS ANCHOR, K-BARS, & RDS. LOAD & TEST TO 500-OK. RIG DOWN.
10-09-01: ON 24 HR OPT. PUMPING 14 BO, 57 BW, & 24 MCF.

FINAL REPORT

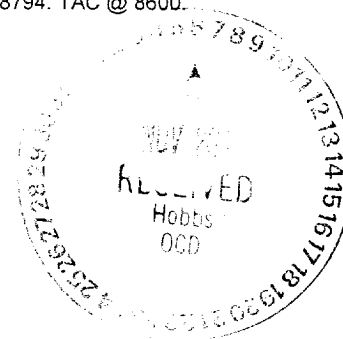

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant DATE 10/31/01
TYPE OR PRINT NAME J. Denise Leake Telephone No. 915-688-4752

(This space for State Use)

APPROVED PAUL F. KAUZ DATE NOV 14 2001
CONDITIONS OF APPROVAL IF ANY: _____ TITLE _____ PETROLEUM ENGINEER

JCS