

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-29858
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	B-1506

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name	Plains Radio State
--------------------------------------	--------------------

1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. Name of Operator Primero Operating, Inc.	8. Well No. 1
3. Address of Operator P.O. Box 1433, Roswell, NM 88202-1433	9. Pool name or Wildcat Undesignated Abo	
4. Well Location Unit Letter <u>E</u> <u>1980</u> Feet From The <u>North</u> Line and <u>660</u> Feet From The <u>East</u> Line Section <u>23</u> Township <u>17S</u> Range <u>35E</u> NM/PM Lea County	10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3929.7 GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: Acidize Abo and repair casing leak ☐	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work): SEE RULE 1103.

11/3/97: Acidize existing Abo perforations 9591-9617 w/ 3,000 gallons of 20% NEFE
11/3-11/97: Swab test Abo
11/6/97: Found holes in 5 1/2" casing between 5006' and 5441'.
11/7/97: Place RBP @ 7043'
11/8/97: Set cement retainer @ 4973'. Squeeze casing w/ 300 sx Class C cement.
11/10-11/97: Drill out retainer and cement, test casig to 1000 psi OK.
11/23/97: Put Abo formation on pump.
12/15/97: Re-acidize Abo w/ 1500 gallons 20% NEFE and return to production.


I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE <u>[Signature]</u>	TITLE <u>President</u>	DATE <u>1/24/98</u>
TYPE OR PRINT NAME <u>Phelps White</u>	TELEPHONE NO. <u>505-622-1111</u>	

(This space for State Use)

ORIGINAL SIGNED BY CHRIS WILLIAMS
DISTRICT I SUPERVISOR

APPROVED BY _____	TITLE _____	DATE _____
CONDITIONS OF APPROVAL, IF ANY:		

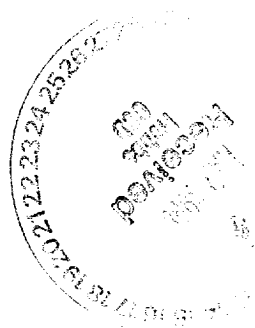

31957