

Submit 3 copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-30970
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	B-1056-1
7. Lease Name or Unit Agreement Name	VACUUM GLORIETA WEST UNIT
8. Well No.	48
9. Pool Name or Wildcat	VACUUM GLORIETA
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3990' GL

SUNDY NOTICES AND REPORTS ON WELL
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	TEXACO EXPLORATION & PRODUCTION INC.
3. Address of Operator	P.O. BOX 730, HOBBS, NM 88240
4. Well Location	Unit Letter <u>P</u> : <u>815</u> Feet From The <u>SOUTH</u> Line and <u>800</u> Feet From The <u>EAST</u> Line Section <u>25</u> Township <u>17S</u> Range <u>34E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3990' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ ADDED PAY AND ACIDIZED

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5/26/94 - 6/4/94

1. MIRU. TOH W/ RODS, TBG, & PMP. TAGGED @ 6299' (PBDT), NO FILL. SET RBP @ 6285' & SET PKR @ 6156', LOADED BS W/ FW & TSTD CSG TO 300 PSI FOR 30 MIN ON CHART, HELD OK.
 2. ACIDIZED PERFS FR 6166'-6175' W/ 1500 GALS 20% NEFE HCL & 1 DRUM OF TW-425, MAX P = 3800#, AIR = 4 BPM. SI 1 HR, SWABBED BACK.
 3. TOH W/ RBP & PKR. RAN GR/CORRELATION LOG. PERFD W/ 2 SPF FR 5995'-6050' (56FT - 112 HLES).
 4. SPTD150 GALS 20% NEFE HCL FR 6050'-5995', SET PKR @ 5747', SQZD ACID INTO FORMATION, SI 1 HR, LOADED BS W/ FW.
 5. ACIDIZED PERFS FR 5995'-6050' W/ 5500 GALS 20% NEFE HCL, MAX P = 3800#, AIR = 3.9 BPM. SI 1 HR. SWABBED BACK.
 6. SCALED SQZD W/ 2 DRUMS TH-793 IN 30 BFW, OVERFLUSHED W/ 200 BFW. TOH W/ RBP & PKR.
 7. TIH W/ RODS, TBG, & PMP. RETURNED WELL TO PRODUCTION.
- OPT 6/12/94 34 BOPD, 309 BWPD, 30 MCFD

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Monte C. Duncan TITLE Engr Asst

DATE 8/30/94

TYPE OR PRINT NAME Monte C. Duncan

Telephone No. 397-0418


(This space for State Use)

APPROVED BY _____ TITLE _____


Orig. Signed by
Paul Nichols
C. Nichols

DATE SEP 01 1994

CONDITIONS OF APPROVAL, IF ANY:

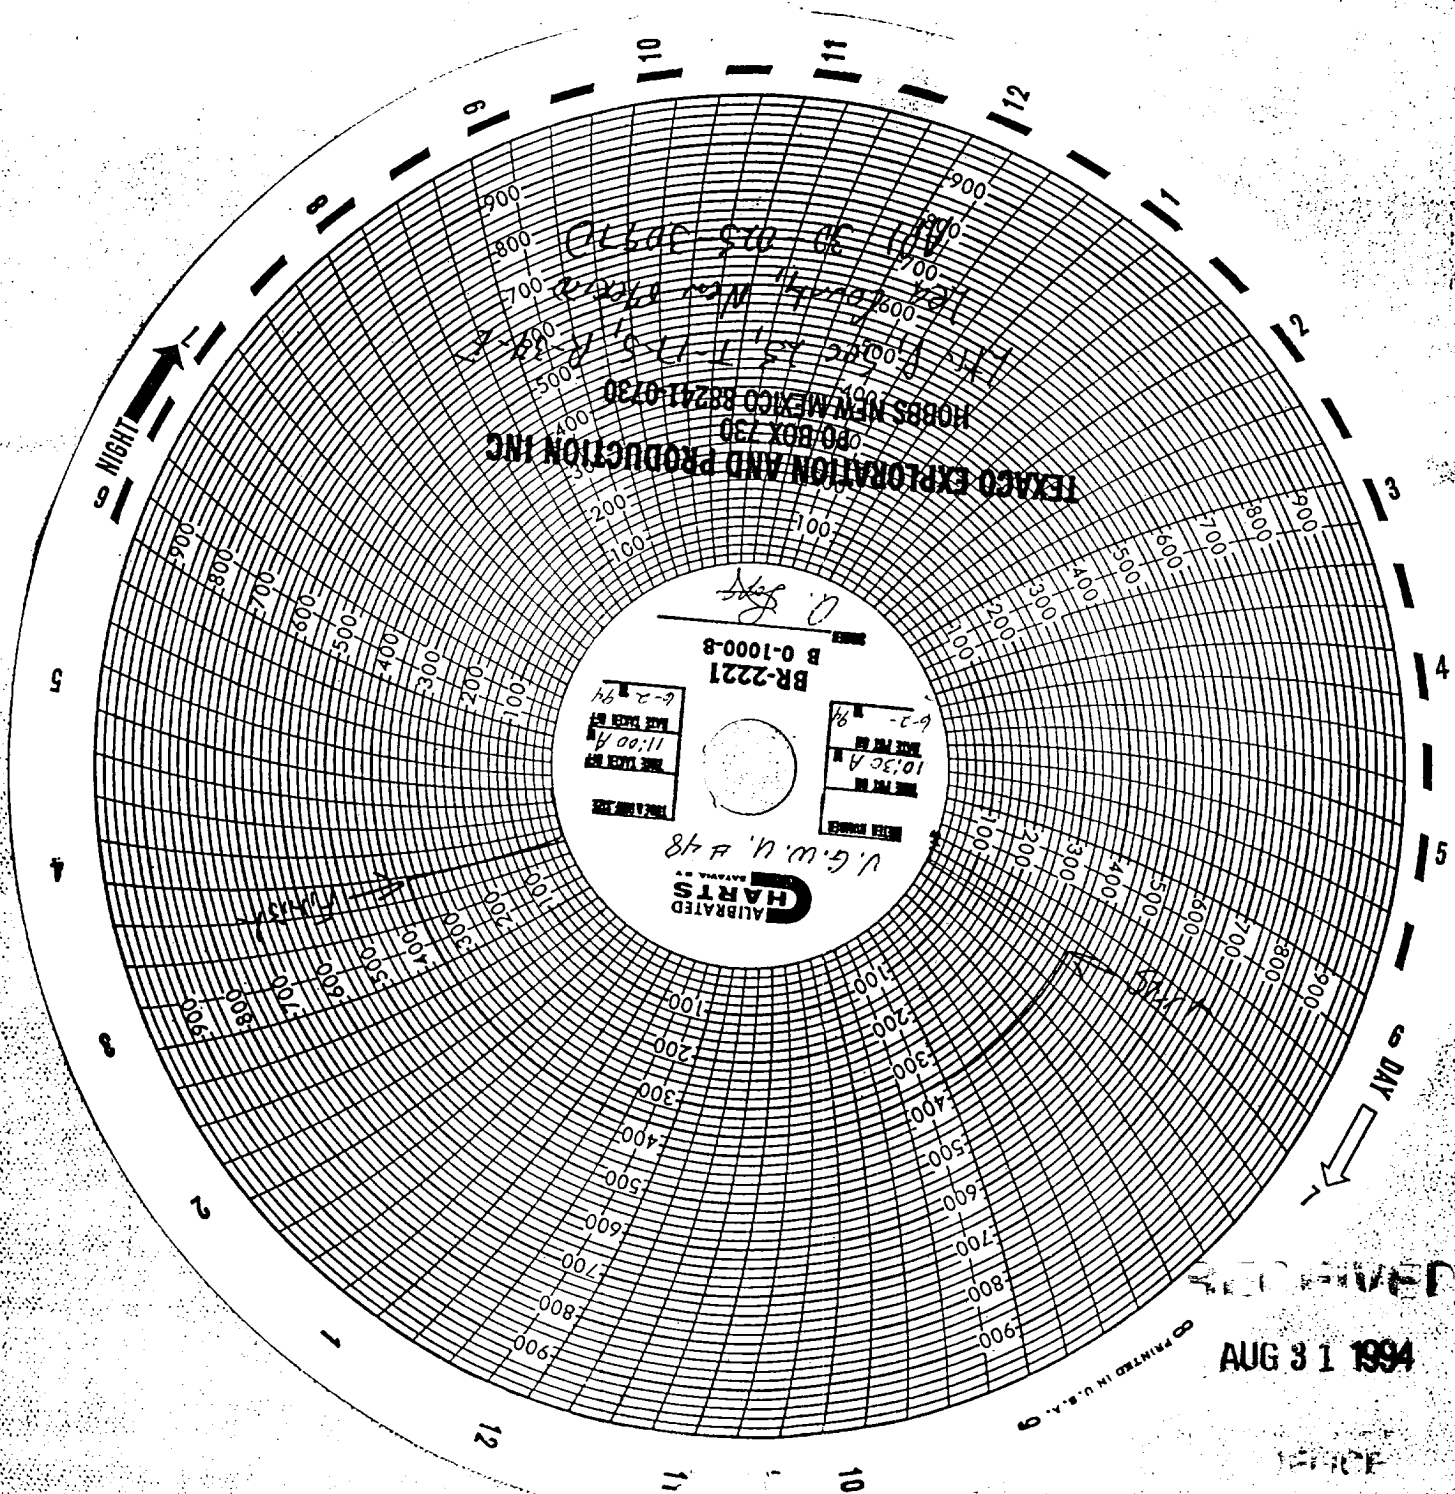

PRINTED IN U.S.A.

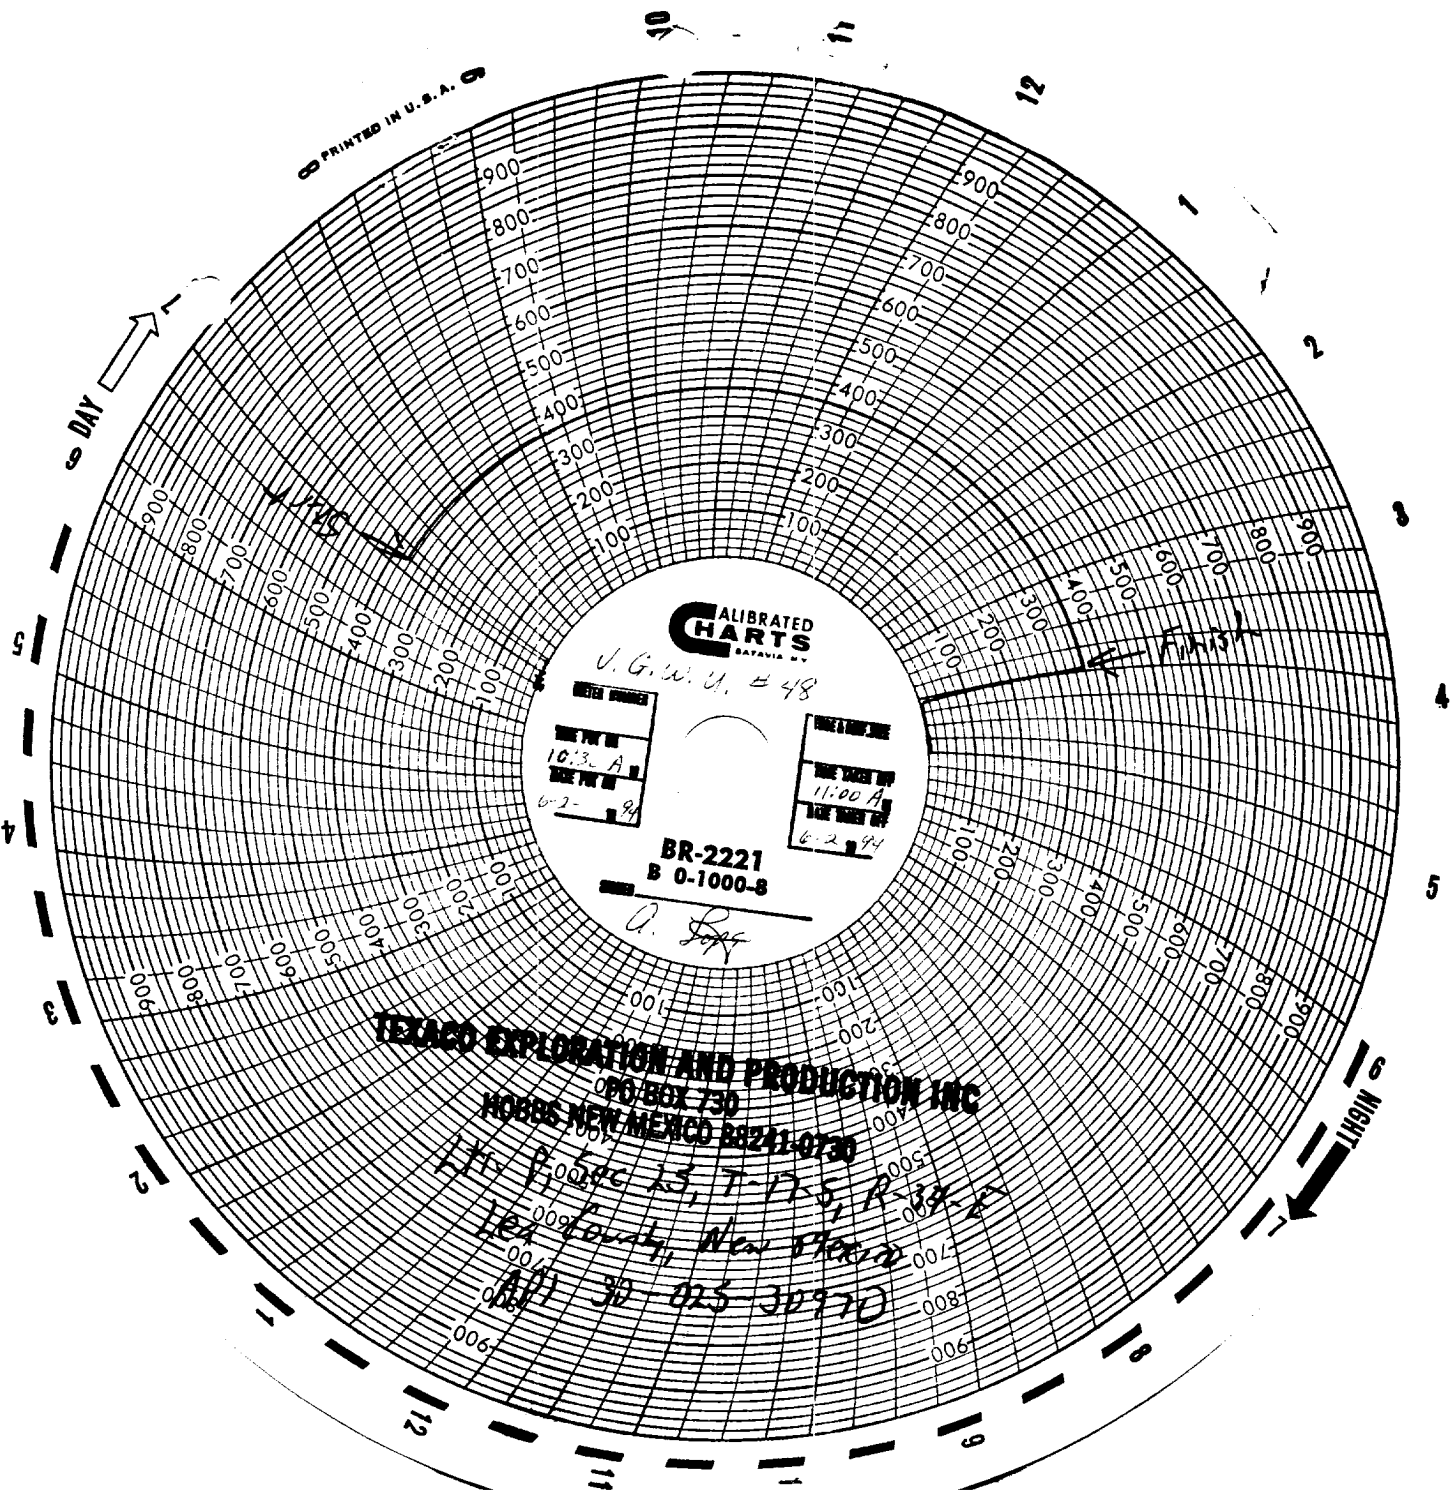

DATE 6/2/94
WELL NAME Vacuum Blowers West Unit #48
SUPERVISOR Edis Hewley / Don Gannett Relief
PACKER TYPE _____
PACKER SETTING DEPTH 5747'
PERFORATIONS 6050' - 5995'