

Submit 3 copies
to Appropriate
District Office

State of New Mexico
Enr Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-31701
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil / Gas Lease No.	B-2706
7. Lease Name or Unit Agreement Name	VACUUM GLORIETA WEST UNIT
8. Well No.	40
9. Pool Name or Wildcat	VACUUM GLORIETA
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	4001' GR

SUNDY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well: OIL WELL ☐ GAS WELL ☐ OTHER WATER INJECTION

2. Name of Operator
TEXACO EXPLORATION & PRODUCTION INC.

3. Address of Operator
205 E. Bender, HOBBS, NM 88240

4. Well Location
Unit Letter K : 1590 Feet From The SOUTH Line and 2404 Feet From The WEST Line
Section 25 Township 17S Range 34E NMPM LEA COUNTY

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ REPERF, ACIDIZE, CONVERT TO INJ

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5-15-00: MIRU. NDWH. NUBOP. UNSET PKR. TIH W/BIT.
5-16-00: TAG @ 5944'. C/O TO 6052'. TIH W/PKR, SN ON TBG. STOP PKR @ 3150'.
5-17-00: TIH W/TBG & PKR TO 5901'. SET PKR. TEST CSG & PKR TO 500#-OK. UNSET PKR.
5-18-00: TIH W/CMT RET ON TBG TO 5892'. SET RET @ 5892'. TEST TBG TO 2000#-OK. SQZ GLORIETA PERFS 6002-6040 W/100 SX CL C. TIH W/BIT, DC'S ON TBG TO 3285'.
5-19-00: TIH W/BIT & TAG @ 5896'. DRILL CMT 5896-5901. DRILL RET 5901-03. DRILL HARD CMT 5903-5992. DISPL HLE W/130 BBLS CLEAN 2% KCL WTR.
5-22-00: RUN CCL & GR. TIH W/CSG GUN & PERF GLORIETA FORM 5880-90, 5904-54, 5960-74. TIH W/PKR, SN ON TBG PSA 5804'. PRESS BACKSIDE TO 500#-OK.
5-23-00: ACIDIZE GLORIETA PERFS 5880-5974 W/7500 GALS 15% NEFE HCL. RU SWAB. FL @ SURF., END FL @ 5700'. SWAB DRY.
5-24-00: FL @ 4000'. UNSET PKR. LOWER TBG & TAG SALT FILL @ 5942'. WASH OUT SALT 5942-5992' PBD. PULL PKR TO 5804 & RESET. UNSET PKR.
5-25-00: TIH W/PKR, TBG NIP. PKR SWINGING @ 5830'. SET PKR @ 5830'. TEST TO 500#. NDBOP. NU INJ HDR.
5-26-00: PRESS TEST CSG & PKR TO 550 PSI. ON CHART FOR NMOC-OK. RIG DOWN.
6-19-00: ON 24 HR OPT; INJ'G 657B BWPD @ 1525 PSI.
FINAL REPORT

Bill Pritchard - OCS - has the chart

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. Denise Leake TITLE Engineering Assistant

DATE 6/26/00

TYPE OR PRINT NAME J. Denise Leake

Telephone No. 397-0405


(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL IF ANY: _____ TITLE _____

DATE _____

DeSoto/Nichols 12-93 ver 1.0

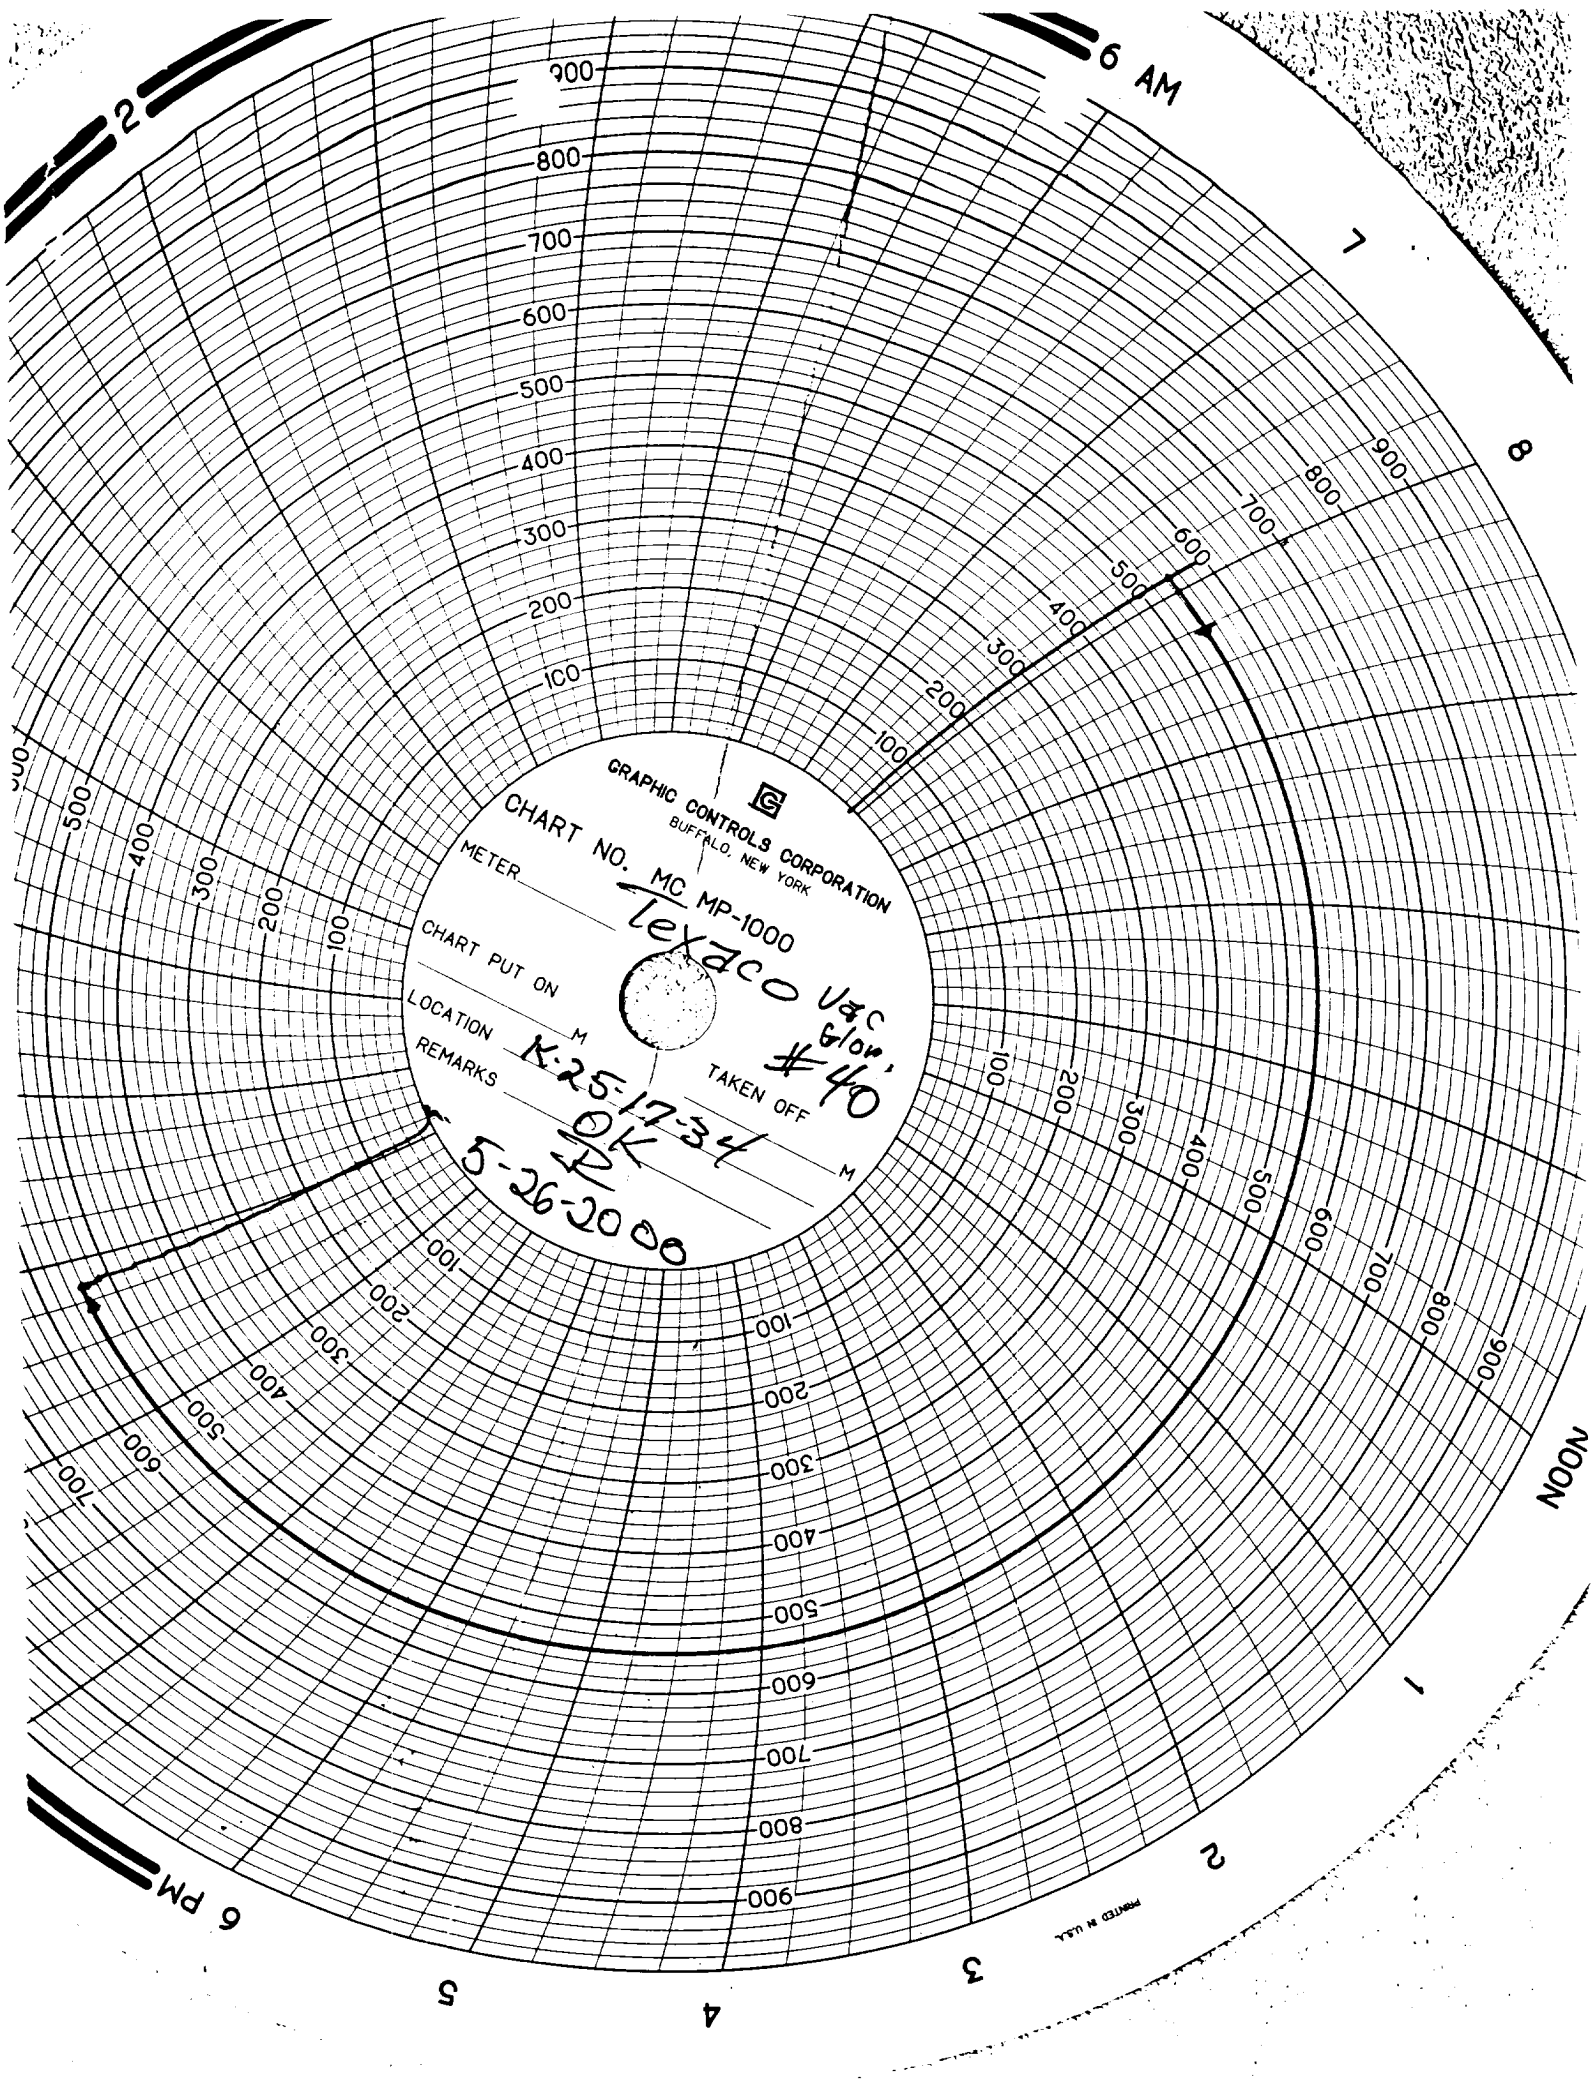

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK

CHART NO. MC MP-1000

METER

CHART PUT ON

LOCATION

REMARKS

Lexaco VAC
6/10/40
#40

TAKEN OFF

K-25-17-34

OK
5-26-2000

PRINTED IN U.S.A.