

District I
1625 N. French Dr., Hobbs, NM 87240
District II
811 South First, Artesia, NM 87210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

WELL API NO.
30-025-07701

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:
HOBBS SWD

8. Well No.
P-16

9. Pool name or Wildcat
SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☐ Gas Well ☐ Other SWD Well

2. Name of Operator
RICE OPERATING COMPANY

3. Address of Operator
122 W. TAYLOR, HOBBS, NM 88240

4. Well Location
Unit Letter P : 660 feet from the SOUTH line and 660 feet from the EAST line
Section 16 Township 19S Range 38E NMPM LEA County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3588' GL; 3604' KB

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST / CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

P&A PROCEDURE in RESPONSE to NM UIC LETTER 12-01-99 to INSTALL INJECTION PACKER

January 8, 2001: Rig up pulling unit, POOH w/ 130 jts 4 1/2" tbg
GIH w/ workstring, 8 5/8" packer, RBP. Set RBP @ 4100' and circulate oil blanket out. POOH. GIH and tag @ 6988'.
Pump salt gel mud (166 bbls 9.5# brine w/25# gel/bbl) to load hole from tag depth to 4226'.
Pull up to 4226' and pump 7 bbls cement for cement plug across casing shoe (50' below; 50' above shoe) Pull up; WOC.
Tag top of cement plug across casing shoe. Did not tag. NMOCD requested to pump the plug again. Repeated. Still no tag.
NMOCD approved setting a retainer. POOH. GIH w/ cement retainer to 4168' and set. Pump 3 bbls cement and 24 bbls FW.
Sting-out of retainer. Pump 201 bbls gel mud to displace hole. Pump 4 bbls cement on top of retainer. WOC. Tag @ 4101'.
Pull up to 1574' and pump 7 bbls cement, 9bbl mud for cement plug across top of Anhydrite zone 1574'-1686'. Pull up to 252'.
Pump 7 bbls cement, 2 bbl mud for cement plug across surface casing shoe. WOC. Tag cement @ 230'. Plug is 230-342'.
Pull up to 62'. Pump 7 bbls cement. POOH. WOC. After overnight, Cement plug is 4" below surface.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Carolyn Doran Haynes TITLE OPERATIONS ENGINEER DATE January 23, 2001

Type or print name CAROLYN DORAN HAYNES Telephone No. 505-393-9174

(This space for State use)


APPROVED BY [Signature] TITLE MAN 3 0 2003

Conditions of approval, if any:
OC FIELD REPRESENTATIVE II/STAFF MANAGER

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

HOBBS SWD WELL P-16

660' FSL & 660' FEL, Sec 16, T19S, R38E, Lea County, New Mexico

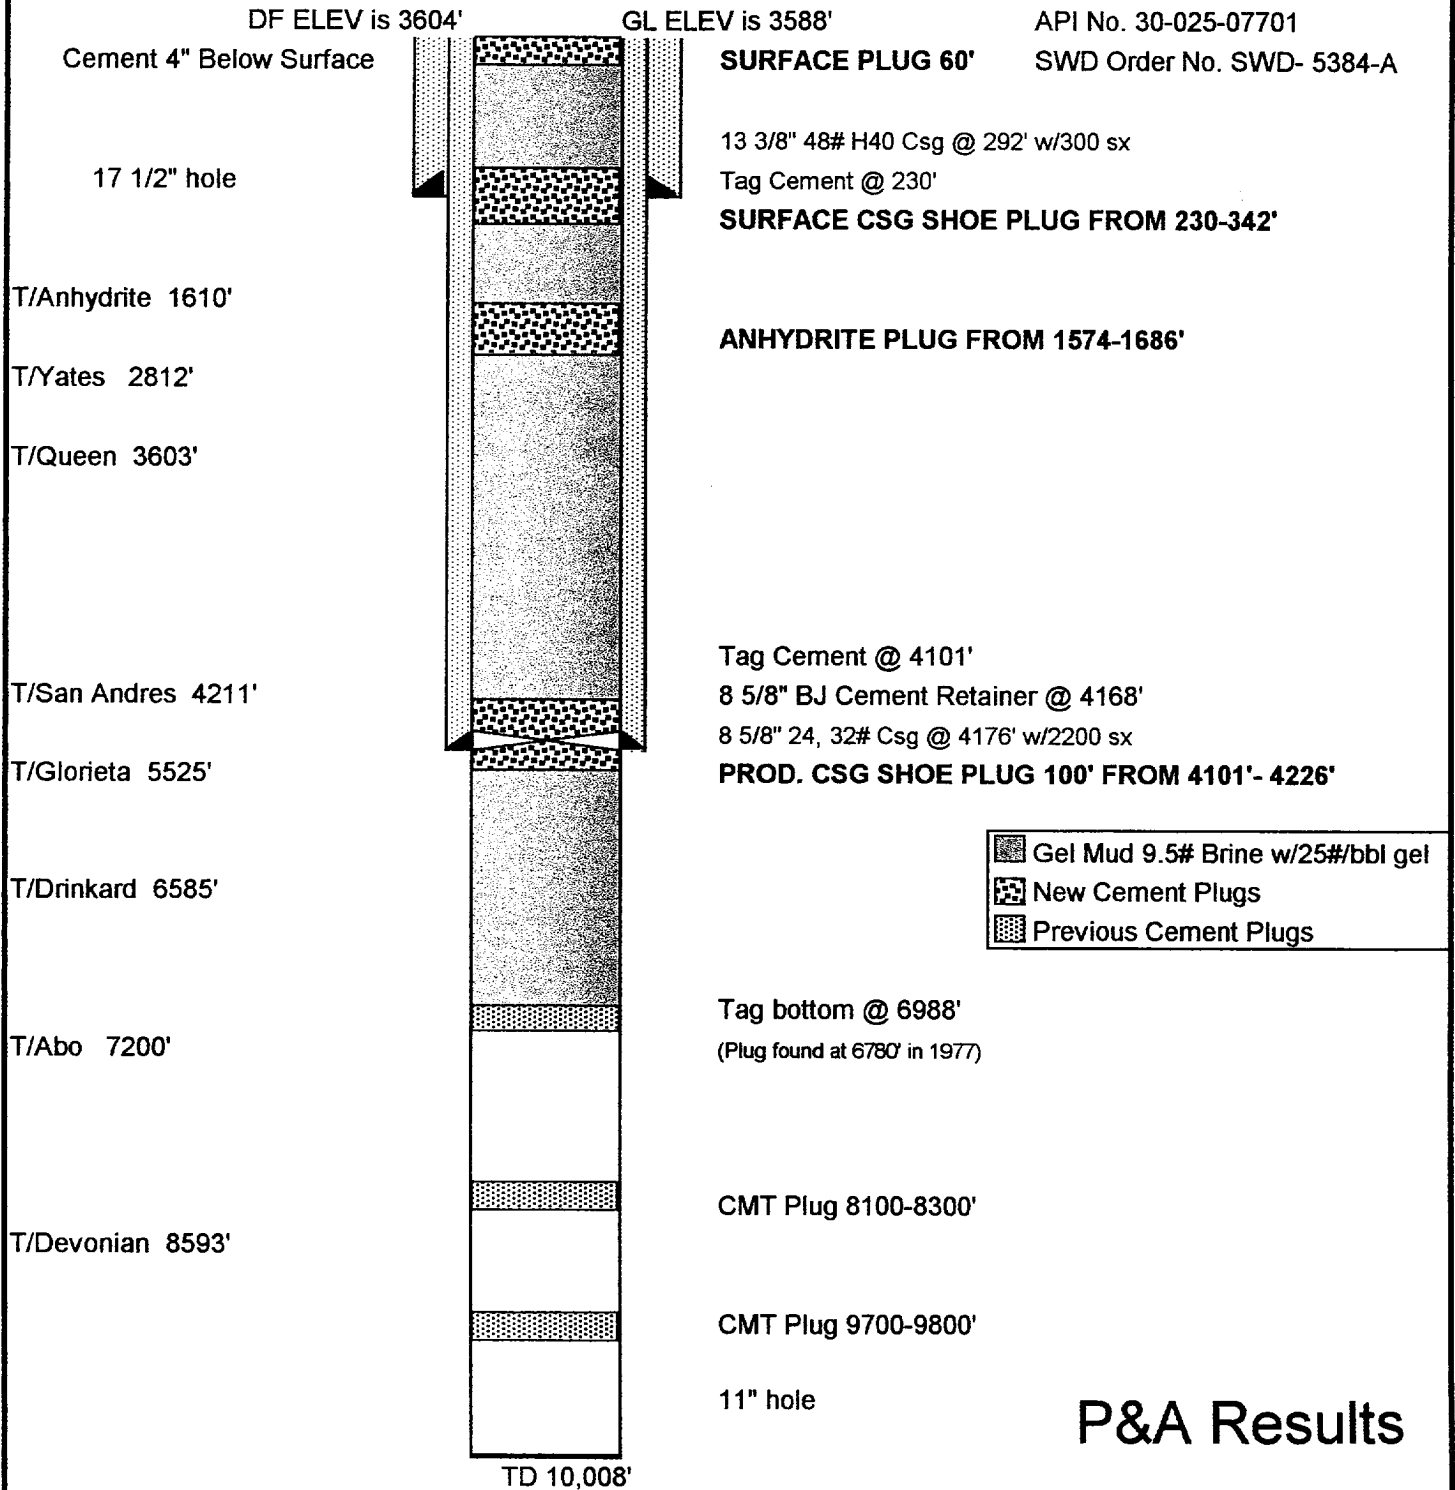

Drawn	BY	RICE OPERATING COMPANY 122 West Taylor Hobbs, New Mexico 88240	Hobbs SWD P-16 660' FSL & 660' FEL SEC 16, T19S, R38E Lea County New Mexico
10/27/00	CDH		
1/23/01	CDH		